




# OIL ANALYSIS REPORT

## Sample Rating Trend

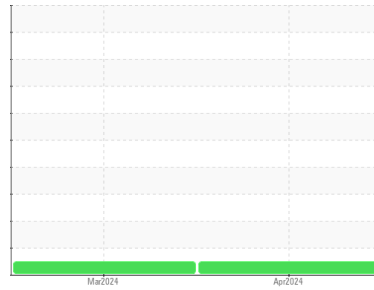

**NORMAL**



Area

**Assy F-18/Rig 12**

Machine Id  
**DEC 2646**

Component

**Hydraulic System**

Fluid

**MILITARY MIL-H-83282C (--- GAL)**

### DIAGNOSIS

#### Recommendation

Resample at the next service interval to monitor.  
NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

#### Wear

All component wear rates are normal.

#### Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

#### Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			<b>WC0926853</b>	WC0920415	---
Sample Date	Client Info			<b>03 Apr 2024</b>	12 Mar 2024	---
Machine Age	hrs	Client Info		<b>0</b>	0	---
Oil Age	hrs	Client Info		<b>0</b>	0	---
Oil Changed	Client Info			<b>N/A</b>	N/A	---
Sample Status				<b>NORMAL</b>	NORMAL	---

CONTAMINATION		method	limit/base	current	history1	history2
Water	WC Method		>0.05	<b>NEG</b>	NEG	---

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	<b>0</b>	0	---
Chromium	ppm	ASTM D5185(m)	>20	<b>0</b>	0	---
Nickel	ppm	ASTM D5185(m)	>20	<b>0</b>	0	---
Titanium	ppm	ASTM D5185(m)		<b>0</b>	0	---
Silver	ppm	ASTM D5185(m)		<b>0</b>	0	---
Aluminum	ppm	ASTM D5185(m)	>20	<b>0</b>	<1	---
Lead	ppm	ASTM D5185(m)	>20	<b>0</b>	0	---
Copper	ppm	ASTM D5185(m)	>20	<b>0</b>	<1	---
Tin	ppm	ASTM D5185(m)	>20	<b>0</b>	0	---
Antimony	ppm	ASTM D5185(m)		<b>0</b>	0	---
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	---
Beryllium	ppm	ASTM D5185(m)		<b>0</b>	0	---
Cadmium	ppm	ASTM D5185(m)		<b>0</b>	0	---





ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		<b>&lt;1</b>	0	---
Barium	ppm	ASTM D5185(m)		<b>0</b>	0	---
Molybdenum	ppm	ASTM D5185(m)		<b>0</b>	0	---
Manganese	ppm	ASTM D5185(m)		<b>0</b>	0	---
Magnesium	ppm	ASTM D5185(m)		<b>0</b>	<1	---
Calcium	ppm	ASTM D5185(m)		<b>3</b>	2	---
Phosphorus	ppm	ASTM D5185(m)		<b>752</b>	778	---
Zinc	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	---
Sulfur	ppm	ASTM D5185(m)		<b>7</b>	0	---
Lithium	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	---

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	<b>0</b>	0	---
Sodium	ppm	ASTM D5185(m)		<b>0</b>	0	---
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	<1	---

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	<b>830</b>	412	---
Particles >6µm		ASTM D7647	>1300	<b>209</b>	95	---
Particles >14µm		ASTM D7647	>160	<b>18</b>	5	---
Particles >21µm		ASTM D7647	>40	<b>6</b>	2	---
Particles >38µm		ASTM D7647	>10	<b>1</b>	0	---
Particles >71µm		ASTM D7647	>3	<b>0</b>	0	---
Oil Cleanliness		ISO 4406 (c)	>19/17/14	<b>17/15/11</b>	16/14/10	---



# OIL ANALYSIS REPORT

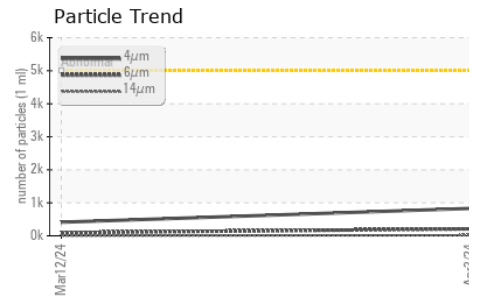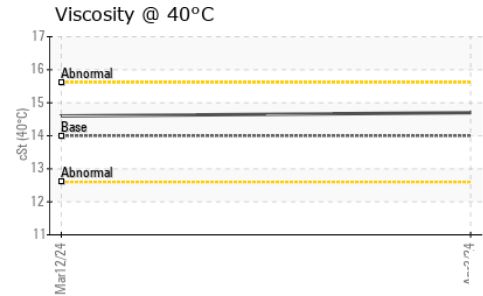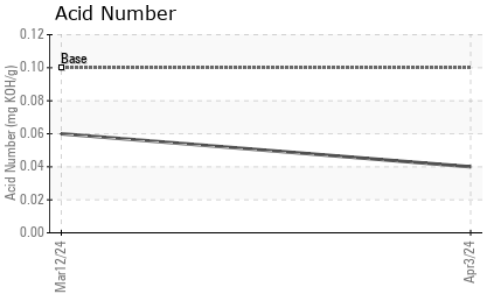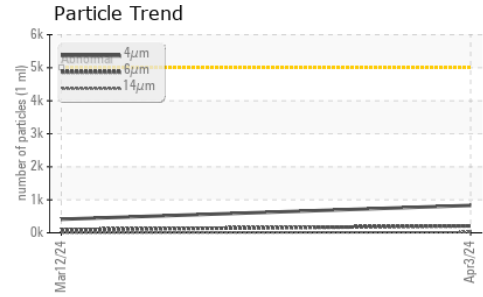


FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*	0.1	<b>0.04</b>	0.06	---





VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	---
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	---
Precipitate	scalar	Visual*	NONE	<b>NONE</b>	NONE	---
Silt	scalar	Visual*	NONE	<b>NONE</b>	NONE	---
Debris	scalar	Visual*	NONE	<b>NONE</b>	NONE	---
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	---
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	---
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	---
Emulsified Water	scalar	Visual*	>0.05	<b>NEG</b>	NEG	---
Free Water	scalar	Visual*		<b>NEG</b>	NEG	---

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	14.0	<b>14.7</b>	14.6	---

### SAMPLE IMAGES

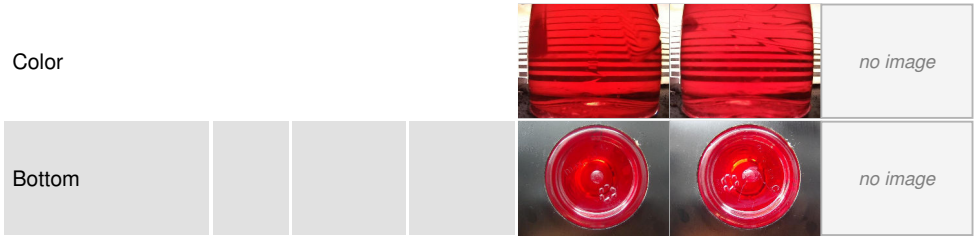

### GRAPHS

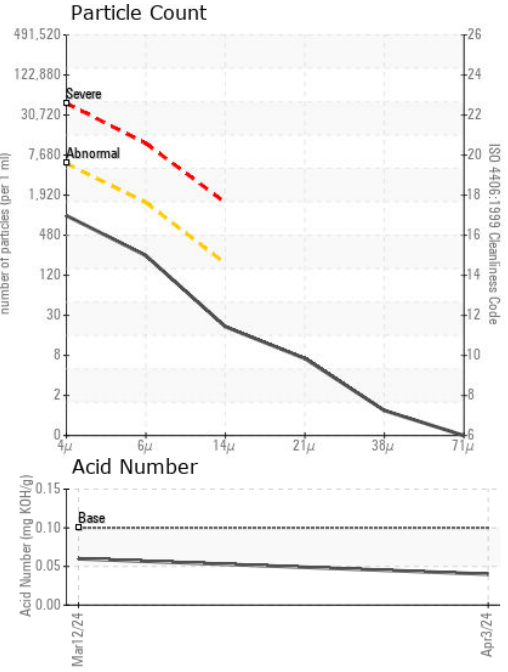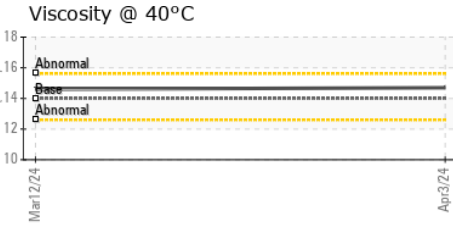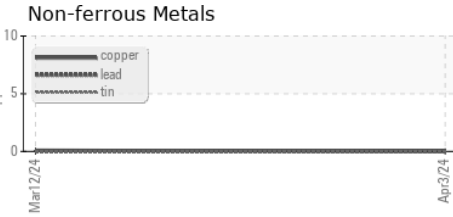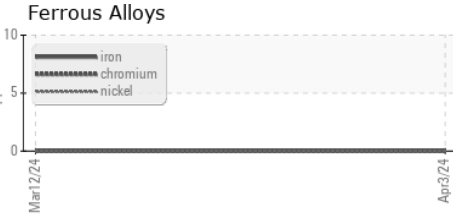

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : WC0926853 **Received** : 04 Apr 2024  
**Lab Number** : **02626607** **Tested** : 05 Apr 2024  
**Unique Number** : 5759739 **Diagnosed** : 05 Apr 2024 - Wes Davis  
**Test Package** : IND 2 ( Additional Tests: TAN Man )

**Safran Landing Systems**  
 574 Monarch Ave  
 Ajax, ON  
 CA L1S 2G8  
 Contact: Stuart Potter  
 stuart.potter@safrangroup.com  
 T:  
 F: (905)683-6983

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.