




# OIL ANALYSIS REPORT

Sample Rating Trend

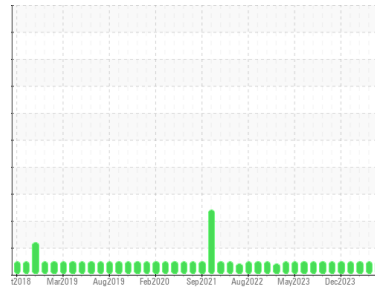

**NORMAL**



Area  
**PUMPHOUSE/SVS MOTOR & FAN**  
 Machine Id  
**D - SVS Motor Lube System-west**  
 Component  
**Lube System**  
 Fluid  
**PETRO CANADA HYDREX AW 32 (45 GAL)**

## DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.

### Wear

All component wear rates are normal.

### Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

### Fluid Condition

The oil viscosity is higher than typical. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

## SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		<b>WC0934083</b>	WC0926494	WC0910457
Sample Date	Client Info		<b>15 Apr 2024</b>	22 Mar 2024	16 Feb 2024
Machine Age	hrs	Client Info	<b>0</b>	0	0
Oil Age	hrs	Client Info	<b>0</b>	0	0
Oil Changed	Client Info		<b>N/A</b>	N/A	N/A
Sample Status			<b>NORMAL</b>	NORMAL	NORMAL

## CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>5	<b>NEG</b>	NEG	NEG

## WEAR METALS

	method	limit/base	current	history1	history2
PQ	ASTM D8184*	>DFLT	<b>0</b>	0	0
Iron	ppm	ASTM D5185(m) >20	<b>&lt;1</b>	<1	<1
Chromium	ppm	ASTM D5185(m) >20	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m) >20	<b>&lt;1</b>	0	0
Titanium	ppm	ASTM D5185(m)	<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)	<b>0</b>	0	0
Aluminum	ppm	ASTM D5185(m) >20	<b>0</b>	0	<1
Lead	ppm	ASTM D5185(m) >20	<b>6</b>	5	6
Copper	ppm	ASTM D5185(m) >20	<b>15</b>	16	16
Tin	ppm	ASTM D5185(m) >20	<b>3</b>	3	3
Antimony	ppm	ASTM D5185(m)	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)	<b>0</b>	0	0
Beryllium	ppm	ASTM D5185(m)	<b>0</b>	0	0
Cadmium	ppm	ASTM D5185(m)	<b>0</b>	0	0

## ADDITIVES






	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m) 0	<b>0</b>	0	0
Barium	ppm	ASTM D5185(m) 0	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185(m) 0	<b>0</b>	0	0
Manganese	ppm	ASTM D5185(m) 0	<b>0</b>	0	0
Magnesium	ppm	ASTM D5185(m) 0	<b>&lt;1</b>	1	1
Calcium	ppm	ASTM D5185(m) 50	<b>84</b>	86	87
Phosphorus	ppm	ASTM D5185(m) 330	<b>354</b>	361	377
Zinc	ppm	ASTM D5185(m) 430	<b>481</b>	479	479
Sulfur	ppm	ASTM D5185(m) 760	<b>3313</b>	3452	3808
Lithium	ppm	ASTM D5185(m)	<b>&lt;1</b>	<1	<1

## CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m) >15	<b>0</b>	0	3
Sodium	ppm	ASTM D5185(m)	<b>&lt;1</b>	<1	<1
Potassium	ppm	ASTM D5185(m) >20	<b>&lt;1</b>	<1	<1



# OIL ANALYSIS REPORT

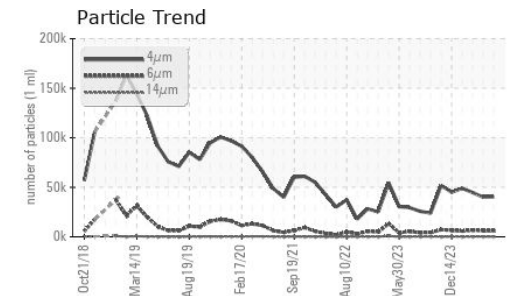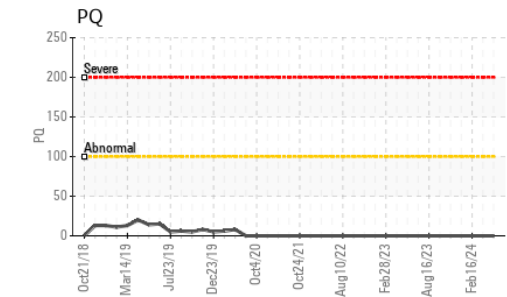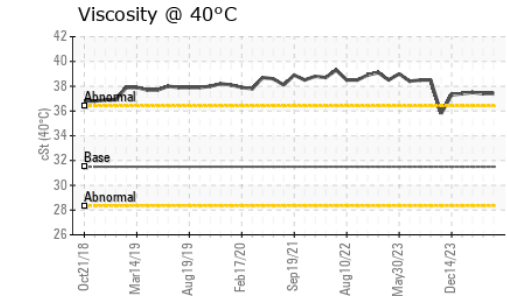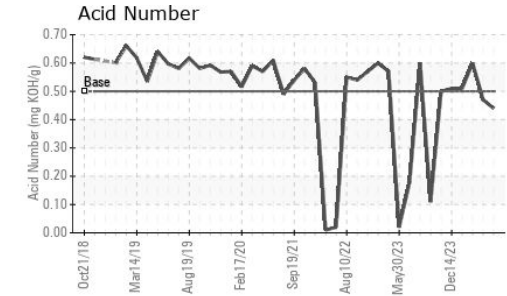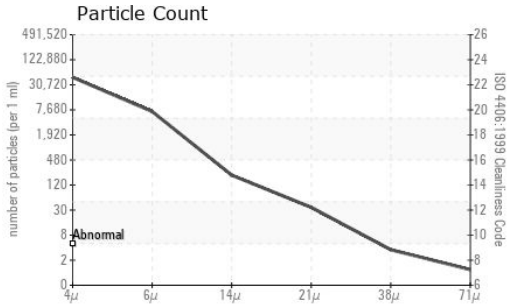

FLUID CLEANLINESS	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647		<b>40301</b>	40027	44774
Particles >6µm	ASTM D7647	>10240000	<b>6109</b>	5922	6672
Particles >14µm	ASTM D7647	>10240000	<b>183</b>	257	231
Particles >21µm	ASTM D7647	>25600000	<b>31</b>	62	47
Particles >38µm	ASTM D7647	>6400000	<b>3</b>	3	4
Particles >71µm	ASTM D7647	>1600000	<b>1</b>	0	1
Oil Cleanliness	ISO 4406 (c)	>--/30/30	<b>23/20/15</b>	23/20/15	23/20/15


FLUID DEGRADATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g ASTM D974*	0.50	<b>0.44</b>	0.47	0.60

VISUAL	method	limit/base	current	history1	history2
White Metal	scalar Visual*	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar Visual*	NONE	<b>NONE</b>	NONE	NONE
Precipitate	scalar Visual*	NONE	<b>NONE</b>	NONE	NONE
Silt	scalar Visual*	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar Visual*	NONE	<b>NONE</b>	NONE	VLITE
Sand/Dirt	scalar Visual*	NONE	<b>VLITE</b>	NONE	NONE
Appearance	scalar Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar Visual*	>5	<b>NEG</b>	.2%	NEG
Free Water	scalar Visual*		<b>NEG</b>	NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt ASTM D7279(m)	31.5	<b>37.4</b>	37.4	37.5

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

Color



Bottom



**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : WC0934083  
**Lab Number** : 02629209  
**Unique Number** : 5762341  
**Test Package** : IND 2 ( Additional Tests: PQ )

**STELCO - BOSC - Basic Oxygen Slab Caster**  
 2330 Regional Road #3, Door: BOSC8  
 NANTICOKE, ON  
 CA N0A 1L0  
 Contact: Tom Walden  
 Thomas.Walden@stelco.com  
 T: (519)587-4541  
 F: (519)587-7702

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.