


# **OIL ANALYSIS REPORT**

Area
RONI
Machine la 184 Component Swing Drive

PETRO CANADA 30W (--- GAL)

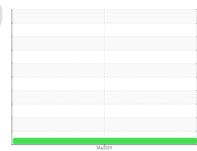

Sample Rating Trend



### Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the


### **Fluid Condition**

The condition of the oil is acceptable for the time in service.

				Mar2024		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0920806		
Sample Date		Client Info		23 Mar 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
CONTAMINATIO	V	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>400	44		
Chromium	ppm	ASTM D5185(m)	>10	<1		
Nickel	ppm	ASTM D5185(m)	>10	0		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>25	<1		
Lead	ppm	ASTM D5185(m)	>50	0		
Copper	ppm	ASTM D5185(m)	>200	<1		
Tin	ppm	ASTM D5185(m)	>10	0		
Antimony	ppm	ASTM D5185(m)	>5	0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		39		
Barium	ppm	ASTM D5185(m)		<1		
Molybdenum	ppm	ASTM D5185(m)		<1		
Manganese	ppm	ASTM D5185(m)		<1		
Magnesium	ppm	ASTM D5185(m)		403		
Calcium	ppm	ASTM D5185(m)		2131		
Phosphorus	ppm	ASTM D5185(m)		991		
Zinc	ppm	ASTM D5185(m)		936		
Sulfur	ppm	ASTM D5185(m)		5546		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>50	11		
Sodium	ppm	ASTM D5185(m)		<1		
Potassium	ppm	ASTM D5185(m)	>20	<1		




## **OIL ANALYSIS REPORT**

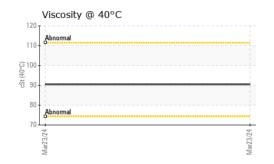

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	NONE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	VLITE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
<b>Emulsified Water</b>	scalar	Visual*	>0.2	NEG		
Free Water	scalar	Visual*		NEG		
FLUID PROPERT	TES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)		90.5		

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color				no image	no image
Bottom				no image	no image
CDADUC					

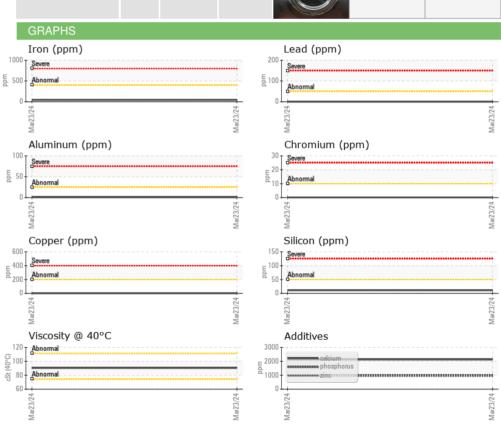



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number : 02629308

: WC0920806 Unique Number : 5762440

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 RONI/IRON SHORE EXCAVATING LTD. Received **Tested** 

: 16 Apr 2024 Diagnosed

: 16 Apr 2024

: 16 Apr 2024 - Wes Davis

100 MACINTOSH BLVD VAUGHAN, ON CA L4K 4P3

Contact: Service Team service.team@roni.ca

To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test Package : MOBCE ( Additional Tests: Visual )

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

T:

F: