


OIL ANALYSIS REPORT

6-3-359 Bypass Baghouse Fan North

Component Gearbox

MOBIL SHC 630 (100 LTR)

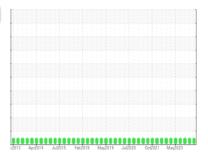

Sample Rating Trend



Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0925345	WC0902043	WC0869888
Sample Date		Client Info		09 Apr 2024	15 Feb 2024	23 Nov 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINATION	J	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
PQ		ASTM D8184*		0	0	0
Iron	ppm	ASTM D5185(m)	>200	0	0	<1
Chromium	ppm	ASTM D5185(m)	>15	0	0	0
Nickel	ppm	ASTM D5185(m)	>15	0	0	<1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	0	<1
Aluminum	ppm	ASTM D5185(m)	>25	0	<1	0
Lead	ppm	ASTM D5185(m)	>100	0	0	0
Copper	ppm	ASTM D5185(m)	>200	0	<1	<1
Tin	ppm	ASTM D5185(m)	>25	0	0	0
Antimony	ppm	ASTM D5185(m)	>5	0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	0.3	0	0	<1
Barium	ppm	ASTM D5185(m)	0.0	0	0	<1
Molybdenum	ppm	ASTM D5185(m)	0.0	0	0	0
Manganese	ppm	ASTM D5185(m)	0.0	0	0	0
Magnesium	ppm	ASTM D5185(m)	0.1	0	<1	0
Calcium	ppm	ASTM D5185(m)	0.0	0	0	<1
Phosphorus	ppm	ASTM D5185(m)	864	400	413	395
Zinc	ppm	ASTM D5185(m)	2.0	1	1	1
Sulfur	ppm	ASTM D5185(m)	36	71	42	71
Lithium	ppm	ASTM D5185(m)		<1	<1	<1
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>50	0	<1	<1
Sodium	ppm	ASTM D5185(m)		0	<1	<1
Potassium	ppm	ASTM D5185(m)	>20	<1	<1	0
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*	0.45	0.30	0.40	0.35



OIL ANALYSIS REPORT

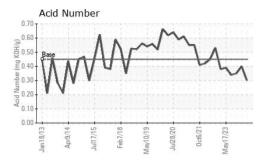

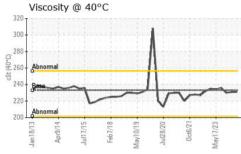


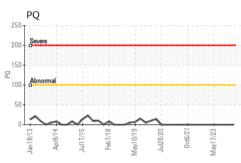

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	VLITE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG	NEG
FLUID PROPERT	TIES	method	limit/base	current	history1	history2

FLUID PROPERI	IES	method			history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	233	231	231	230

SAMPLE IMAGES	method		history2
Color			
Bottom			

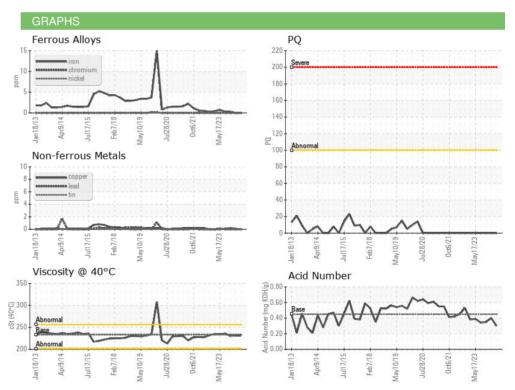





Laboratory Sample No. Lab Number : 02629351

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : WC0925345

Received **Tested** Diagnosed

: 16 Apr 2024

: 17 Apr 2024

: 17 Apr 2024 - Wes Davis

Unique Number : 5762483 Test Package : IND 2 (Additional Tests: TAN Man)

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

ST. MARYS CEMENT CO.

400 BOWMANVILLE AVENUE BOWMANVILLE, ON **CA L1C 7B5**

Contact: Lou Traiforos lou.traiforos@vcimentos.com

> T: (905)440-5874 F: (905)623-4695

> > Submitted By: ?