

OIL ANALYSIS REPORT

Area **STRATH**Machine Id

BABBIT BRG PEDESTAL B BALL MILL NON DRIVE END

Non-Drive End Bearing

PETRO CANADA TURBOFLO R&O 68 (8 GAL)





Recommendation

Resample at the next service interval to monitor.

Lead ppm levels are noted. All other component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.


Fluid Condition


The condition of the oil is acceptable for the time in service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0904127	WC0897570	WC0866180
Sample Date		Client Info		02 Apr 2024	04 Mar 2024	09 Jan 2024
Machine Age	mths	Client Info		0	0	0
Oil Age	mths	Client Info		6	6	0
Oil Changed		Client Info		Changed	Not Changd	Not Changd
Sample Status				ATTENTION	ATTENTION	ATTENTION
CONTAMINATION	V	method	limit/base	current	history1	history2
Water		WC Method	>2	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	0	0	0
Chromium	ppm	ASTM D5185(m)	>20	0	0	0
Nickel	ppm	ASTM D5185(m)	>20	0	0	0
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	0	0
Aluminum	ppm	ASTM D5185(m)	>20	0	0	<1
Lead	ppm	ASTM D5185(m)	>20	106	104	1 05
Copper	ppm	ASTM D5185(m)	>20	0	<1	<1
Tin	ppm	ASTM D5185(m)	>20	0	0	0
Antimony	ppm	ASTM D5185(m)		0	<1	<1
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		0	0	0
Barium	ppm	ASTM D5185(m)		0	0	0
Molybdenum	ppm	ASTM D5185(m)		0	0	0
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)		<1	0	<1
Calcium	ppm	ASTM D5185(m)	0	<1	1	1
Phosphorus	ppm	ASTM D5185(m)	4	5	4	5
Zinc	ppm	ASTM D5185(m)	0	1	1	1
Sulfur	ppm	ASTM D5185(m)		153	156	152
Lithium	ppm	ASTM D5185(m)		<1	<1	<1
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	0	0	0
Sodium	ppm	ASTM D5185(m)		<1	0	0
Potassium	ppm	ASTM D5185(m)	>20	0	<1	1




OIL ANALYSIS REPORT

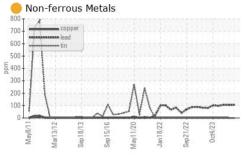

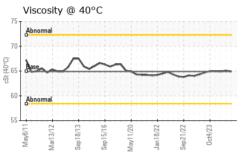



VISUAL						
White Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>2	NEG	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG	NEG
ELLID DDADEDT	IEC	اه و ملخو مور	line it/le e e e	aa.	la la tament	history (O
FLUID PROPERT	IES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	64.9	64.9	65.1	64.9
SAMPLE IMAGES		method	limit/base	current	historv1	history2


Color

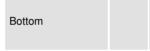



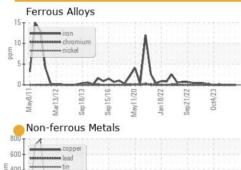

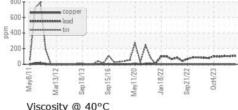

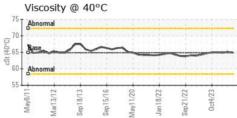





Laboratory Sample No.

Test Package : IND 1

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Wajax - Northpoint Technical Services : WC0904127 Lab Number : 02629954

Unique Number : 5763086

Received **Tested** Diagnosed

: 18 Apr 2024 : 18 Apr 2024

: 18 Apr 2024 - Kevin Marson

1108 WebbWood Drive.

Sudbury, ON CA P3C 3B7 Contact: Nick Walker

nwalker@northpoints.com T: (705)499-2387

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

F: (795)690-9010 Contact/Location: Nick Walker - CENSUD