

# **OIL ANALYSIS REPORT**

Sample Rating Trend

NORMAL

#### Machine Id

# KUBOTA 1140 100014501

Component Diesel Engine Fluid SAE 15W40 (--- GAL)

#### DIAGNOSIS

# Recommendation

Resample at the next service interval to monitor.

## Wear

All component wear rates are normal.

## Contamination

There is no indication of any contamination in the oil.

## Fluid Condition

The condition of the oil is acceptable for the time in service.

SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0930773		
Sample Date		Client Info		09 May 2024		
Machine Age	hrs	Client Info		5282		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
CONTAMINATION	٧	method	limit/base	current	history1	history2
Fuel		WC Method	>5	<1.0		
Water		WC Method	>0.2	NEG		
Glycol		WC Method		NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>100	41		
Chromium	ppm	ASTM D5185(m)	>20	<1		
Nickel	ppm	ASTM D5185(m)	>4	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)	>3	0		
Aluminum	ppm	ASTM D5185(m)	>20	6		
Lead	ppm	ASTM D5185(m)	>40	0		
Copper	ppm	ASTM D5185(m)	>330	2		
Tin	ppm	ASTM D5185(m)	>15	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		36		
Barium	ppm	ASTM D5185(m)		0		
Molybdenum	ppm	ASTM D5185(m)		42		
Manganese	ppm	ASTM D5185(m)		<1		
Magnesium	ppm	ASTM D5185(m)		536		
Calcium	ppm	ASTM D5185(m)		1862		
Phosphorus	ppm	ASTM D5185(m)		735		
Zinc	ppm	ASTM D5185(m)		911		
Sulfur	ppm	ASTM D5185(m)		2031		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>25	12		
Sodium	ppm	ASTM D5185(m)	>57	4		
Potassium	ppm	ASTM D5185(m)	>20	1		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*	>3	0.6		
Nitration	Abs/cm	ASTM D7624*	>20	11.1		
Sulfation	Abs/.1mm	ASTM D7415*	>30	26.3		





# **OIL ANALYSIS REPORT**





## Viscosity @ 100°C

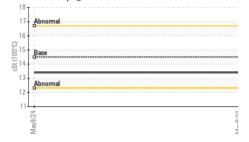

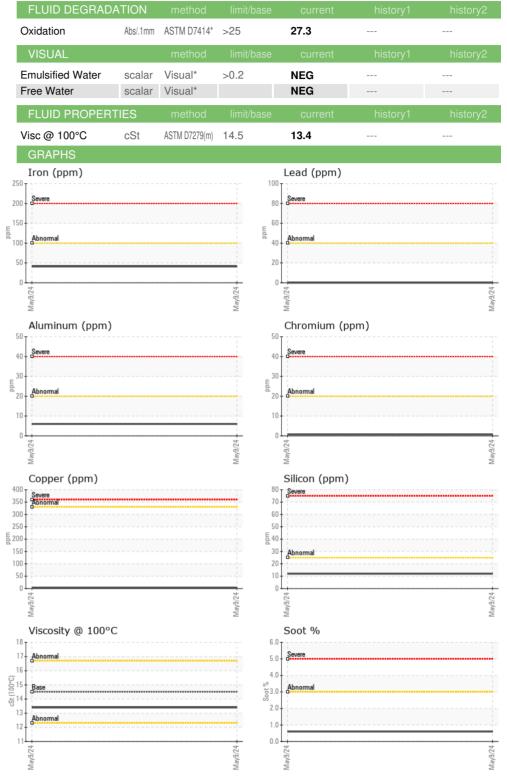

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Agnico Eagle Canada CALA 1350 Government Rd. W, MACASSA COMPLEX Sample No. : WC0930773 Received : 11 Jun 2024 Lab Number : 02641017 Tested : 11 Jun 2024 Kirkland Lake, ON ISO 17025:2017 Accredited Unique Number : 5798556 Diagnosed : 11 Jun 2024 - Kevin Marson CA P2N 3J1 Laboratory Test Package : MOB 1 Contact: Mitch Lamontagne To discuss this sample report, contact Customer Service at 1-800-268-2131. AEM\_KL\_macassaoilsampleresults@agnicoeagle.com T: (705)567-5208 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied. F: (705)567-5221

Report Id: KIR370KIR [WCAMIS] 02641017 (Generated: 06/11/2024 14:49:37) Rev: 1

Contact/Location: Mitch Lamontagne - KIR370KIR