




OIL ANALYSIS REPORT

Sample Rating Trend

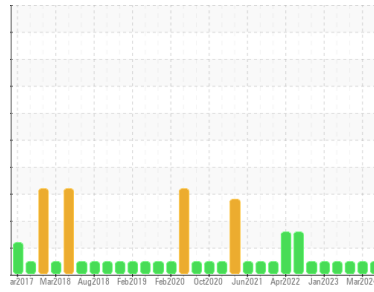

NORMAL



Area

Materials Handling/NE Pedestal Crane
Machine Id
WPD471231 CRANE PEDESTAL NORTH EAST

Component

Main Brake

Fluid

MOBIL MOBILUBE HD 80W90 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.
NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. Please specify the component make and model with your next sample.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the fluid.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the fluid is suitable for further service.

SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	PP13994630	PP	PP13897519
Sample Date	Client Info	26 May 2024	27 Mar 2024	01 Jul 2023
Machine Age	hrs	0	0	0
Oil Age	hrs	0	0	0
Oil Changed	Client Info	N/A	N/A	N/A
Sample Status		NORMAL	NORMAL	NORMAL

CONTAMINATION

method	limit/base	current	history1	history2
Water	WC Method >0.2	NEG	NEG	NEG

WEAR METALS

method	limit/base	current	history1	history2
PQ	ASTM D8184*	0	0	15
Iron	ppm ASTM D5185(m) >350	7	8	6
Chromium	ppm ASTM D5185(m) >5	0	0	0
Nickel	ppm ASTM D5185(m) >5	0	0	0
Titanium	ppm ASTM D5185(m)	0	0	0
Silver	ppm ASTM D5185(m)	0	0	0
Aluminum	ppm ASTM D5185(m) >8	0	0	<1
Lead	ppm ASTM D5185(m) >10	0	0	0
Copper	ppm ASTM D5185(m) >150	5	3	3
Tin	ppm ASTM D5185(m) >5	0	0	0
Antimony	ppm ASTM D5185(m) >5	0	0	0
Vanadium	ppm ASTM D5185(m)	0	0	0
Beryllium	ppm ASTM D5185(m)	0	0	0
Cadmium	ppm ASTM D5185(m)	0	0	0

ADDITIVES

method	limit/base	current	history1	history2
Boron	ppm ASTM D5185(m)	170	175	175
Barium	ppm ASTM D5185(m)	0	0	0
Molybdenum	ppm ASTM D5185(m)	0	0	0
Manganese	ppm ASTM D5185(m)	0	0	0
Magnesium	ppm ASTM D5185(m)	<1	<1	<1
Calcium	ppm ASTM D5185(m)	1	1	2
Phosphorus	ppm ASTM D5185(m)	991	989	1082
Zinc	ppm ASTM D5185(m)	16	4	5
Sulfur	ppm ASTM D5185(m)	24076	24172	21372
Lithium	ppm ASTM D5185(m)	<1	<1	<1

CONTAMINANTS




method	limit/base	current	history1	history2
Silicon	ppm ASTM D5185(m) >400	0	0	2
Sodium	ppm ASTM D5185(m)	6	<1	<1
Potassium	ppm ASTM D5185(m) >20	10	<1	<1

FLUID DEGRADATION

method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g ASTM D974*	1.41	1.50	1.36




OIL ANALYSIS REPORT

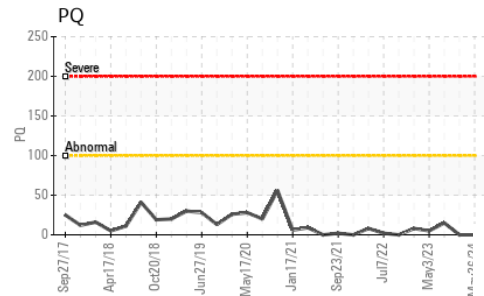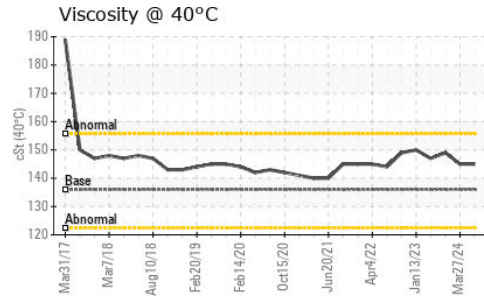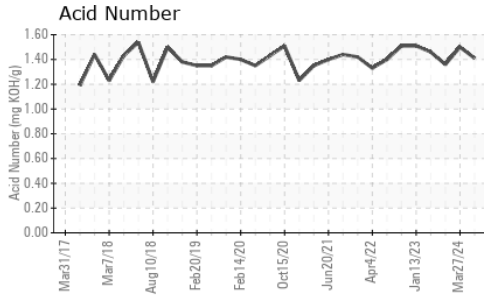






PARAMETER	method	limit/base	current	history1	history2	
White Metal	scalar	Visual*	NONE	VLITE	NONE	VLITE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	VLITE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE	VLITE
Debris	scalar	Visual*	NONE	NONE	VLITE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	136	145	149

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

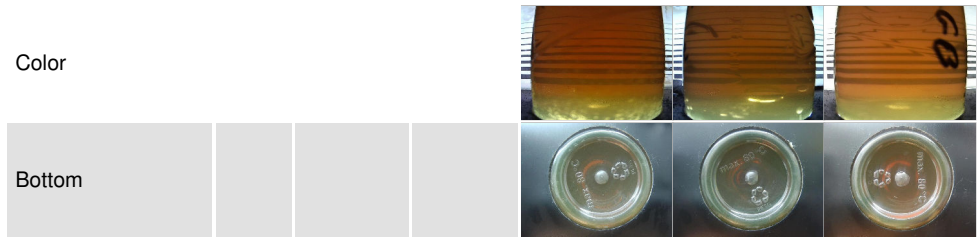

GRAPHS

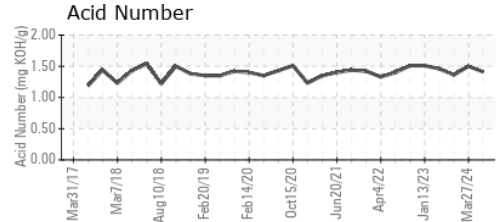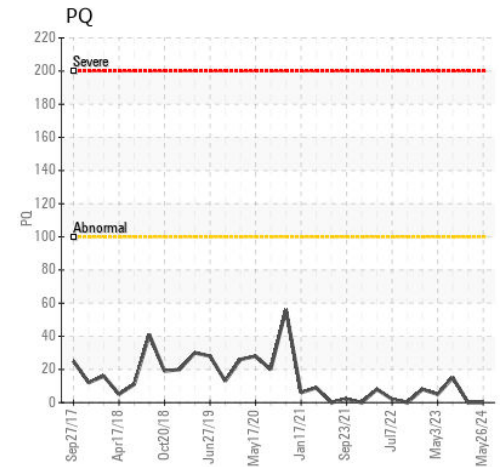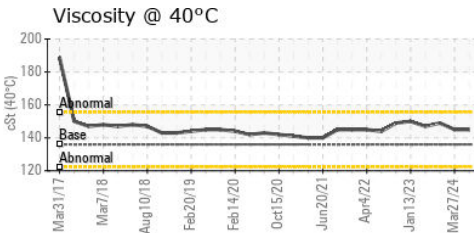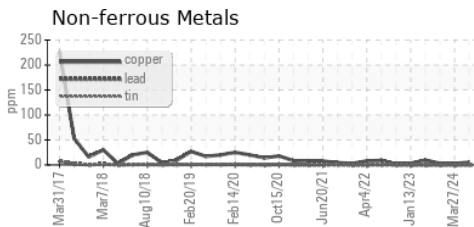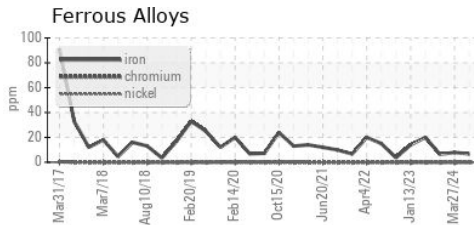

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
 Sample No. : PP13994630 Received : 13 Jun 2024
 Lab Number : 02641834 Tested : 14 Jun 2024
 Unique Number : 5799373 Diagnosed : 14 Jun 2024 - Kevin Marson
 Test Package : MAR 2 (Additional Tests: TAN Man)

ExxonMobil Canada East Ltd.
 Hebron-Materials and Repair Coordin, Suite 1000, 100 New Gow
 St. John's, NL
 CA A1C 6K3
 Contact: Liam Maher
 liam.m.maher@exxonmobil.com
 T: (709)273-3729
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.