

OIL ANALYSIS REPORT


Sample Rating Trend

NORMAL

DOMTAR 321-702-2 [GTT224-445 DOMTAR] TRANE DOMTAR 321-702-2

Chiller

TRANE 0078 (--- GAL)

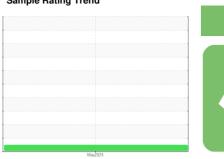



Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

The water content is negligible. There is no indication of any contamination in the oil.

Fluid Condition

The condition of the oil is acceptable for the time in service.

				May2024		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GTT0003265		
Sample Date		Client Info		30 May 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>8	<1		
Chromium	ppm	ASTM D5185(m)	>2	0		
Nickel	ppm	ASTM D5185(m)		<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)	>2	0		
Aluminum	ppm	ASTM D5185(m)	>3	0		
Lead	ppm	ASTM D5185(m)	>2	0		
Copper	ppm	ASTM D5185(m)	>8	<1		
Tin	ppm	ASTM D5185(m)	>4	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		2		
Barium	ppm	ASTM D5185(m)		0		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)		<1		
Calcium	ppm	ASTM D5185(m)		0		
Phosphorus	ppm	ASTM D5185(m)		1695		
Zinc	ppm	ASTM D5185(m)		1		
Sulfur	ppm	ASTM D5185(m)		341		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	13		
Sodium	ppm	ASTM D5185(m)		<1		
Potassium	ppm	ASTM D5185(m)	>20	<1		
ppm Water	ppm	ASTM D6304*	>100	126		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2

Acid Number (AN)

mg KOH/g ASTM D974*

0.01



OIL ANALYSIS REPORT

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	NONE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
SAMPLE IMAGES		method				history2
SAMPLE IMAGES Color		method	limit/base	current	history1 no image	history2 no image
		method	limit/base	current		



Sample No. : GTT0003265 Received : 14 Jun 2024 Lab Number : 02642214 Tested : 24 Jun 2024 Diagnosed : 24 Jun 2024 - Bill Quesnel Unique Number : 5799753 Test Package : IND 2 (Additional Tests: KV40)

To discuss this sample report, contact Customer Service at 1-905-847-9300 Ext 26.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

Damages: Seller shall in no event be liable for special, incidental, or consequential damages, of a commercial nature, resulting from any cause.

Bridair Inc.

4704 boul Bertrand Rock Forest, QC CA J1N 2B1

Contact: Service Manager

T:

F: