



OIL ANALYSIS REPORT

Area
Wegu Can - W00800
 Machine #
A2406113
 Component
Hydraulic System
 Fluid
AW HYDRAULIC OIL ISO 46 (--- GAL)

Sample Rating Trend



DIAGNOSIS

● **Wear**
 Copper ppm levels are noted.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Batch #	Client Info			2024 06 0090	---	---
Department	Client Info			Production	---	---
Sample From	Client Info			Machine	---	---
Production Stage	Client Info			Initial	---	---
Sent to WC	Client Info			06/14/2024	---	---
Sample Number	Client Info			E30002401	---	---
Sample Date	Client Info			14 Jun 2024	---	---
Machine Age	hrs	Client Info		0	---	---
Oil Age	hrs	Client Info		0	---	---
Oil Changed	Client Info			N/A	---	---
Sample Status				ABNORMAL	---	---

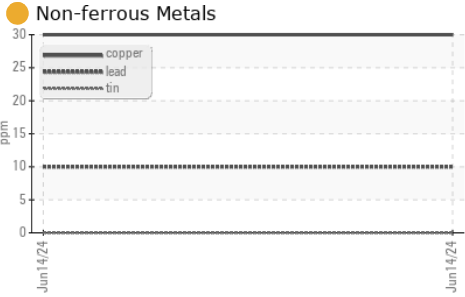
CONTAMINATION		method	limit/base	current	history1	history2
Water	WC Method		>0.05	NEG	---	---

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	16	---	---
Chromium	ppm	ASTM D5185(m)	>10	<1	---	---
Nickel	ppm	ASTM D5185(m)	>10	<1	---	---
Titanium	ppm	ASTM D5185(m)		0	---	---
Silver	ppm	ASTM D5185(m)		<1	---	---
Aluminum	ppm	ASTM D5185(m)	>10	2	---	---
Lead	ppm	ASTM D5185(m)	>20	10	---	---
Copper	ppm	ASTM D5185(m)	>20	● 30	---	---
Tin	ppm	ASTM D5185(m)	>10	0	---	---
Antimony	ppm	ASTM D5185(m)		0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
Beryllium	ppm	ASTM D5185(m)		0	---	---
Cadmium	ppm	ASTM D5185(m)		0	---	---



ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	5	2	---	---
Barium	ppm	ASTM D5185(m)	5	1	---	---
Molybdenum	ppm	ASTM D5185(m)	5	0	---	---
Manganese	ppm	ASTM D5185(m)		<1	---	---
Magnesium	ppm	ASTM D5185(m)	25	29	---	---
Calcium	ppm	ASTM D5185(m)	200	70	---	---
Phosphorus	ppm	ASTM D5185(m)	300	589	---	---
Zinc	ppm	ASTM D5185(m)	370	591	---	---
Sulfur	ppm	ASTM D5185(m)	2500	1978	---	---
Lithium	ppm	ASTM D5185(m)		<1	---	---

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	9	---	---
Sodium	ppm	ASTM D5185(m)		2	---	---
Potassium	ppm	ASTM D5185(m)	>20	1	---	---

OIL ANALYSIS REPORT



VISUAL	method	limit/base	current	history1	history2	
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---
Precipitate	scalar	Visual*	NONE	NONE	---	---
Silt	scalar	Visual*	NONE	NONE	---	---
Debris	scalar	Visual*	NONE	NONE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	▲ WGOIL	---	---
Odor	scalar	Visual*	NORML	NORML	---	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color				no image	no image
Bottom				no image	no image

GRAPHS



Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : E30002401
Lab Number : 02642731
Unique Number : 5800270
Test Package : TEST (Additional Tests: ICP)

Environmental 360 Solutions Ltd.
 640 Victoria Street
 Cobourg, ON
 CA K9A 5H5
 Contact: Tatiana Sorkina
 tsorkina@e360s.ca
 T: (800)263-3939
 F: (905)373-4950

To discuss this sample report, contact Customer Service at 1-905-372-2251.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.