


OIL ANALYSIS REPORT

City of Windsor Transfer Station - 888092 **RB015-R**

Component Hydraulic System

MOBIL DTE 10 EXCEL 46 (--- GAL)

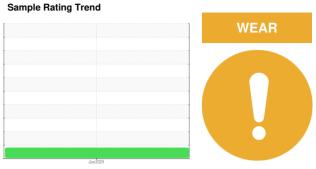

Recommendation

Copper ppm levels are noted. We recommend monitoring these metals' content.

Copper ppm levels are noted.

			•	Jun2024		
CAMPLE INFORM	ATION	on a the a al	live it/le e e e	a	la i a t a .m .ed	٠٠٠ سوماها
SAMPLE INFORM	ATION	method	limit/base	current	history1	history2
Machine ID		Client Info		South Compactor		
Department		Client Info		Sales		
Sample From		Client Info		Machine		
Production Stage		Client Info		Lab Reclaim		
Sent to WC		Client Info		06/19/2024		
Sample Number		Client Info		E30002446		
Sample Date		Client Info		19 Jun 2024		
9	hrs	Client Info		0		
- 9-	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ATTENTION		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	<1		
Chromium	ppm	ASTM D5185(m)	>20	<1		
Nickel	ppm	ASTM D5185(m)	>20	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		<1		
Aluminum	ppm	ASTM D5185(m)	>20	<1		
Lead	ppm	ASTM D5185(m)	>20	<1		
Copper	ppm	ASTM D5185(m)	>20	9 36		
Tin	ppm	ASTM D5185(m)	>20	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		<1		
Barium	ppm	ASTM D5185(m)		0		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		0		
	ppm	ASTM D5185(m)		<1		
	ppm	ASTM D5185(m)		68		
	ppm	ASTM D5185(m)		403		
	ppm	ASTM D5185(m)		104		
	ppm	ASTM D5185(m)		1165		
	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	0		
	ppm	ASTM D5185(m)		<1		
	ppm	ASTM D5185(m)	>20	<1		
	%	ASTM D6304*	>0.05	0.002		
	,0		20.00	0.00E		

ASTM D6304* >500


ppm

17

ppm Water



OIL ANALYSIS REPORT

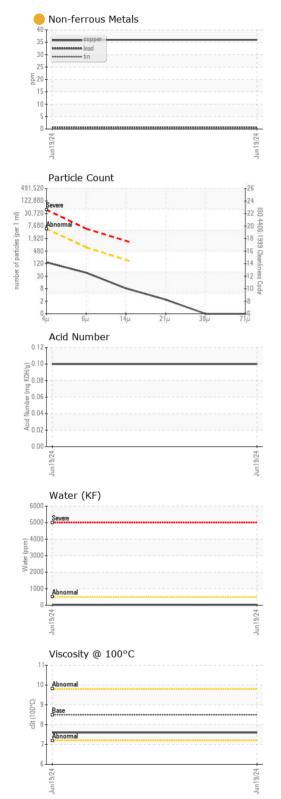

FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	122		
Particles >6µm		ASTM D7647	>640	39		
Particles >14µm		ASTM D7647	>160	7		
Particles >21µm		ASTM D7647	>40	2		
Particles >38µm		ASTM D7647	>10	0		
Particles >71µm		ASTM D7647		0		
Oil Cleanliness		ISO 4406 (c)	>19/16/14	14/12/10		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*		0.10		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	NONE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
Emulsified Water	scalar	Visual*	>0.05	NEG		
Free Water	scalar	Visual*		NEG		
FLUID PROPERT	IES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	45.6	43.0		
Visc @ 100°C	cSt	ASTM D7279(m)	8.5	7.6		
Viscosity Index (VI)	Scale	ASTM D2270*	164	145		
SAMPLE IMAGES	5	method	limit/base	current	history1	history2
Color					no image	no image
Bottom					no image	no image



CALA ISO 17025:2017 Accredited Laboratory

Laboratory

Sample No. Lab Number : 02643416 Unique Number : 5800955

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9

: E30002446

Received **Tested** Diagnosed

: 21 Jun 2024 : 24 Jun 2024

: 25 Jun 2024 - Aylwin Lee

Test Package : IND 2 (Additional Tests: KF, KV100, VI) To discuss this sample report, contact Customer Service at 1-905-372-2251.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

Environmental 360 Solutions Ltd.

640 Victoria Street Cobourg, ON CA K9A 5H5

Contact: Tatiana Sorkina tsorkina@e360s.ca T: (800)263-3939

F: (905)373-4950