




OIL ANALYSIS REPORT

Area
Stadacona - S11900
 Machine Id
A2406140
 Component
Unknown Component
 Fluid
MOBIL SHC 634 (--- GAL)

Sample Rating Trend

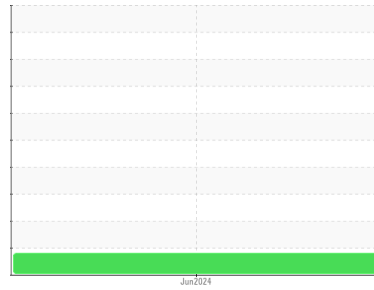

CONTAMINANT



DIAGNOSIS

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Batch #	Client Info			2024 06 0450	---	---
Department	Client Info			Production	---	---
Sample From	Client Info			Machine	---	---
Production Stage	Client Info			Initial	---	---
Sent to WC	Client Info			06/20/2024	---	---
Sample Number	Client Info			E30002489	---	---
Sample Date	Client Info			20 Jun 2024	---	---
Machine Age	hrs	Client Info		0	---	---
Oil Age	hrs	Client Info		0	---	---
Oil Changed	Client Info			N/A	---	---
Sample Status				ABNORMAL	---	---

CONTAMINATION	method	limit/base	current	history1	history2
Water	WC Method		NEG	---	---



WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)		3	---	---
Chromium	ppm	ASTM D5185(m)		0	---	---
Nickel	ppm	ASTM D5185(m)		0	---	---
Titanium	ppm	ASTM D5185(m)		0	---	---
Silver	ppm	ASTM D5185(m)		0	---	---
Aluminum	ppm	ASTM D5185(m)		<1	---	---
Lead	ppm	ASTM D5185(m)		0	---	---
Copper	ppm	ASTM D5185(m)		4	---	---
Tin	ppm	ASTM D5185(m)		<1	---	---
Antimony	ppm	ASTM D5185(m)		0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
Beryllium	ppm	ASTM D5185(m)		0	---	---
Cadmium	ppm	ASTM D5185(m)		0	---	---

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	3.6	<1	---	---
Barium	ppm	ASTM D5185(m)	0.0	0	---	---
Molybdenum	ppm	ASTM D5185(m)	0.0	0	---	---
Manganese	ppm	ASTM D5185(m)		0	---	---
Magnesium	ppm	ASTM D5185(m)	0.0	0	---	---
Calcium	ppm	ASTM D5185(m)	0.4	<1	---	---
Phosphorus	ppm	ASTM D5185(m)	838	343	---	---
Zinc	ppm	ASTM D5185(m)	1.0	2	---	---
Sulfur	ppm	ASTM D5185(m)	386	55	---	---
Lithium	ppm	ASTM D5185(m)		<1	---	---

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)		11	---	---
Sodium	ppm	ASTM D5185(m)		1	---	---
Potassium	ppm	ASTM D5185(m)	>20	2	---	---

OIL ANALYSIS REPORT

VISUAL	method	limit/base	current	history1	history2	
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---
Precipitate	scalar	Visual*	NONE	NONE	---	---
Silt	scalar	Visual*	NONE	NONE	---	---
Debris	scalar	Visual*	NONE	NONE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	▲ HAZY	---	---
Odor	scalar	Visual*	NORML	NORML	---	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color				no image	no image
Bottom				no image	no image

GRAPHS



Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : E30002489 **Received** : 24 Jun 2024
Lab Number : **02643856** **Tested** : 25 Jun 2024
Unique Number : 5801395 **Diagnosed** : 26 Jun 2024 - Aylwin Lee
Test Package : TEST (Additional Tests: ICP)

Environmental 360 Solutions Ltd.
 640 Victoria Street
 Cobourg, ON
 CA K9A 5H5
 Contact: Tatiana Sorkina
 tsorkina@e360s.ca
 T: (800)263-3939
 F: (905)373-4950

To discuss this sample report, contact Customer Service at 1-905-372-2251.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.