

OIL ANALYSIS REPORT

Sample Rating Trend



NORMAL



Machine Id
Q-1703
Component

Component Hydraulic System

SHELL S4 VX ARTIC TELLUS (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

Wear

All component wear rates are normal.

Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Jun2024		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
	IATION		IIIIII/Dase			
Sample Number		Client Info		WC0764344		
Sample Date		Client Info		13 Jun 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
CONTAMINATION	١	method	limit/base	current	history1	history2
Water		WC Method	>0.05	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	<1		
Chromium	ppm	ASTM D5185(m)	>20	0		
Nickel	ppm	ASTM D5185(m)	>20	0		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>20	<1		
Lead	ppm	ASTM D5185(m)	>20	0		
Copper	ppm	ASTM D5185(m)	>20	<1		
Tin	ppm	ASTM D5185(m)	>20	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		<1		
Barium	ppm	ASTM D5185(m)		0		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)		0		
Calcium	ppm	ASTM D5185(m)		<1		
Phosphorus	ppm	ASTM D5185(m)		547		
Zinc	ppm	ASTM D5185(m)		34		
Sulfur	ppm	ASTM D5185(m)		691		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	2		
Sodium	ppm	ASTM D5185(m)		0		
Potassium	ppm	ASTM D5185(m)	>20	0		
FLUID CLEANLIN	ESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	781		
Particles >6µm		ASTM D7647	>1300	229		
Particles >14µm		ASTM D7647	>160	17		
Particles >21µm		ASTM D7647	>40	5		
Particles >38µm		ASTM D7647	>10	1		
Particles >71µm		ASTM D7647	>3	1		
Oil Cleanliness		ISO 4406 (c)	>19/17/14	17/15/11		
		(3)		. ,		



OIL ANALYSIS REPORT

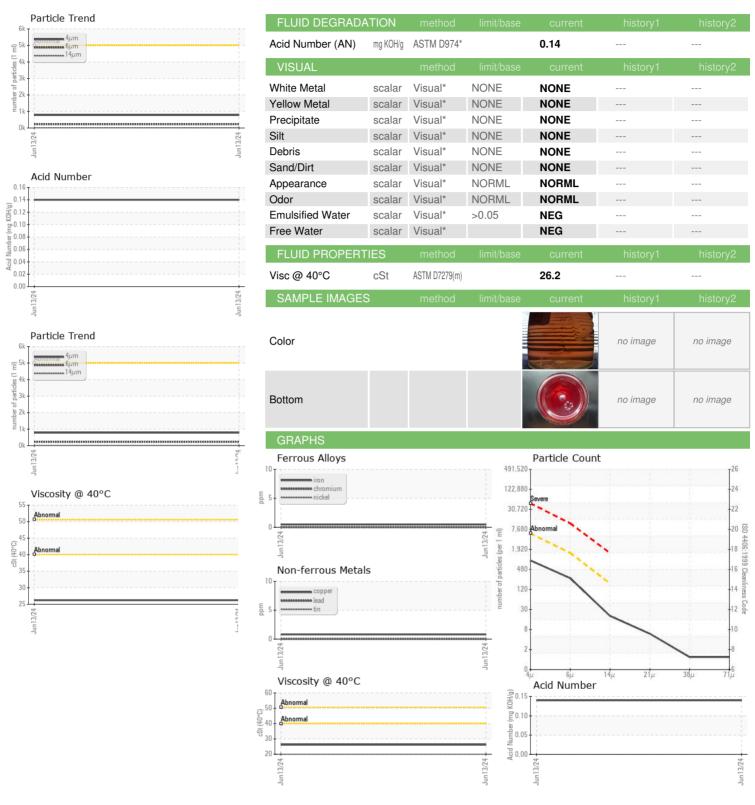



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number Unique Number : 5801915

: WC0764344

: 02644376

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Received

Tested Diagnosed

: 27 Jun 2024 : 28 Jun 2024 : 28 Jun 2024 - Kevin Marson

215 Water Street, Suite 802, PO Box 74 St. John's, NL CA A1C 6C9

Test Package : IND 2 (Additional Tests: TAN Man) To discuss this sample report, contact Customer Service at 1-800-268-2131.

Contact: HMDC Material Control Coordinator hmdc.material.control.coordinator@exxonmobil.com Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. T:

Validity of results and interpretation are based on the sample and information as supplied. Report Id: PAR215STJ [WCAMIS] 02644376 (Generated: 06/28/2024 16:54:28) Rev: 1

Contact/Location: HMDC Material Control Coordinator - PAR215STJ

F:

Parker Wellbore