




# OIL ANALYSIS REPORT

## Sample Rating Trend

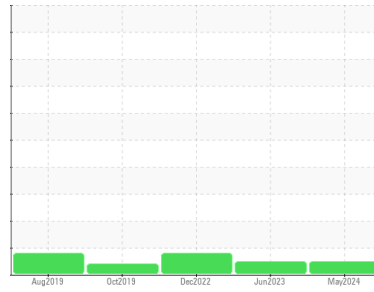

**NORMAL**



Machine Id  
**MPG B (S/N CAHE-V833200B)**  
 Component  
**Hydraulic System**  
 Fluid  
**MOBIL DTE 832 (--- LTR)**

### DIAGNOSIS

#### Recommendation

Resample at the next service interval to monitor.  
 NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

#### Wear

All component wear rates are normal.

#### Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

#### Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			<b>PP14002072</b>	PP13874958	PP13809087
Sample Date	Client Info			<b>30 May 2024</b>	02 Jun 2023	11 Dec 2022
Machine Age	hrs	Client Info		<b>0</b>	0	0
Oil Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed	Client Info			<b>N/A</b>	N/A	N/A
Sample Status				<b>NORMAL</b>	NORMAL	ABNORMAL

CONTAMINATION		method	limit/base	current	history1	history2
Water	WC Method		>0.05	<b>NEG</b>	NEG	NEG

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	<b>0</b>	0	0
Chromium	ppm	ASTM D5185(m)	>10	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	>10	<b>&lt;1</b>	<1	0
Titanium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)		<b>0</b>	0	0
Aluminum	ppm	ASTM D5185(m)	>10	<b>0</b>	<1	0
Lead	ppm	ASTM D5185(m)	>20	<b>0</b>	0	<1
Copper	ppm	ASTM D5185(m)	>20	<b>0</b>	0	<1
Tin	ppm	ASTM D5185(m)	>10	<b>0</b>	0	0
Antimony	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Beryllium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Cadmium	ppm	ASTM D5185(m)		<b>0</b>	0	0





ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		<b>&lt;1</b>	0	<1
Barium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185(m)		<b>0</b>	0	0
Manganese	ppm	ASTM D5185(m)		<b>0</b>	0	0
Magnesium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Calcium	ppm	ASTM D5185(m)		<b>0</b>	<1	0
Phosphorus	ppm	ASTM D5185(m)		<b>1093</b>	1183	2781
Zinc	ppm	ASTM D5185(m)		<b>&lt;1</b>	2	<1
Sulfur	ppm	ASTM D5185(m)		<b>30</b>	0	2
Lithium	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	<1

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	<b>1</b>	1	<1
Sodium	ppm	ASTM D5185(m)		<b>0</b>	<1	6
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	<1	0

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	<b>3616</b>	3931	1261
Particles >6µm		ASTM D7647	>1300	<b>915</b>	640	171
Particles >14µm		ASTM D7647	>160	<b>40</b>	34	21
Particles >21µm		ASTM D7647	>40	<b>12</b>	9	12
Particles >38µm		ASTM D7647	>10	<b>2</b>	1	3
Particles >71µm		ASTM D7647	>3	<b>1</b>	0	1
Oil Cleanliness		ISO 4406 (c)	>19/17/14	<b>19/17/12</b>	19/16/12	17/15/12



# OIL ANALYSIS REPORT

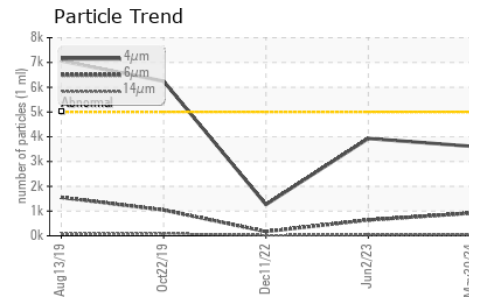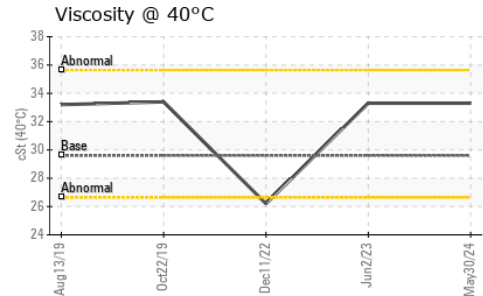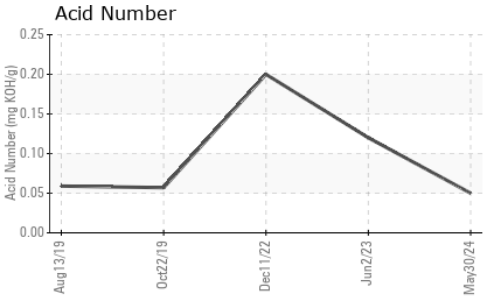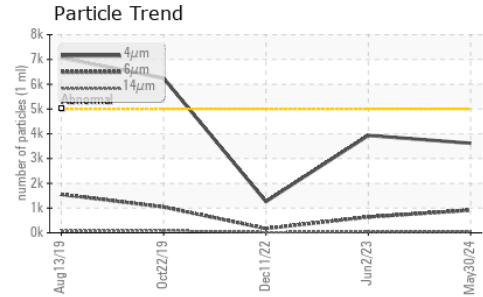


FLUID DEGRADATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*	<b>0.05</b>	0.12	0.20


VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.05	NEG	NEG
Free Water	scalar	Visual*	NEG	NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	<b>33.3</b>	33.3	▲ 26.2

### SAMPLE IMAGES

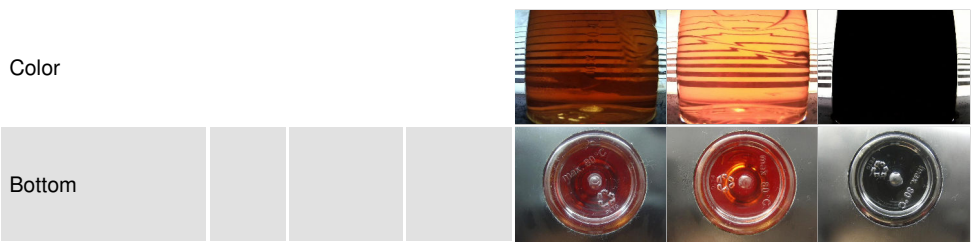

### GRAPHS

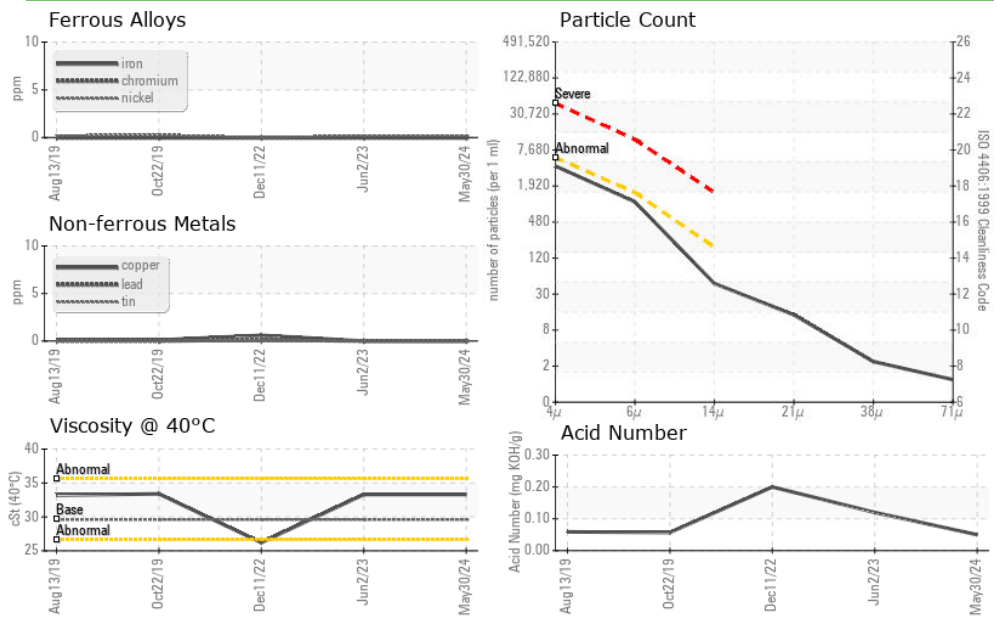

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : PP14002072 **Received** : 27 Jun 2024  
**Lab Number** : **02644386** **Tested** : 28 Jun 2024  
**Unique Number** : 5801925 **Diagnosed** : 28 Jun 2024 - Kevin Marson  
**Test Package** : MAR 2 ( Additional Tests: TAN Man )

**ExxonMobil Canada East Ltd.**  
 Hebron-Materials and Repair Coordin, Suite 1000, 100 New Gow  
 St. John's, NL  
 CA A1C 6K3  
 Contact: Liam Maher  
 liam.m.maher@exxonmobil.com  
 T: (709)273-3729  
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.