


OIL ANALYSIS REPORT

Area 8th Ave. Place Ch#2 [GTT224-466 863309] **MCQUAY STNU090700020** Chiller



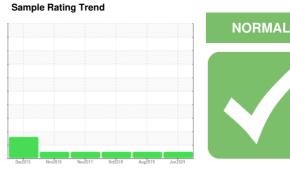

EMKARATE RL 32H (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

The water content is negligible. There is no indication of any contamination in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GTT0002715	GTT74242	GTT74243
Sample Date		Client Info		18 Jun 2024	19 Aug 2019	09 Oct 2018
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>100	4	1	<1
Chromium	ppm	ASTM D5185(m)	>2	0	<1	<1
Nickel	ppm	ASTM D5185(m)		<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)	>2	0		
Aluminum	ppm	ASTM D5185(m)	>50	1	<1	<1
Lead	ppm	ASTM D5185(m)	>2	0	<1	<1
Copper	ppm	ASTM D5185(m)	>100	8	9	6
Tin	ppm	ASTM D5185(m)	>4	<1	<1	<1
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	0	1		
Barium	ppm	ASTM D5185(m)	0	0		
Molybdenum	ppm	ASTM D5185(m)	0	0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)	0	<1		
Calcium	ppm	ASTM D5185(m)	0	<1		
Phosphorus	ppm	ASTM D5185(m)	5	2		
Zinc	ppm	ASTM D5185(m)	10	6	4	3
Sulfur	ppm	ASTM D5185(m)	50	52		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>50	3		
Sodium	ppm	ASTM D5185(m)		<1		
Potassium	ppm	ASTM D5185(m)	>20	1		
ppm Water	ppm	ASTM D6304*	>400	387	125	82
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*	.05	0.05	0.018	0.038



OIL ANALYSIS REPORT

VISUAL		method	limit/base	current	history1	history2		
White Metal	scalar	Visual*	NONE	NONE				
Yellow Metal	scalar	Visual*	NONE	NONE				
Precipitate	scalar	Visual*	NONE	NONE				
Silt	scalar	Visual*	NONE	NONE				
Debris	scalar	Visual*	NONE	VLITE				
Sand/Dirt	scalar	Visual*	NONE	NONE				
Appearance	scalar	Visual*	NORML	NORML				
Odor	scalar	Visual*	NORML	NORML				
Emulsified Water	scalar	Visual*	>0.040	NEG				
Free Water	scalar	Visual*		NEG				
FLUID PROPERTIES		method	limit/base	current	history1	history2		
Visc @ 40°C	cSt	ASTM D7279(m)	31.5	29.7				
SAMPLE IMAGES		method	limit/base	current	history1	history2		
Color					no image	no image		
Bottom				0	no image	no image		
GRAPHS								



Sample No. : GTT0002715 Received : 27 Jun 2024 100-2588 27th St NE Lab Number : 02644480 Tested : 05 Jul 2024 Calgary, AB Unique Number : 5802019 Diagnosed : 05 Jul 2024 - Bill Quesnel CA T1Y 7G1 Test Package : IND 2 (Additional Tests: KF, TAN Man) Contact: Service Manager To discuss this sample report, contact Customer Service at 1-905-847-9300 Ext 26. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Damages: Seller shall in no event be liable for special, incidental, or consequential damages, of a commercial nature, resulting from any cause.

Report Id: GTT0000300 [WCAMIS] 02644480 (Generated: 07/05/2024 18:17:46) Rev: 2

Contact/Location: Service Manager - GTT0000300 Page 2 of 2

Ainsworth Electric - Calgary

T:

F: