



OIL ANALYSIS REPORT

Sample Rating Trend



ISO

Area

UNASSIGNED

Machine Id

5042CD830R (S/N 8566805)

Component

Hydraulic System

Fluid

{not provided} (--- GAL)

DIAGNOSIS

▲ Recommendation

Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment. We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid. We recommend an early resample to monitor this condition. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. Please specify the brand, type, and viscosity of the oil on your next sample.

Wear

All component wear rates are normal.

▲ Contamination

There is a moderate amount of particulates (2 to 100 microns in size) present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			WC0918451	---	---
Sample Date	Client Info			26 Jun 2024	---	---
Machine Age	hrs	Client Info		75742	---	---
Oil Age	hrs	Client Info		0	---	---
Oil Changed	Client Info			Not Chngd	---	---
Sample Status				ABNORMAL	---	---

CONTAMINATION		method	limit/base	current	history1	history2
Water	WC Method		>0.05	NEG	---	---

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	2	---	---
Chromium	ppm	ASTM D5185(m)	>20	0	---	---
Nickel	ppm	ASTM D5185(m)	>20	<1	---	---
Titanium	ppm	ASTM D5185(m)		0	---	---
Silver	ppm	ASTM D5185(m)		0	---	---
Aluminum	ppm	ASTM D5185(m)	>20	0	---	---
Lead	ppm	ASTM D5185(m)	>20	0	---	---
Copper	ppm	ASTM D5185(m)	>20	3	---	---
Tin	ppm	ASTM D5185(m)	>20	0	---	---
Antimony	ppm	ASTM D5185(m)		0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
Beryllium	ppm	ASTM D5185(m)		0	---	---
Cadmium	ppm	ASTM D5185(m)		0	---	---





ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		<1	---	---
Barium	ppm	ASTM D5185(m)		0	---	---
Molybdenum	ppm	ASTM D5185(m)		0	---	---
Manganese	ppm	ASTM D5185(m)		0	---	---
Magnesium	ppm	ASTM D5185(m)		0	---	---
Calcium	ppm	ASTM D5185(m)		24	---	---
Phosphorus	ppm	ASTM D5185(m)		311	---	---
Zinc	ppm	ASTM D5185(m)		302	---	---
Sulfur	ppm	ASTM D5185(m)		1188	---	---
Lithium	ppm	ASTM D5185(m)		<1	---	---

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	0	---	---
Sodium	ppm	ASTM D5185(m)		1	---	---
Potassium	ppm	ASTM D5185(m)	>20	<1	---	---

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>5000	● 9161	---	---	
Particles >6µm	ASTM D7647	>1300	▲ 3108	---	---	
Particles >14µm	ASTM D7647	>160	▲ 349	---	---	
Particles >21µm	ASTM D7647	>40	▲ 107	---	---	
Particles >38µm	ASTM D7647	>10	8	---	---	
Particles >71µm	ASTM D7647	>3	1	---	---	
Oil Cleanliness	ISO 4406 (c)	>19/17/14	▲ 20/19/16	---	---	



OIL ANALYSIS REPORT

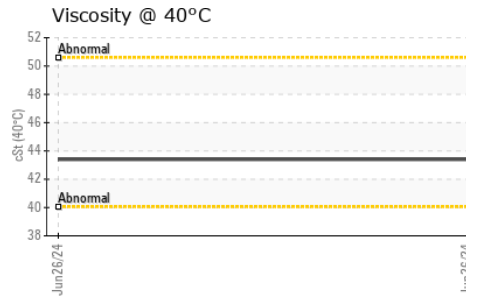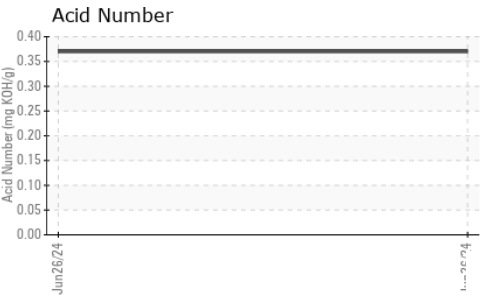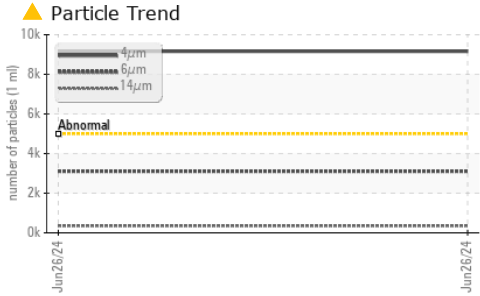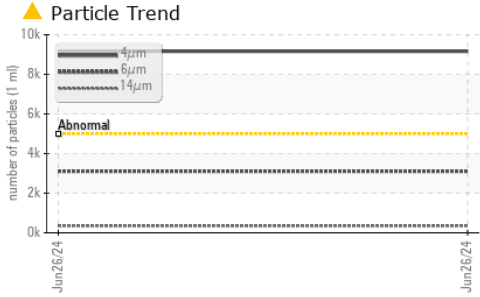

FLUID DEGRADATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*	0.37	---	---





VISUAL	method	limit/base	current	history1	history2	
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---
Precipitate	scalar	Visual*	NONE	NONE	---	---
Silt	scalar	Visual*	NONE	NONE	---	---
Debris	scalar	Visual*	NONE	NONE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	---	---
Emulsified Water	scalar	Visual*	>0.05	NEG	---	---
Free Water	scalar	Visual*		NEG	---	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	43.4	---	---

SAMPLE IMAGES

method	limit/base	current	history1	history2
Color				
Bottom				

GRAPHS

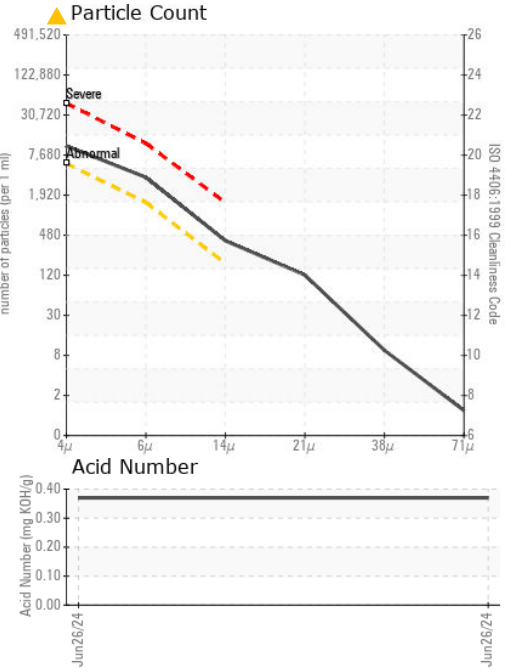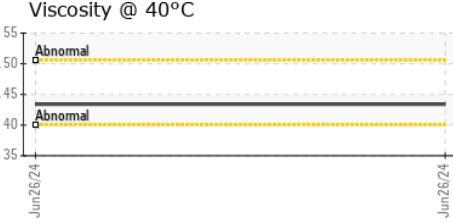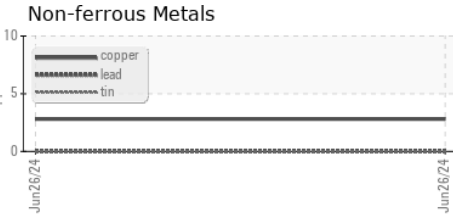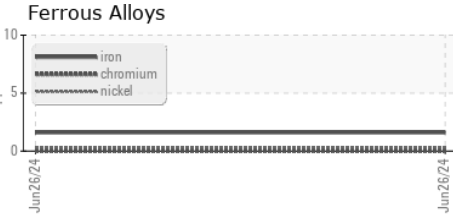

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0918451 **Received** : 28 Jun 2024
Lab Number : **02644581** **Tested** : 02 Jul 2024
Unique Number : 5802120 **Diagnosed** : 02 Jul 2024 - Wes Davis
Test Package : IND 2

Machinex Recycling Services Inc.
 817 Brock Rd.
 Pickering, ON
 CA L1W 3L9
 Contact: Nicole Hendrickson
 nhendrickson@machinexrt.ca
 T: (905)420-0466
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.