


OIL ANALYSIS REPORT

Indus Moules - 106200 A2407028

Hydraulic System

AW HYDRAULIC OIL ISO 46 (--- GAL)

DIAGNOSIS

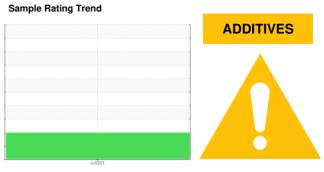

SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Batch #		Client Info		2024 06 0680		
Department		Client Info		Production		
Sample From		Client Info		Machine		
Production Stage		Client Info		Initial		
Sent to WC		Client Info		07/05/2024		
Sample Number		Client Info		E30002579		
Sample Date		Client Info		05 Jul 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
CONTAMINATION	1	method	limit/base	current	history1	history2
Water		WC Method	>0.05	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	6		
Chromium	ppm	ASTM D5185(m)	>10	<1		
Nickel	ppm	ASTM D5185(m)	>10	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>10	<1		
Lead	ppm	ASTM D5185(m)	>20	2		
Copper	ppm	ASTM D5185(m)	>20	9		
Tin	ppm	ASTM D5185(m)	>10	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	5	1		
Barium	ppm	ASTM D5185(m)	5	<1		
Molybdenum	ppm	ASTM D5185(m)	5	0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)	25	11		
Calcium	ppm	ASTM D5185(m)	200	65		
Phosphorus	ppm	ASTM D5185(m)	300	373		
Zinc	ppm	ASTM D5185(m)	370	431		
Sulfur	ppm	ASTM D5185(m)	2500	1369		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	1		
Sodium	ppm	ASTM D5185(m)		<1		
Potassium	ppm	ASTM D5185(m)	>20	<1		



OIL ANALYSIS REPORT

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	▲ LIGHT		
Silt	scalar	Visual*	NONE	NONE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	▲ MILKY		
Odor	scalar	Visual*	NORML	NORML		
SAMPLE IMAGES	3	method	limit/base	current	history1	history2
Color					no image	no image
Bottom					no image	no image
GRAPHS						



CALA ISO 17025:2017 Accredited Laboratory

 $\textbf{Unique Number} \hspace{0.1cm}: 5812059$

Laboratory **Sample No.** : E30002579 Lab Number : 02646507

Test Package : TEST (Additional Tests: ICP)

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Received Tested

Diagnosed

: 08 Jul 2024 : 09 Jul 2024

: 11 Jul 2024 - Tatiana Sorkina

Cobourg, ON CA K9A 5H5 Contact: Tatiana Sorkina tsorkina@e360s.ca T: (800)263-3939

Environmental 360 Solutions Ltd.

F: (905)373-4950 Contact/Location: Tatiana Sorkina - CHECOB

To discuss this sample report, contact Customer Service at 1-905-372-2251.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

640 Victoria Street