




# OIL ANALYSIS REPORT

Sample Rating Trend

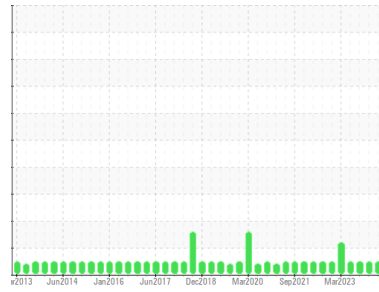

**NORMAL**



Area  
**2 Phoenix/007 Hydrobon/Plat/C Compressor/1A Recycle/Makeup**  
 Machine Id  
**N/A 07C1A RECIP.**  
 Component  
**Reciprocating Compressor**  
 Fluid  
**PETRO CANADA COMPRO COMPRESSOR FLUID 100 (600 LTR)**

## DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.

### Wear

All component wear rates are normal.

### Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The water content is negligible. The system and fluid cleanliness is acceptable.

### Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

## SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		<b>WC0957452</b>	WC0912438	WC0883384
Sample Date	Client Info		<b>02 Jul 2024</b>	12 Mar 2024	15 Dec 2023
Machine Age	hrs	Client Info	<b>0</b>	0	0
Oil Age	hrs	Client Info	<b>0</b>	0	0
Oil Changed	Client Info		<b>N/A</b>	N/A	N/A
Sample Status			<b>NORMAL</b>	NORMAL	NORMAL

## WEAR METALS

	method	limit/base	current	history1	history2
PQ	ASTM D8184*		<b>0</b>	---	---
Iron	ppm	ASTM D5185(m) >50	<b>&lt;1</b>	<1	<1
Chromium	ppm	ASTM D5185(m) >10	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	<b>&lt;1</b>	0	0
Titanium	ppm	ASTM D5185(m)	<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)	<b>0</b>	0	<1
Aluminum	ppm	ASTM D5185(m) >25	<b>&lt;1</b>	<1	<1
Lead	ppm	ASTM D5185(m) >25	<b>0</b>	0	0
Copper	ppm	ASTM D5185(m) >50	<b>4</b>	3	4
Tin	ppm	ASTM D5185(m) >15	<b>0</b>	0	0
Antimony	ppm	ASTM D5185(m)	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)	<b>0</b>	0	0
Beryllium	ppm	ASTM D5185(m)	<b>0</b>	0	0
Cadmium	ppm	ASTM D5185(m)	<b>0</b>	0	0

## ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m) 0	<b>&lt;1</b>	0	<1
Barium	ppm	ASTM D5185(m) 0	<b>0</b>	0	<1
Molybdenum	ppm	ASTM D5185(m) 0	<b>0</b>	0	0
Manganese	ppm	ASTM D5185(m)	<b>0</b>	0	0
Magnesium	ppm	ASTM D5185(m) 0	<b>&lt;1</b>	<1	0
Calcium	ppm	ASTM D5185(m) 0	<b>&lt;1</b>	<1	<1
Phosphorus	ppm	ASTM D5185(m) 50	<b>2</b>	<1	2
Zinc	ppm	ASTM D5185(m) 0	<b>2</b>	2	3
Sulfur	ppm	ASTM D5185(m) 1500	<b>2880</b>	3124	2968
Lithium	ppm	ASTM D5185(m)	<b>&lt;1</b>	<1	<1

## CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m) >25	<b>0</b>	0	0
Sodium	ppm	ASTM D5185(m)	<b>0</b>	0	<1
Potassium	ppm	ASTM D5185(m) >20	<b>&lt;1</b>	1	<1
Water	%	ASTM D6304* >0.1	<b>0.003</b>	0.001	0.002
ppm Water	ppm	ASTM D6304* >1000	<b>34</b>	9	25




## FLUID CLEANLINESS

	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>10000	<b>4373</b>	4941	3288
Particles >6µm	ASTM D7647	>2500	<b>1070</b>	1278	706
Particles >14µm	ASTM D7647	>320	<b>59</b>	60	21
Particles >21µm	ASTM D7647	>80	<b>14</b>	11	4
Particles >38µm	ASTM D7647	>20	<b>2</b>	2	1
Particles >71µm	ASTM D7647	>4	<b>0</b>	1	0

Oil Cleanliness	ISO 4406 (c)	>20/18/15	<b>19/17/13</b>	19/17/13	19/17/12
-----------------	--------------	-----------	-----------------	----------	----------



# OIL ANALYSIS REPORT

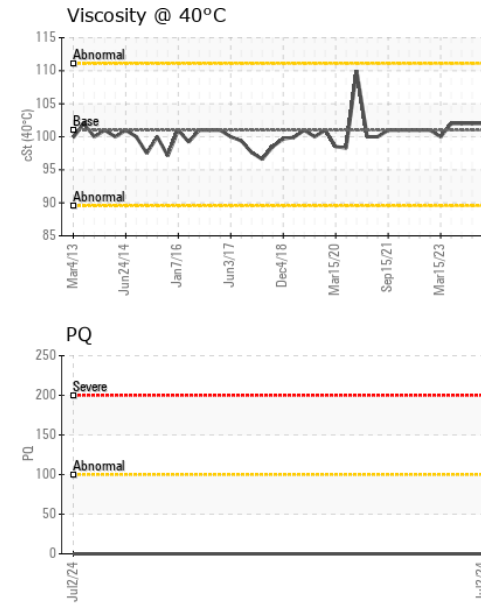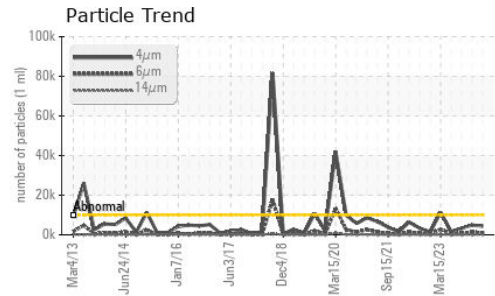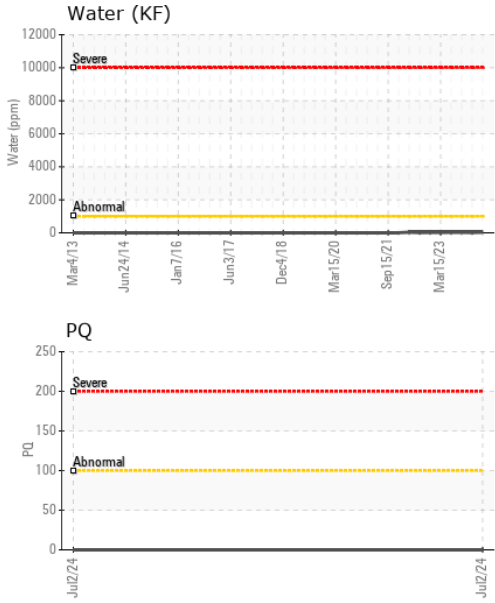



FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*	0.3	<b>0.08</b>	0.07	0.08

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Precipitate	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Silt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>0.1	<b>NEG</b>	NEG	NEG
Free Water	scalar	Visual*		<b>NEG</b>	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	101.0	<b>102</b>	102	102

SAMPLE IMAGES		method	limit/base	current	history1	history2
Color						
Bottom						

## GRAPHS

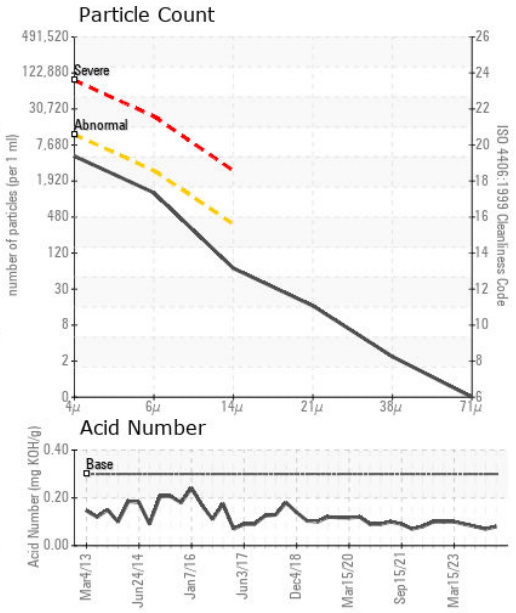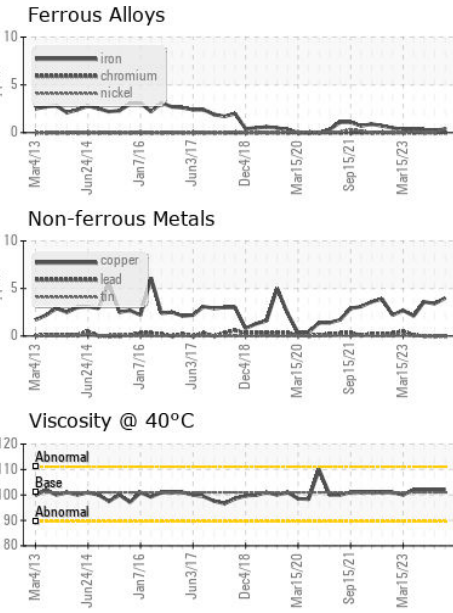

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : WC0957452 **Received** : 09 Jul 2024  
**Lab Number** : **02646727** **Tested** : 15 Jul 2024  
**Unique Number** : 5812279 **Diagnosed** : 15 Jul 2024 - Wes Davis  
**Test Package** : IND 2 ( Additional Tests: KF, PQ, TAN Man )

**Petro Canada Lubricants Inc.**  
 385 Southdown Road  
 Mississauga, ON  
 CA L5J 2Y3  
 Contact: Martin Wagenaar  
 martin.wagenaar@HFSinclair.com  
 T: (905)403-5682  
 F: (905)822-6025

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.