


# **OIL ANALYSIS REPORT**

# Windmill Plastics - W02200 A2407038

Hydraulic System

**AW HYDRAULIC OIL ISO 46 (--- GAL)** 

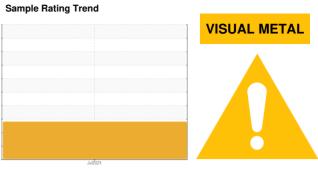

### **DIAGNOSIS**


#### Wear


Copper and iron ppm levels are noted.

				Jul2024		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Batch #		Client Info		2024 06 0870		
Department		Client Info		Production		
Sample From		Client Info		Machine		
Production Stage		Client Info		Initial		
Sent to WC		Client Info		07/08/2024		
Sample Number		Client Info		E30002592		
Sample Date		Client Info		08 Jul 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
CONTAMINATION	V	method	limit/base	current	history1	history2
Water		WC Method	>0.05	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	<b>6</b> 1		
Chromium	ppm	ASTM D5185(m)	>10	1		
Nickel	ppm	ASTM D5185(m)	>10	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>10	1		
Lead	ppm	ASTM D5185(m)	>20	3		
Copper	ppm	ASTM D5185(m)	>20	<b>37</b>		
Tin	ppm	ASTM D5185(m)	>10	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	5	2		
Barium	ppm	ASTM D5185(m)	5	<1		
Molybdenum	ppm	ASTM D5185(m)	5	0		
Manganese	ppm	ASTM D5185(m)		<1		
Magnesium	ppm	ASTM D5185(m)	25	11		
Calcium	ppm	ASTM D5185(m)	200	8		
Phosphorus	ppm	ASTM D5185(m)	300	429		
Zinc	ppm	ASTM D5185(m)	370	304		
Sulfur	ppm	ASTM D5185(m)	2500	1665		
Lithium	ppm	ASTM D5185(m)		3		
CONTAMINANTS	1	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	2		
Sodium	ppm	ASTM D5185(m)		2		
Potassium	ppm	ASTM D5185(m)	>20	<1		



## **OIL ANALYSIS REPORT**

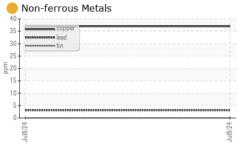

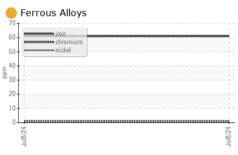

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	▲ VLITE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	NONE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
SAMPLE IMAGES		method	limit/base	current	la la ta mud	la la tarrir o
	,	method	IIIIII/Dase	Current	history1	history2
Color	,	memou	illilli/base	Current	no image	no image



CALA ISO 17025:2017 Accredited Laboratory

Laboratory **Sample No.** : E30002592 Lab Number : 02647260

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9

Unique Number : 5812812

**GRAPHS** 

Received Tested Test Package : TEST ( Additional Tests: ICP )

: 11 Jul 2024 Diagnosed

: 12 Jul 2024 - Aylwin Lee To discuss this sample report, contact Customer Service at 1-905-372-2251.

: 10 Jul 2024

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

Cobourg, ON CA K9A 5H5 Contact: Tatiana Sorkina tsorkina@e360s.ca

Environmental 360 Solutions Ltd.

T: (800)263-3939 F: (905)373-4950

640 Victoria Street