




OIL ANALYSIS REPORT

Sample Rating Trend

NORMAL



Machine Id
CATERPILLAR R1600G SCP215
 Component
Rear Right Planetary
 Fluid
PETRO CANADA PRODURO TO-4 SAE 50 (--- GAL)

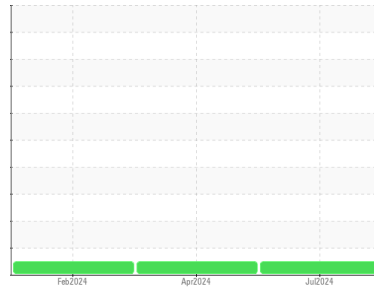

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0915121	WC0928355	WC0826252
Sample Date	Client Info		10 Jul 2024	06 Apr 2024	16 Feb 2024
Machine Age	hrs	Client Info	0	3621	3275
Oil Age	hrs	Client Info	0	0	0
Oil Changed	Client Info		N/A	Not Changd	Changed
Sample Status			NORMAL	NORMAL	NORMAL

CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>0.2	NEG	NEG	NEG

WEAR METALS

	method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185(m)	>500	22	18	141
Chromium	ppm	ASTM D5185(m)	>10	0	0	1
Nickel	ppm	ASTM D5185(m)	>10	<1	0	<1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	0	0
Aluminum	ppm	ASTM D5185(m)	>25	2	2	5
Lead	ppm	ASTM D5185(m)	>25	0	0	<1
Copper	ppm	ASTM D5185(m)	>75	3	2	27
Tin	ppm	ASTM D5185(m)	>10	0	0	1
Antimony	ppm	ASTM D5185(m)	>5	0	0	2
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0

ADDITIVES


	method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185(m)	2	2	1	2
Barium	ppm	ASTM D5185(m)	0	<1	0	0
Molybdenum	ppm	ASTM D5185(m)	0	<1	<1	<1
Manganese	ppm	ASTM D5185(m)	0	<1	<1	1
Magnesium	ppm	ASTM D5185(m)	9	11	13	15
Calcium	ppm	ASTM D5185(m)	3114	3481	3543	3692
Phosphorus	ppm	ASTM D5185(m)	1099	809	892	876
Zinc	ppm	ASTM D5185(m)	1245	1086	1085	1005
Sulfur	ppm	ASTM D5185(m)	7086	11012	11071	7447
Lithium	ppm	ASTM D5185(m)		<1	<1	<1

CONTAMINANTS

	method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185(m)	>75	7	7	14
Sodium	ppm	ASTM D5185(m)		1	<1	5
Potassium	ppm	ASTM D5185(m)	>20	1	1	10




OIL ANALYSIS REPORT

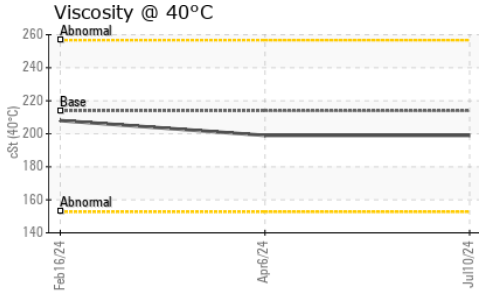


VISUAL	method	limit/base	current	history1	history2	
White Metal	scalar	Visual*	NONE	LIGHT	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2	
Visc @ 40°C	cSt	ASTM D7279(m)	213.9	199	199	208

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

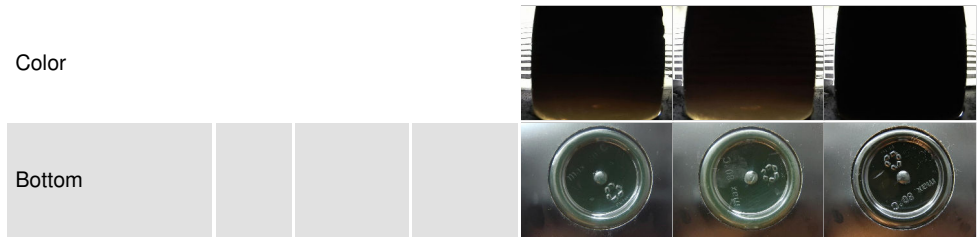

GRAPHS

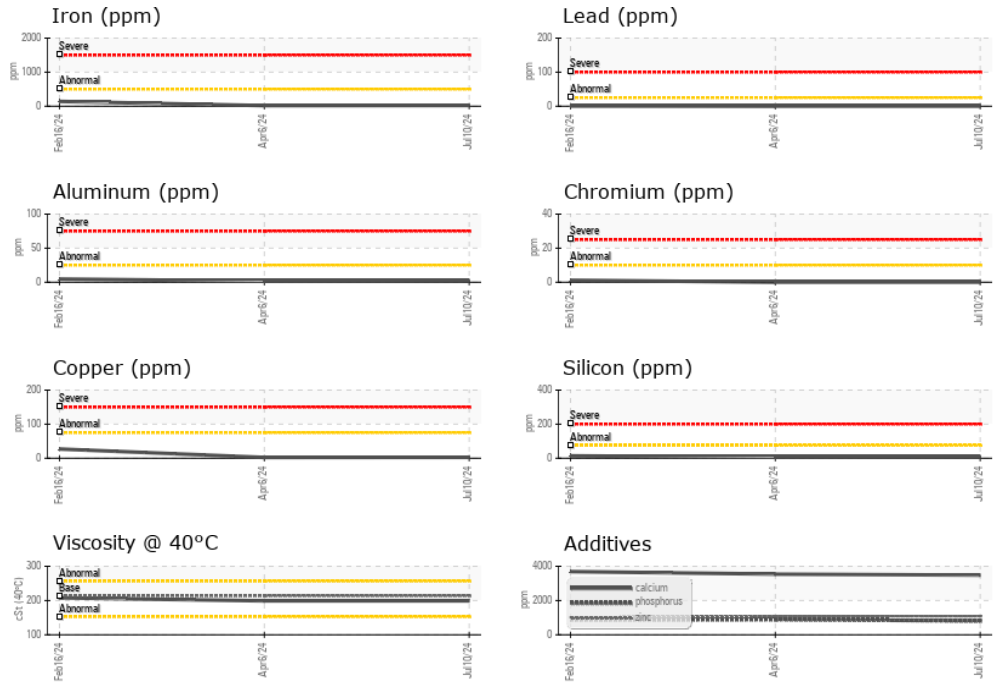

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0915121
Lab Number : **02647378**
Unique Number : 5812930
Test Package : MOB 1

Agnico Eagle Canada
 1350 Government Rd. W, MACASSA COMPLEX
 Kirkland Lake, ON
 CA P2N 3J1

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

Contact: Mitch Lamontagne
 AEM_KL_macassaoilsampleresults@agnicoeagle.com
 T: (705)567-5208
 F: (705)567-5221