


OIL ANALYSIS REPORT

Area

Boiler Building Boiler Feed Pump #1

Outboard Bearing

MOBIL SHC 824 (2 GAL)

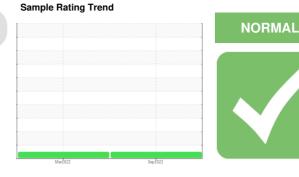

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0738669	WC0685244	
Sample Date		Client Info		13 Sep 2022	31 Mar 2022	
Machine Age	hrs	Client Info		0	0	
Oil Age	hrs	Client Info		0	0	
Oil Changed		Client Info		N/A	N/A	
Sample Status				NORMAL	NORMAL	
CONTAMINATION	V	method	limit/base	current	history1	history2
Water		WC Method	>2	NEG	NEG	
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	0	0	
Chromium	ppm	ASTM D5185m	>20	0	0	
Nickel	ppm	ASTM D5185m	>20	0	0	
Titanium	ppm	ASTM D5185m		0	0	
Silver	ppm	ASTM D5185m		<1	0	
Aluminum	ppm	ASTM D5185m	>20	<1	<1	
Lead	ppm	ASTM D5185m	>20	0	0	
Copper	ppm	ASTM D5185m	>20	3	4	
Tin	ppm	ASTM D5185m	>20	0	0	
Vanadium	ppm	ASTM D5185m		0	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	
Barium	ppm	ASTM D5185m		0	0	
Molybdenum	ppm	ASTM D5185m		0	0	
Manganese	ppm	ASTM D5185m		0	0	
Magnesium	ppm	ASTM D5185m		0	0	
Calcium	ppm	ASTM D5185m		0	0	
Phosphorus	ppm	ASTM D5185m		981	1105	
Zinc	ppm	ASTM D5185m		27	5	
Sulfur	ppm	ASTM D5185m		9	4	
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	0	<1	
Sodium	ppm	ASTM D5185m		0	<1	
Potassium	ppm	ASTM D5185m	>20	0	0	
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.5	0.10	0.18	





OIL ANALYSIS REPORT

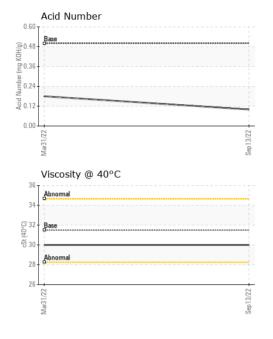

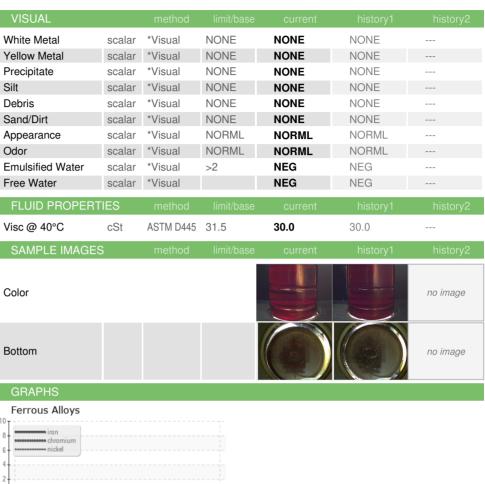

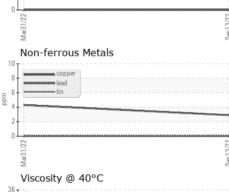

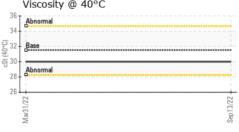

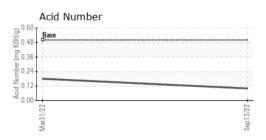





Certificate 12367

Laboratory Sample No.

Lab Number : 05645585

: WC0738669 Unique Number : 10140124 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received **Tested**

Diagnosed

: 19 Sep 2022 : 20 Sep 2022

: 21 Sep 2022 - Don Baldridge

COLBERT, GA US 30628 Contact: CRAIG STEPHENS craig.stephens@veolia.com T: (281)906-7010

VEOLIA NA - MADISON

125 HV CHANDLER

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)