




OIL ANALYSIS REPORT

Sample Rating Trend

NORMAL

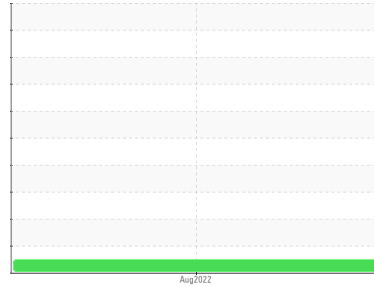

Machine Id
TURBINA 09 (S/N 101311)

Component
Hydraulic System

Fluid
SHELL TELLUS S2 VX 32 (320 LTR)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

The amount and size of particulates present in the system are acceptable. There is no indication of any contamination in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			WC05674241	---	---
Sample Date	Client Info			15 Aug 2022	---	---
Machine Age	hrs	Client Info		0	---	---
Oil Age	hrs	Client Info		0	---	---
Oil Changed	Client Info			N/A	---	---
Sample Status				NORMAL	---	---

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	6	---	---
Chromium	ppm	ASTM D5185m	>20	9	---	---
Nickel	ppm	ASTM D5185m	>20	0	---	---
Titanium	ppm	ASTM D5185m		<1	---	---
Silver	ppm	ASTM D5185m		<1	---	---
Aluminum	ppm	ASTM D5185m	>20	0	---	---
Lead	ppm	ASTM D5185m	>20	0	---	---
Copper	ppm	ASTM D5185m	>20	6	---	---
Tin	ppm	ASTM D5185m	>20	0	---	---
Vanadium	ppm	ASTM D5185m		<1	---	---
Cadmium	ppm	ASTM D5185m		0	---	---

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	---	---
Barium	ppm	ASTM D5185m		0	---	---
Molybdenum	ppm	ASTM D5185m		<1	---	---
Manganese	ppm	ASTM D5185m		1	---	---
Magnesium	ppm	ASTM D5185m		12	---	---
Calcium	ppm	ASTM D5185m		19	---	---
Phosphorus	ppm	ASTM D5185m		300	---	---
Zinc	ppm	ASTM D5185m		314	---	---
Sulfur	ppm	ASTM D5185m		4471	---	---






CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	1	---	---
Sodium	ppm	ASTM D5185m		1	---	---
Potassium	ppm	ASTM D5185m	>20	0	---	---
Water	%	ASTM D6304	>0.05	0.005	---	---
ppm Water	ppm	ASTM D6304	>500	59.1	---	---

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		1257	---	---
Particles >6µm		ASTM D7647	>5000	203	---	---
Particles >14µm		ASTM D7647	>640	31	---	---
Particles >21µm		ASTM D7647	>160	9	---	---
Particles >38µm		ASTM D7647	>40	2	---	---
Particles >71µm		ASTM D7647	>10	1	---	---
Oil Cleanliness		ISO 4406 (c)	>--/19/16	17/15/12	---	---

FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.31	---	---



OIL ANALYSIS REPORT

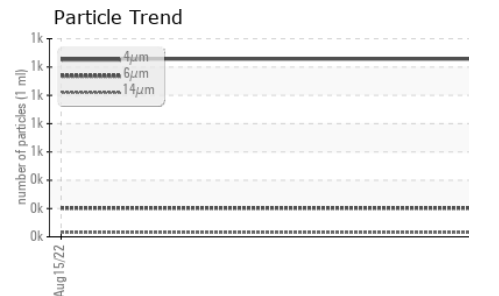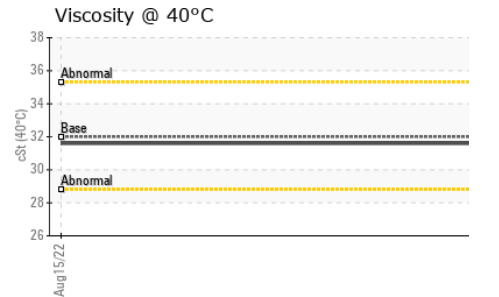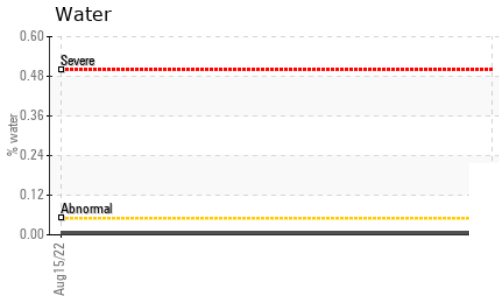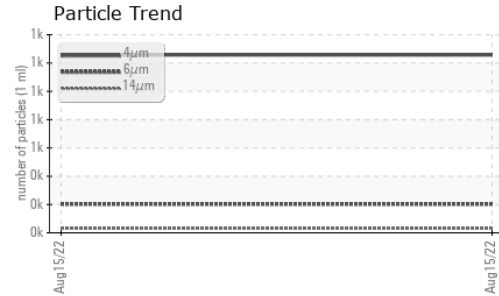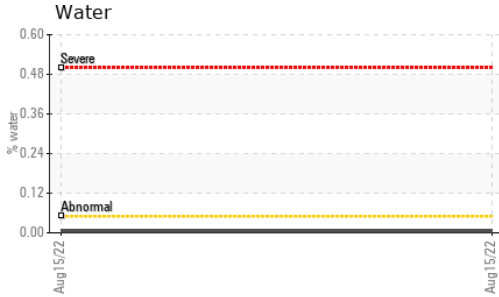






VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	---
Yellow Metal	scalar	*Visual	NONE	NONE	---
Precipitate	scalar	*Visual	NONE	NONE	---
Silt	scalar	*Visual	NONE	NONE	---
Debris	scalar	*Visual	NONE	NONE	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---
Appearance	scalar	*Visual	NORML	NORML	---
Odor	scalar	*Visual	NORML	NORML	---
Emulsified Water	scalar	*Visual	>0.05	NEG	---
Free Water	scalar	*Visual		NEG	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	32	31.6	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

Color			no image	no image
Bottom			no image	no image

GRAPHS

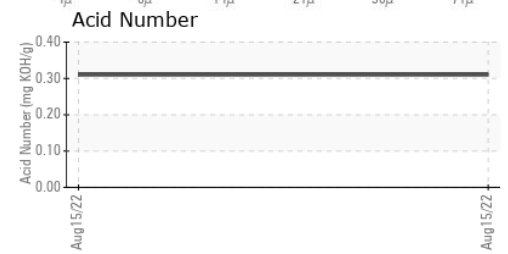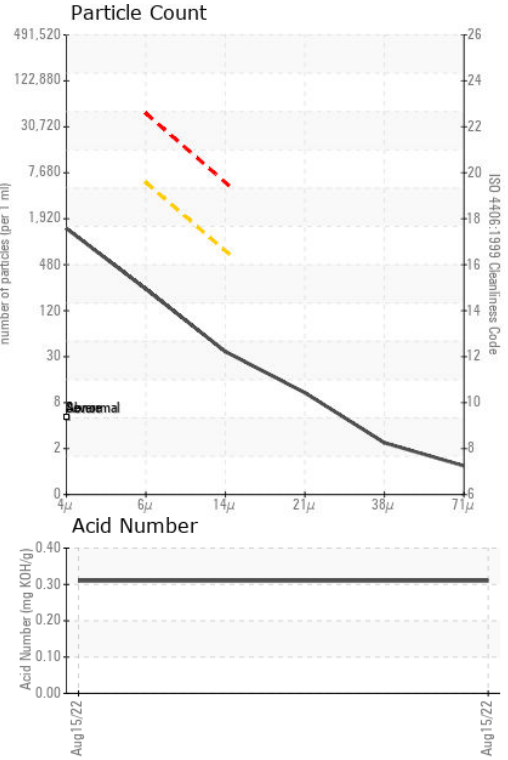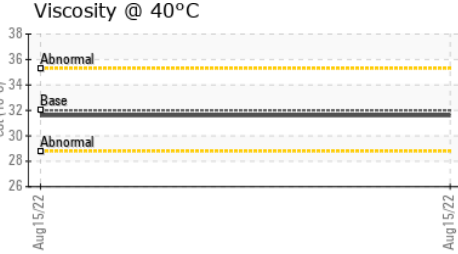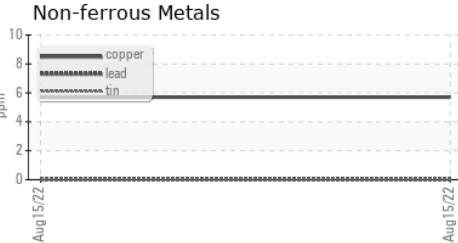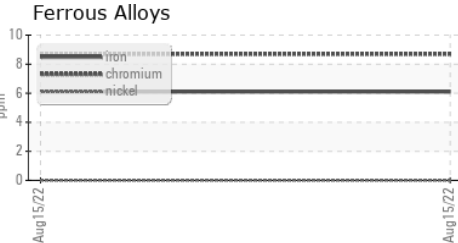

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC05674241 **Received** : 24 Oct 2022
Lab Number : 05674241 **Diagnosed** : 25 Oct 2022
Unique Number : 10188812 **Diagnostician** : Don Baldrige
Test Package : IND 2 (Additional Tests: KF)

EOL DE NICARAGUA S.A.
 DEL SEMAFORO DEL CLUB TERRAZA, 1 CUADRA AL SUR
 MANAGUA, ZZ
 NI
 Contact: Rafael Bermudez

Certificate L2367
 To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)