




OIL ANALYSIS REPORT

Sample Rating Trend

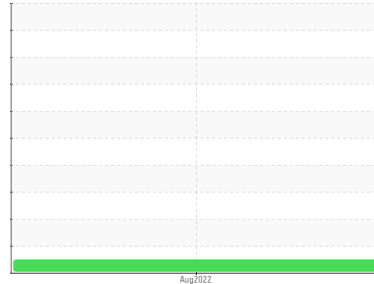

NORMAL



Machine Id
TURBINA 11 (S/N 101167)

Component
Hydraulic System

Fluid
SHELL TELLUS S2 VX 32 (320 LTR)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

The amount and size of particulates present in the system are acceptable. There is no indication of any contamination in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			WC05674247	---	---
Sample Date	Client Info			02 Aug 2022	---	---
Machine Age	hrs	Client Info		0	---	---
Oil Age	hrs	Client Info		0	---	---
Oil Changed	Client Info			N/A	---	---
Sample Status				NORMAL	---	---

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	3	---	---
Chromium	ppm	ASTM D5185m	>20	2	---	---
Nickel	ppm	ASTM D5185m	>20	0	---	---
Titanium	ppm	ASTM D5185m		<1	---	---
Silver	ppm	ASTM D5185m		<1	---	---
Aluminum	ppm	ASTM D5185m	>20	0	---	---
Lead	ppm	ASTM D5185m	>20	0	---	---
Copper	ppm	ASTM D5185m	>20	2	---	---
Tin	ppm	ASTM D5185m	>20	0	---	---
Vanadium	ppm	ASTM D5185m		<1	---	---
Cadmium	ppm	ASTM D5185m		0	---	---

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	---	---
Barium	ppm	ASTM D5185m		0	---	---
Molybdenum	ppm	ASTM D5185m		<1	---	---
Manganese	ppm	ASTM D5185m		1	---	---
Magnesium	ppm	ASTM D5185m		6	---	---
Calcium	ppm	ASTM D5185m		24	---	---
Phosphorus	ppm	ASTM D5185m		302	---	---
Zinc	ppm	ASTM D5185m		337	---	---
Sulfur	ppm	ASTM D5185m		1758	---	---






CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	1	---	---
Sodium	ppm	ASTM D5185m		<1	---	---
Potassium	ppm	ASTM D5185m	>20	0	---	---
Water	%	ASTM D6304	>0.05	0.004	---	---
ppm Water	ppm	ASTM D6304	>500	48.4	---	---

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		158	---	---
Particles >6µm		ASTM D7647	>5000	28	---	---
Particles >14µm		ASTM D7647	>640	6	---	---
Particles >21µm		ASTM D7647	>160	2	---	---
Particles >38µm		ASTM D7647	>40	0	---	---
Particles >71µm		ASTM D7647	>10	0	---	---
Oil Cleanliness		ISO 4406 (c)	>--/19/16	14/12/10	---	---

FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.31	---	---




OIL ANALYSIS REPORT

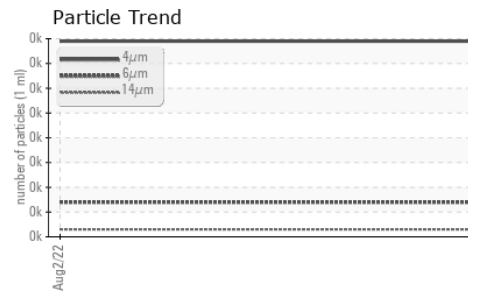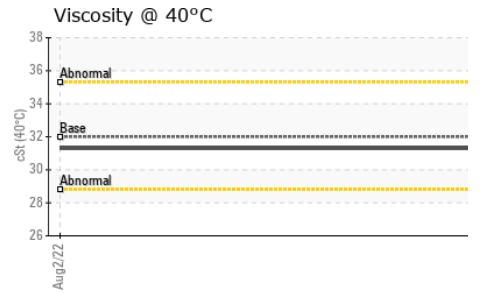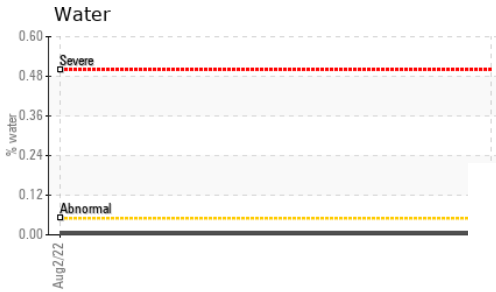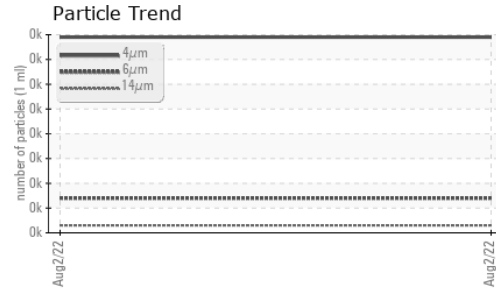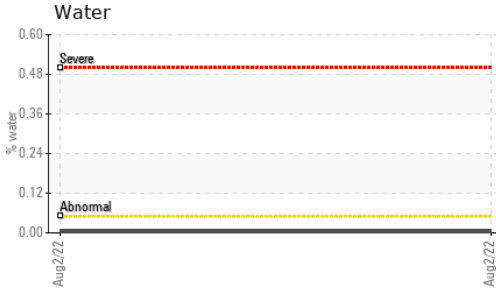






VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual NONE	VLITE	---	---
Yellow Metal	scalar	*Visual NONE	NONE	---	---
Precipitate	scalar	*Visual NONE	NONE	---	---
Silt	scalar	*Visual NONE	NONE	---	---
Debris	scalar	*Visual NONE	VLITE	---	---
Sand/Dirt	scalar	*Visual NONE	NONE	---	---
Appearance	scalar	*Visual NORML	NORML	---	---
Odor	scalar	*Visual NORML	NORML	---	---
Emulsified Water	scalar	*Visual >0.05	NEG	---	---
Free Water	scalar	*Visual	NEG	---	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445 32	31.3	---	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

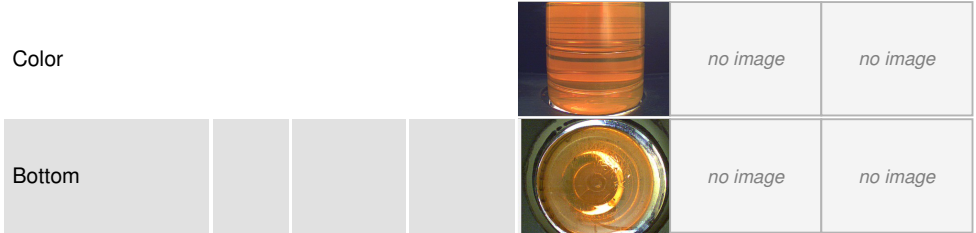

GRAPHS

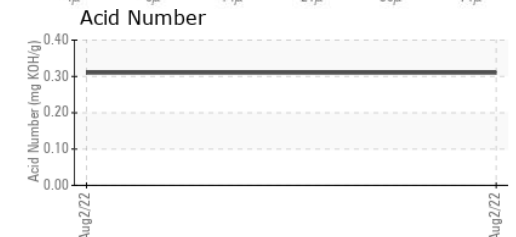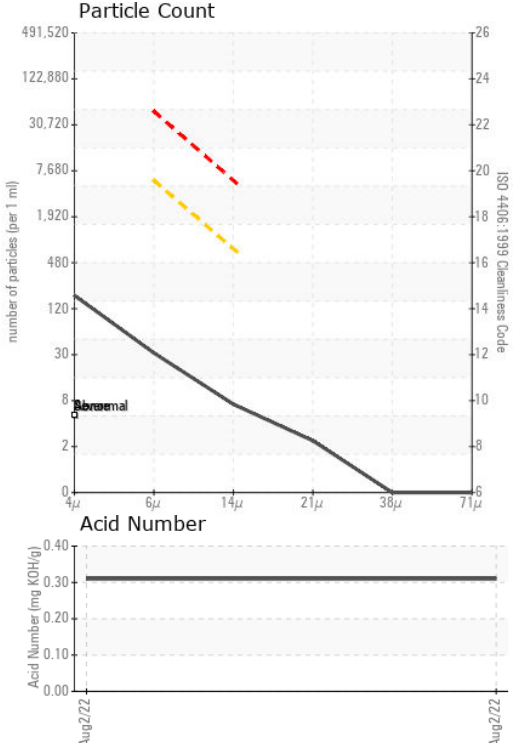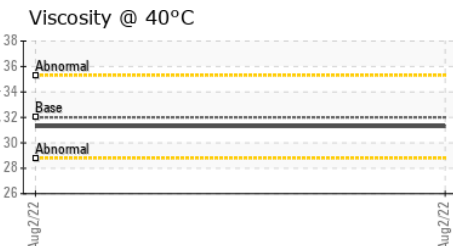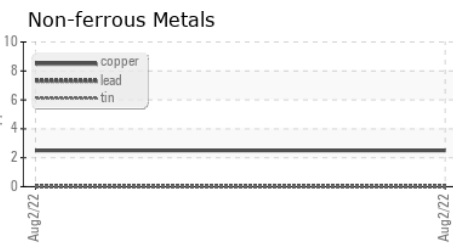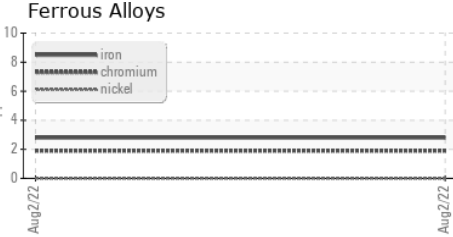

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
 Sample No. : WC05674247 Received : 24 Oct 2022
 Lab Number : 05674247 Diagnosed : 25 Oct 2022
 Unique Number : 10188818 Diagnostician : Don Baldrige
 Test Package : IND 2 (Additional Tests: KF)

EOL DE NICARAGUA S.A.
 DEL SEMAFORO DEL CLUB TERRAZA, 1 CUADRA AL SUR
 MANAGUA, ZZ
 NI
 Contact: Rafael Bermudez

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:
F: