




# FUEL REPORT

Sample Rating Trend

**NORMAL**



Machine Id  
**625 Indiana FP**  
Component  
**Diesel Fuel**  
Fluid  
**NOT GIVEN (--- GAL)**

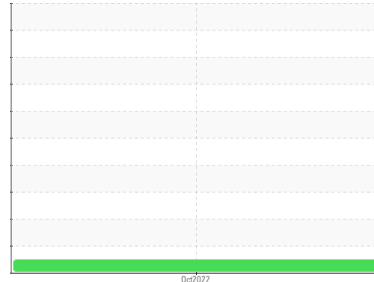

## DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor. ( Customer Sample Comment: 625 Indiana FP diesel fuel Sample )

### Corrosion

All metal levels are normal indicating no corrosion in the system.

### Contaminants

The water content is negligible. There is no indication of any contamination in the fuel.

### Fuel Condition

The condition of the fuel is acceptable for the time in service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			<b>DC0023946</b>	---	---
Sample Date	Client Info			<b>03 Oct 2022</b>	---	---
Machine Age	yrs	Client Info		<b>0</b>	---	---
Sample Status				<b>NORMAL</b>	---	---

PHYSICAL PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445		<b>2.48</b>	---	---

SULFUR CONTENT		method	limit/base	current	history1	history2
Sulfur	ppm	ASTM D5185m		<b>18</b>	---	---

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	<1.0	<b>0</b>	---	---
Sodium	ppm	ASTM D5185m	<0.1	<b>0</b>	---	---
Potassium	ppm	ASTM D5185m	<0.1	<b>0</b>	---	---
Water	%	ASTM D6304	<0.05	<b>0.007</b>	---	---
ppm Water	ppm	ASTM D6304	<500	<b>72.3</b>	---	---
% Gasoline	%	*In-House	<0.50	<b>0.0</b>	---	---
% Biodiesel	%	*In-House	<20.0	<b>0.0</b>	---	---

HEAVY METALS		method	limit/base	current	history1	history2
Aluminum	ppm	ASTM D5185m	<0.1	<b>0</b>	---	---
Nickel	ppm	ASTM D5185m	<0.1	<b>0</b>	---	---
Lead	ppm	ASTM D5185m	<0.1	<b>0</b>	---	---
Vanadium	ppm	ASTM D5185m	<0.1	<b>0</b>	---	---
Iron	ppm	ASTM D5185m	<0.1	<b>0</b>	---	---
Calcium	ppm	ASTM D5185m	<0.1	<b>2</b>	---	---
Magnesium	ppm	ASTM D5185m	<0.1	<b>0</b>	---	---
Phosphorus	ppm	ASTM D5185m	<0.1	<b>4</b>	---	---
Zinc	ppm	ASTM D5185m	<0.1	<b>&lt;1</b>	---	---





## SAMPLE IMAGES

method	limit/base	current	history1	history2
Color			no image	no image
Bottom			no image	no image



# FUEL REPORT

## GRAPHS

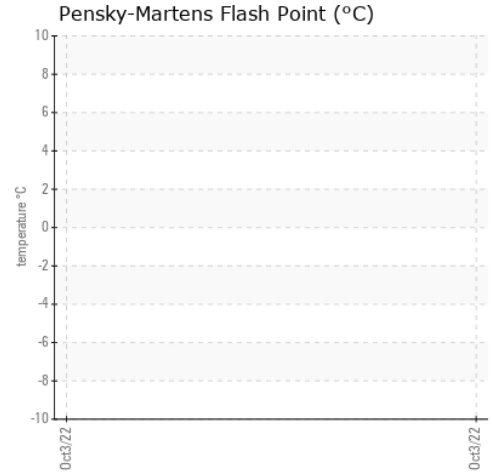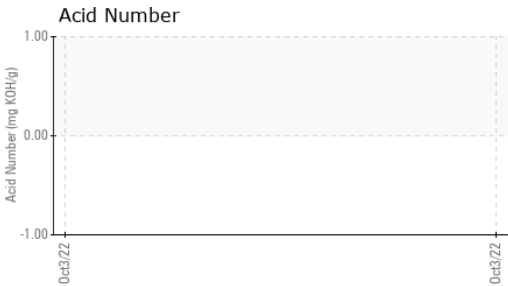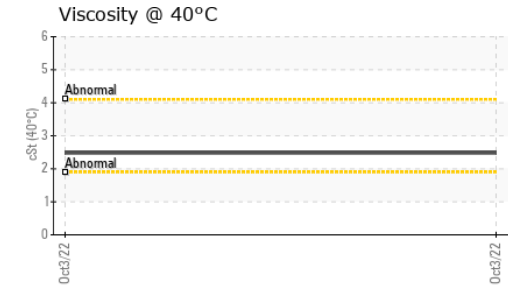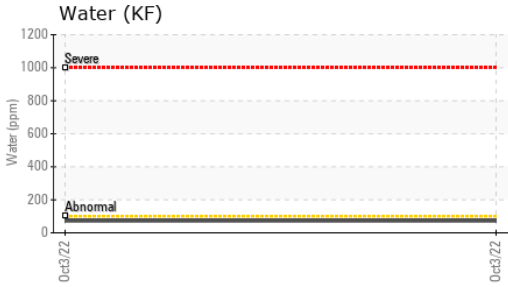

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : DC0023946    **Received** : 31 Oct 2022  
**Lab Number** : **05680813**    **Diagnosed** : 03 Nov 2022  
**Unique Number** : 10195384    **Diagnostician** : Doug Bogart  
**Test Package** : MOB 2 ( Additional Tests: Color-ASTM, GC-PercFuel, KF, PrtCount, XRF )

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

**JE RICHARDS**  
 4600 HARGROVE DR  
 LANHAM, MD  
 US 20706  
 Contact: E. NOEL  
 enoel@phalconusa.com  
 T: (240)623-4398  
 F: