

PROBLEM SUMMARY

Sample Rating Trend

VIS DEBRIS n2019 Nov2019 Sep2020 Jan2071 Jud0711 Nov2019 Mar2029 Lacases

PRMGB2

Component Gearbox

NOT GIVEN (--- GAL)

COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

PROBLEMATIC ⁷	TEST RE	SULTS				
Sample Status				ABNORMAL	NORMAL	NORMAL
Debris	scalar	*Visual	NONE	▲ MODER	NONE	NONE

Customer Id: KOBPIN Sample No.: ST40675 Lab Number: 05704867 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter			?	We recommend you service the filters on this component if applicable.
Alert			?	We were unable to perform a particle count due to a high concentration of particles present in this sample.

HISTORICAL DIAGNOSIS

18 Oct 2022 Diag: Angela Borella

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. The amount and size of particulates present in the system is acceptable. There is no indication of any contamination in the component. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



25 Aug 2022 Diag: Doug Bogart

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. The amount and size of particulates present in the system is acceptable. There is no indication of any contamination in the component. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report

27 Jul 2022 Diag: Jonathan Hester

NORMAL




Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





OIL ANALYSIS REPORT

Sample Rating Trend

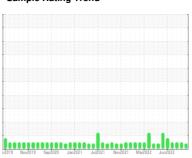

VIS DEBRIS



PRMGB2

Component

Gearbox

NOT GIVEN (--- GAL)

DIAGNOSIS

Recommendation

We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

All component wear rates are normal.

Contamination

Moderate concentration of visible dirt/debris present in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		n2019 Nov20	19 Sep2020 Jan2021	Jul2021 Nov2021 Mar2022 .	Jun 2022	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		ST40675	ST42780	ST42778
Sample Date		Client Info		20 Nov 2022	18 Oct 2022	25 Aug 2022
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	NORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	24	23	20
Chromium	ppm	ASTM D5185m	>15	<1	0	0
Nickel	ppm	ASTM D5185m	>15	<1	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	<1
Aluminum	ppm	ASTM D5185m	>25	1	1	1
Lead	ppm	ASTM D5185m	>100	0	0	<1
Copper	ppm	ASTM D5185m	>200	<1	<1	<1
Tin	ppm	ASTM D5185m	>25	<1	<1	<1
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		2	0	2
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		<1	<1	<1
Manganese	ppm	ASTM D5185m		<1	<1	<1
Magnesium	ppm	ASTM D5185m		2	0	2
Calcium	ppm	ASTM D5185m		14	17	16
Phosphorus	ppm	ASTM D5185m		212	231	211
Zinc	ppm	ASTM D5185m		22	21	11
Sulfur	ppm	ASTM D5185m		12627	12937	9865
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	6	4	4
Sodium	ppm	ASTM D5185m		1	0	0
Potassium	ppm	ASTM D5185m	>20	0	0	2
Water	%	ASTM D6304	>0.2	0.011	0.015	0.013
ppm Water	ppm	ASTM D6304	>2000	117.9	158.0	132.9
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4μm		ASTM D7647	>20000		3971	2495
Particles >6µm		ASTM D7647	>5000		662	307
Particles >14µm		ASTM D7647	>640		68	18
Particles >21µm		ASTM D7647	>160		23	4
Particles >38μm		ASTM D7647	>40		1	0
Particles >71μm		ASTM D7647	>10		0	0
Oil Cleanliness		ISO 4406 (c)	>21/19/16		19/17/13	18/15/11
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.41	0.50	0.50



OIL ANALYSIS REPORT

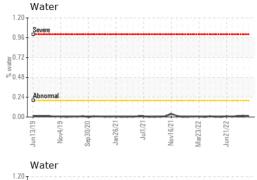



VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	▲ MODER	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG
FILIIN PROPERT	TIEC	method	limit/haco	current	history1	history2

0.96 - Severe					
0.36					
0.72					
0.72					
0.48					
111					
0.24 - Abno	mal	11-1-1-1	1111111	177777	1112 111
0.00					

FLUID PROPER	RTIES	method	limit/base	current	history1	history
Visc @ 40°C	cSt	ASTM D445		209	208	208

SAMPLE IMAGES method limit/base Color

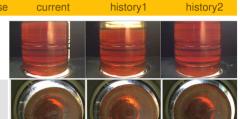


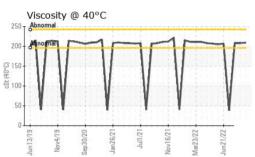



GRAPHS

Bottom

Ferrous Alloys H 30 20

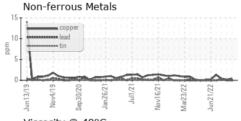

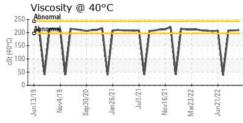

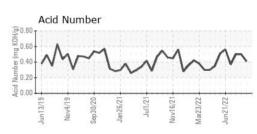





Laboratory Sample No. Lab Number Unique Number

: 10234441

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : ST40675 : 05704867

Received Diagnosed

: 29 Nov 2022 : 30 Nov 2022 Diagnostician : Don Baldridge

Test Package : IND 2 (Additional Tests: KF, PrtCount) Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

Contact: MAXIMILIAN ILG MAXIMILIAN.ILG@WIELAND.COM

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) T: (336)445-4534 F:

3990 HWY. 311

PINE HALL, NC

US 27042

KOBE WIELAND COPPER PRODUCTS