


OIL ANALYSIS REPORT

Sample Rating Trend



NORMAL

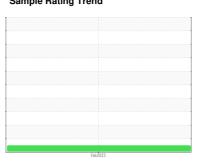

KMGP UNIT 4

Component

Outboard Bearing

ROYAL PURPLE SYNFILM GT 32 (--- GAL)

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

.)				Feb 2023		
SAMPLE INFORM	1ATION	method	limit/base	current	history1	history2
Sample Number		Client Info		RP0028254		1110(01)=
Sample Date		Client Info		16 Feb 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed	1113	Client Info		N/A		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	0		
Chromium	ppm	ASTM D5185m	>20	0		
Nickel	ppm	ASTM D5185m	>20	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>20	<1		
Lead	ppm	ASTM D5185m	>20	0		
Copper	ppm	ASTM D5185m	>20	<1		
Tin	ppm	ASTM D5185m	>20	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
			IIIIII/Dase			
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		57		
Calcium	ppm	ASTM D5185m		2		
Phosphorus Zinc	ppm	ASTM D5185m		0 <1		
-	ppm	HICOLCG INILGY		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	<1		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	0		
Water	%	ASTM D6304	>2	0.014		
ppm Water	ppm	ASTM D6304		147.2		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.31		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	LIGHT		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>2	NEG		


scalar *Visual

ition:-LOGAN SEYL --MAGHOU

NEG



OIL ANALYSIS REPORT

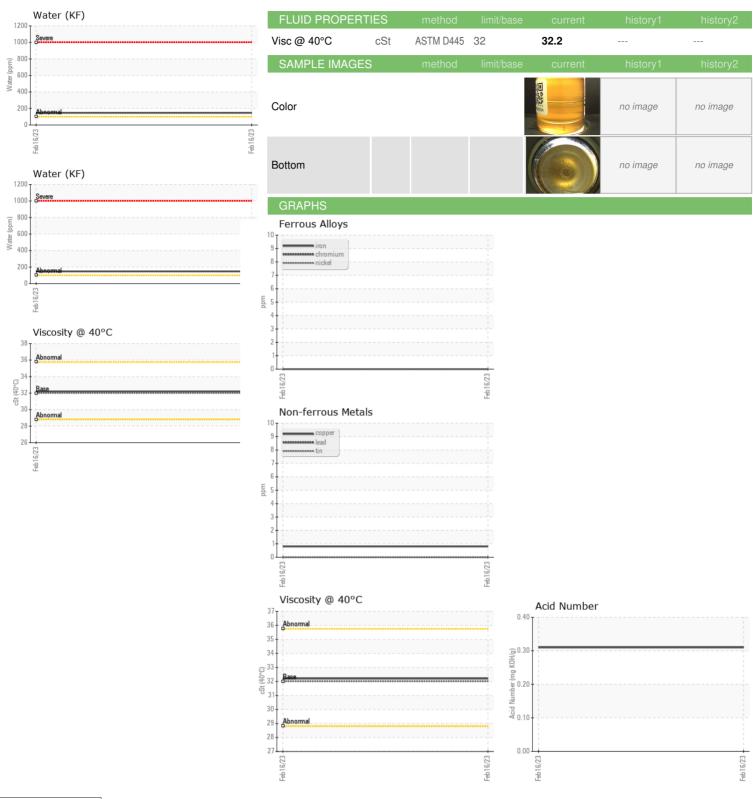



Certificate L2367

Laboratory Sample No. Lab Number Test Package : IND 2

Unique Number : 10387302

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : RP0028254 Received : 05797618

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

: 21 Mar 2023 Diagnosed : 27 Mar 2023 Diagnostician : Doug Bogart

MAGELLAN MIDSTREAM - EH TERMINAL

7901 WALLISVILLE RD HOUSTON, TX US 77029

Contact: LOGAN SEYL logan.seyl@magellanlp.com T:

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

F: