




PROBLEM SUMMARY

Sample Rating Trend

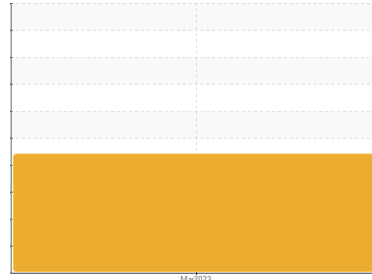


WATER



Machine Id
KAESER SM10 79966600 (S/N 1544)
 Component
Compressor
 Fluid
KAESER SIGMA (OEM) S-460 (--- GAL)

COMPONENT CONDITION SUMMARY

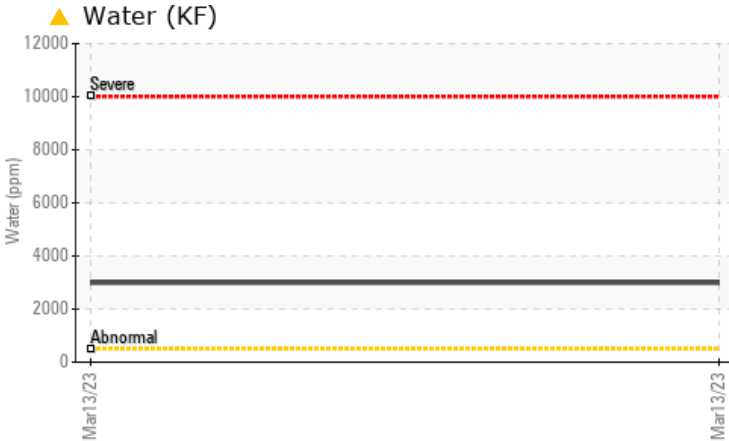

RECOMMENDATION

Oil and filter change at the time of sampling has been noted. We were unable to perform a particle count due to a high concentration of particles present in this sample. We recommend an early resample in 500 hours to monitor this condition.

PROBLEMATIC TEST RESULTS

Sample Status				ABNORMAL	---	---
Water	%	ASTM D6304	>0.05	▲ 0.299	---	---
ppm Water	ppm	ASTM D6304	>500	▲ 2990	---	---
Debris	scalar	*Visual	NONE	▲ MODER	---	---
Appearance	scalar	*Visual	NORML	▲ HAZY	---	---
Free Water	scalar	*Visual		▲ 1.0	---	---

Customer Id: JWSELL
Sample No.: KC102429
Lab Number: 05800359
Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Jonathan Hester +1 919-379-4092 x4092
jhester@wearcheckusa.com

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS


Action	Status	Date	Done By	Description
Change Fluid	---	---	?	Oil and filter change at the time of sampling has been noted.
Change Filter	---	---	?	Oil and filter change at the time of sampling has been noted.
Alert	---	---	?	We were unable to perform a particle count due to a high concentration of particles present in this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

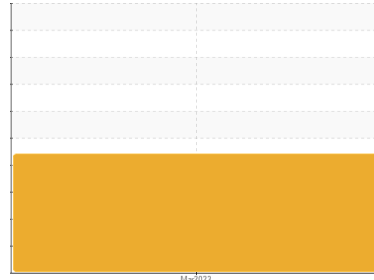

WATER



Machine Id
KAESER SM10 79966600 (S/N 1544)
 Component
Compressor
 Fluid
KAESER SIGMA (OEM) S-460 (--- GAL)

DIAGNOSIS

Recommendation

Oil and filter change at the time of sampling has been noted. We were unable to perform a particle count due to a high concentration of particles present in this sample. We recommend an early resample in 500 hours to monitor this condition.

Wear

All component wear rates are normal.

Contamination

Appearance is hazy. Free water present. There is a light concentration of water present in the oil. Moderate concentration of visible dirt/debris present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	KC102429	---	---
Sample Date	Client Info	13 Mar 2023	---	---
Machine Age	hrs Client Info	148	---	---
Oil Age	hrs Client Info	2852	---	---
Oil Changed	Client Info	Changed	---	---
Sample Status		ABNORMAL	---	---

WEAR METALS

method	limit/base	current	history1	history2
Iron ppm ASTM D5185m	>50	<1	---	---
Chromium ppm ASTM D5185m	>10	0	---	---
Nickel ppm ASTM D5185m	>3	<1	---	---
Titanium ppm ASTM D5185m	>3	0	---	---
Silver ppm ASTM D5185m	>2	0	---	---
Aluminum ppm ASTM D5185m	>10	<1	---	---
Lead ppm ASTM D5185m	>10	<1	---	---
Copper ppm ASTM D5185m	>50	1	---	---
Tin ppm ASTM D5185m	>10	<1	---	---
Vanadium ppm ASTM D5185m		0	---	---
Cadmium ppm ASTM D5185m		0	---	---

ADDITIVES

method	limit/base	current	history1	history2
Boron ppm ASTM D5185m		0	---	---
Barium ppm ASTM D5185m	90	20	---	---
Molybdenum ppm ASTM D5185m		0	---	---
Manganese ppm ASTM D5185m		<1	---	---
Magnesium ppm ASTM D5185m	90	23	---	---
Calcium ppm ASTM D5185m	2	0	---	---
Phosphorus ppm ASTM D5185m		6	---	---
Zinc ppm ASTM D5185m		9	---	---

CONTAMINANTS

method	limit/base	current	history1	history2
Silicon ppm ASTM D5185m	>25	2	---	---
Sodium ppm ASTM D5185m		1	---	---
Potassium ppm ASTM D5185m	>20	<1	---	---
Water % ASTM D6304	>0.05	▲ 0.299	---	---
ppm Water ppm ASTM D6304	>500	▲ 2990	---	---



FLUID DEGRADATION

method	limit/base	current	history1	history2
Acid Number (AN) mg KOH/g ASTM D8045	0.4	0.24	---	---

VISUAL

method	limit/base	current	history1	history2
White Metal scalar *Visual	NONE	NONE	---	---
Yellow Metal scalar *Visual	NONE	NONE	---	---
Precipitate scalar *Visual	NONE	NONE	---	---
Silt scalar *Visual	NONE	NONE	---	---
Debris scalar *Visual	NONE	▲ MODER	---	---
Sand/Dirt scalar *Visual	NONE	NONE	---	---
Appearance scalar *Visual	NORML	▲ HAZY	---	---
Odor scalar *Visual	NORML	NORML	---	---
Emulsified Water scalar *Visual	>0.05	0.2%	---	---
Free Water scalar *Visual		▲ 1.0	---	---

OIL ANALYSIS REPORT

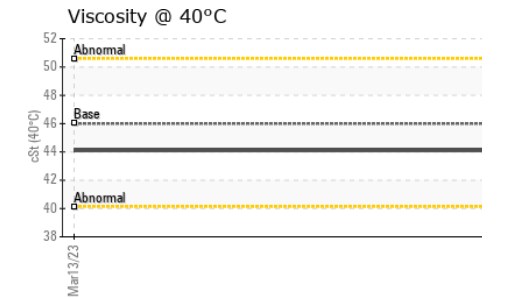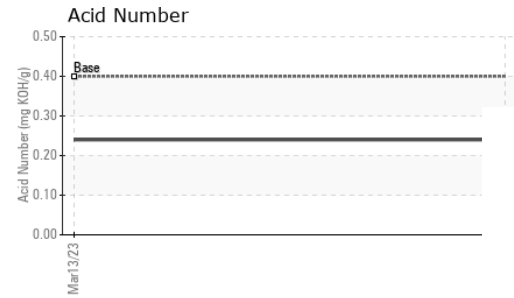





FLUID PROPERTIES

method	limit/base	current	history1	history2
Visc @ 40°C	cSt ASTM D445	46	44.1	---

SAMPLE IMAGES

method	limit/base	current	history1	history2
Color			no image	no image
Bottom			no image	no image

GRAPHS

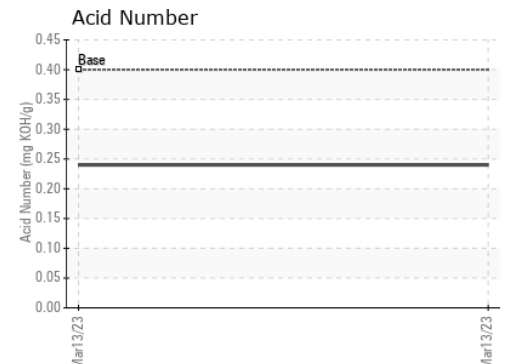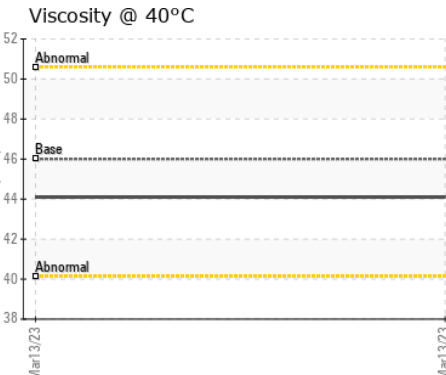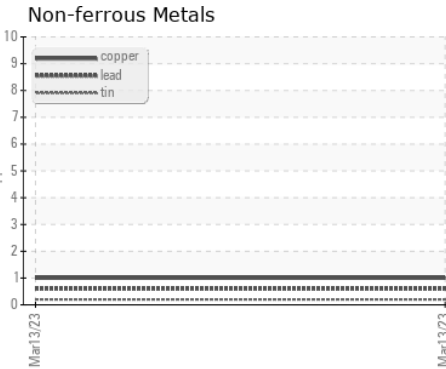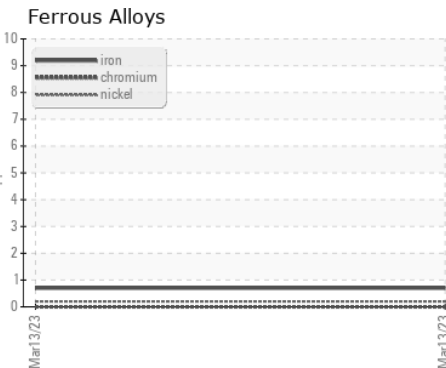

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : KC102429 **Received** : 23 Mar 2023
Lab Number : 05800359 **Diagnosed** : 28 Mar 2023
Unique Number : 10390043 **Diagnostician** : Jonathan Hester
Test Package : IND 2

JW SMITH AUTO BODY
 2401 SHERMANS VALLEY RD
 ELLIOTTSBURG, PA
 US 17024
 Contact:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:
F: