




PROBLEM SUMMARY

Area
WHEY [1718836]
 Machine Id
NF01PP31BB01
 Component
Bearing
 Fluid
MOBIL SHC 626 (--- QTS)

Sample Rating Trend

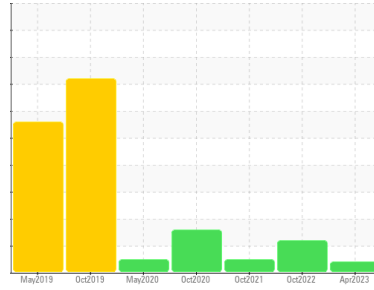

VIS DEBRIS



COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

We suspect abnormal contamination may be due to sampling method. No corrective action is recommended at this time. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status		ABNORMAL	ABNORMAL	NORMAL
Debris	scalar *Visual	▲ MODER	▲ MODER	LIGHT

Customer Id: LEPGRE
Sample No.: WC0805912
Lab Number: 05833318
Test Package: IND 1



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Angela Borella +1 800-237-1369
angela.borella@wearcheckusa.com

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

18 Oct 2022 Diag: Don Baldrige

CONTAMINANT



We recommend you service the filters on this component. Resample at the next service interval to monitor. All component wear rates are normal. Appearance is hazy. Moderate concentration of visible dirt/debris present in the oil. The condition of the oil is acceptable for the time in service.

view report



24 Oct 2021 Diag: Don Baldrige

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

view report



20 Oct 2020 Diag:

WATER



We advise that you check for the source of water entry. Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor. All component wear rates are normal. There is a trace of moisture present in the oil. Free water present. There is a high concentration of water present in the oil. The condition of the oil is suitable for further service.


view report





OIL ANALYSIS REPORT

Sample Rating Trend

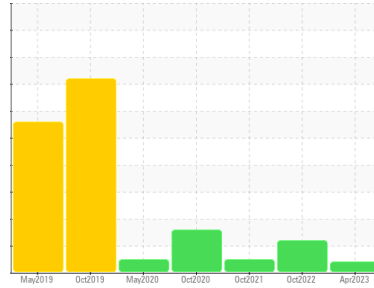

VIS DEBRIS



Area
WHEY [1718836]
 Machine Id
NF01PP31BB01
 Component
Bearing
 Fluid
MOBIL SHC 626 (--- QTS)

DIAGNOSIS

Recommendation

We suspect abnormal contamination may be due to sampling method. No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

Moderate concentration of visible dirt/debris present in the oil.

Fluid Condition

The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0805912	WC0747505	WC0629286
Sample Date	Client Info		21 Apr 2023	18 Oct 2022	24 Oct 2021
Machine Age	Client Info		0	0	0
Oil Age	Client Info		0	0	0
Oil Changed	Client Info		N/A	N/A	N/A
Sample Status			ABNORMAL	ABNORMAL	NORMAL

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >200	1	1	<1
Chromium	ppm	ASTM D5185m >15	0	0	0
Nickel	ppm	ASTM D5185m >15	0	0	0
Titanium	ppm	ASTM D5185m	0	0	0
Silver	ppm	ASTM D5185m	0	0	<1
Aluminum	ppm	ASTM D5185m >25	0	<1	0
Lead	ppm	ASTM D5185m >100	0	<1	0
Copper	ppm	ASTM D5185m >200	<1	<1	<1
Tin	ppm	ASTM D5185m >25	0	<1	0
Antimony	ppm	ASTM D5185m >5	---	---	0
Vanadium	ppm	ASTM D5185m	0	0	0
Cadmium	ppm	ASTM D5185m	0	0	0

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0	0
Barium	ppm	ASTM D5185m	0	0	0
Molybdenum	ppm	ASTM D5185m	0	0	0
Manganese	ppm	ASTM D5185m	<1	<1	<1
Magnesium	ppm	ASTM D5185m	2	0	0
Calcium	ppm	ASTM D5185m	<1	0	0
Phosphorus	ppm	ASTM D5185m	438	459	453
Zinc	ppm	ASTM D5185m	2	2	0
Sulfur	ppm	ASTM D5185m	43	30	26

CONTAMINANTS


	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >50	0	<1	0
Sodium	ppm	ASTM D5185m	<1	1	0
Potassium	ppm	ASTM D5185m >20	0	4	0

VISUAL

	method	limit/base	current	history1	history2
White Metal	scalar	*Visual NONE	MODER	NONE	VLITE
Yellow Metal	scalar	*Visual NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual NONE	NONE	NONE	NONE
Silt	scalar	*Visual NONE	NONE	NONE	NONE
Debris	scalar	*Visual NONE	▲ MODER	▲ MODER	LIGHT
Sand/Dirt	scalar	*Visual NONE	NONE	NONE	NONE
Appearance	scalar	*Visual NORML	NORML	▲ HAZY	NORML
Odor	scalar	*Visual NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual >0.2	NEG	0.2%	NEG
Free Water	scalar	*Visual	NEG	NEG	NEG



OIL ANALYSIS REPORT

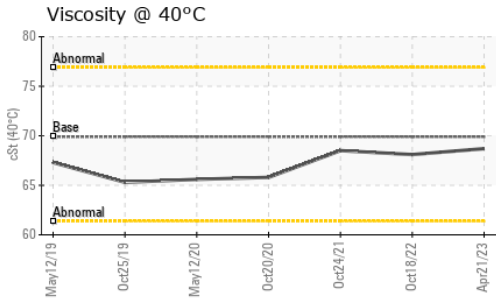




FLUID PROPERTIES	method	limit/base	current	history1	history2
------------------	--------	------------	---------	----------	----------

Visc @ 40°C	cSt	ASTM D445	69.9	68.1	68.5
-------------	-----	-----------	------	------	------

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------



GRAPHS

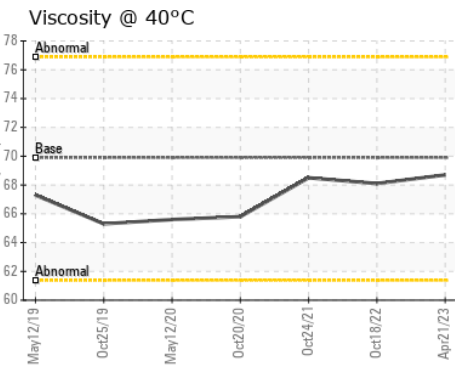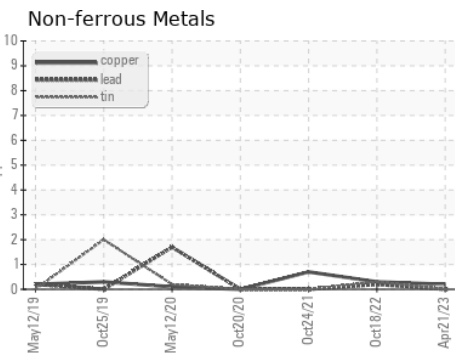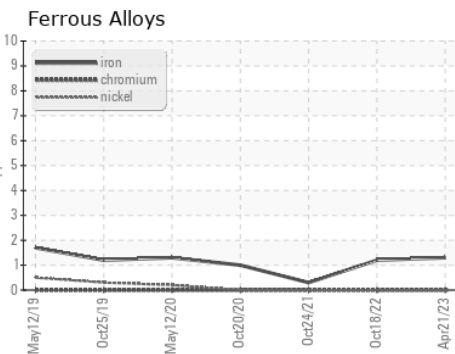

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0805912
Lab Number : 05833318
Unique Number : 10446811
Test Package : IND 1

LEPRINO FOODS-GREELEY
 1302 1ST AVE
 GREELEY, CO
 US 80631-5909
 Contact: ERIC KLINE
 EKLINE@LEPRINOFODS.COM
 T:
 F: (970)347-5190

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)