




PROBLEM SUMMARY

Sample Rating Trend


WATER



Machine Id
NOT GIVEN KCPA002419 (S/N NO INFO ON SIF/BOTTLE)
 Component
Compressor
 Fluid
NOT GIVEN (--- GAL)

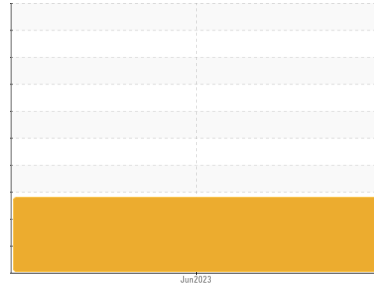

COMPONENT CONDITION SUMMARY

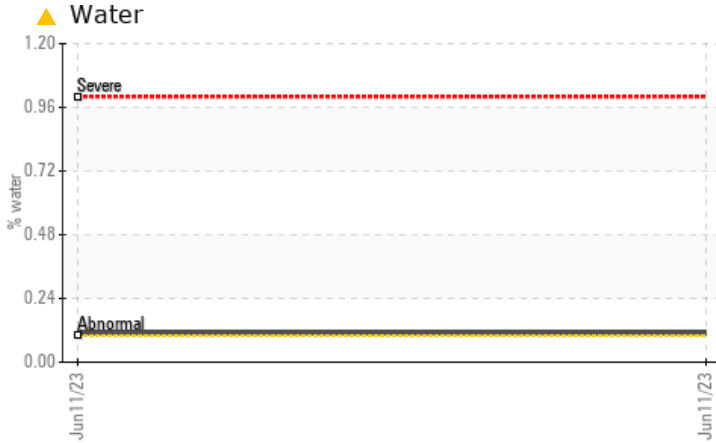

RECOMMENDATION

We recommend you service the filters on this component. We were unable to perform a particle count due to a high concentration of particles present in this sample. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition.

PROBLEMATIC TEST RESULTS

Sample Status				ABNORMAL	---	---
Water	%	ASTM D6304	>0.1	▲ 0.109	---	---
ppm Water	ppm	ASTM D6304	>1000	▲ 1090	---	---
Debris	scalar	*Visual	NONE	▲ MODER	---	---
Appearance	scalar	*Visual	NORML	▲ HAZY	---	---
Emulsified Water	scalar	*Visual	>0.1	▲ 0.2%	---	---

Customer Id: KAEFRE
Sample No.: KCPA002419
Lab Number: 05870962
Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Don Baldrige +1
don.b505@comcast.net

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS


Action	Status	Date	Done By	Description
Change Filter	---	---	?	We recommend you service the filters on this component.
Alert	---	---	?	We were unable to perform a particle count due to a high concentration of particles present in this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

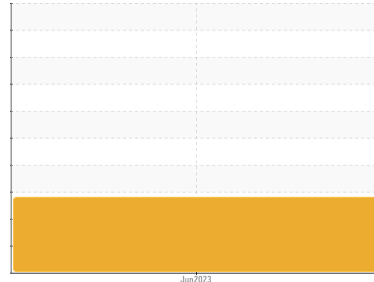

WATER



Machine Id
NOT GIVEN KCPA002419 (S/N NO INFO ON SIF/BOTTLE)

Component
Compressor
Fluid
NOT GIVEN (--- GAL)

DIAGNOSIS

▲ Recommendation

We recommend you service the filters on this component. We were unable to perform a particle count due to a high concentration of particles present in this sample. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition.

Wear

All other component wear rates are normal.

▲ Contamination

Moderate concentration of visible dirt/debris present in the oil. There is a light concentration of water present in the oil.

Fluid Condition

The AN level is acceptable for this fluid.

SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	KCPA002419	---	---
Sample Date	Client Info	11 Jun 2023	---	---
Machine Age	hrs	Client Info	0	---
Oil Age	hrs	Client Info	0	---
Oil Changed	Client Info	N/A	---	---
Sample Status		ABNORMAL	---	---

WEAR METALS

method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >50	<1	---
Chromium	ppm	ASTM D5185m >10	0	---
Nickel	ppm	ASTM D5185m	0	---
Titanium	ppm	ASTM D5185m	0	---
Silver	ppm	ASTM D5185m	0	---
Aluminum	ppm	ASTM D5185m >25	<1	---
Lead	ppm	ASTM D5185m >25	0	---
Copper	ppm	ASTM D5185m >50	7	---
Tin	ppm	ASTM D5185m >15	0	---
Vanadium	ppm	ASTM D5185m	0	---
Cadmium	ppm	ASTM D5185m	0	---

ADDITIVES

method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	---
Barium	ppm	ASTM D5185m	0	---
Molybdenum	ppm	ASTM D5185m	0	---
Manganese	ppm	ASTM D5185m	<1	---
Magnesium	ppm	ASTM D5185m	12	---
Calcium	ppm	ASTM D5185m	<1	---
Phosphorus	ppm	ASTM D5185m	3	---
Zinc	ppm	ASTM D5185m	66	---
Sulfur	ppm	ASTM D5185m	23188	---




CONTAMINANTS

method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >25	0	---
Sodium	ppm	ASTM D5185m	4	---
Potassium	ppm	ASTM D5185m >20	<1	---
Water	%	ASTM D6304 >0.1	▲ 0.109	---
ppm Water	ppm	ASTM D6304 >1000	▲ 1090	---

FLUID DEGRADATION

method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.45	---

OIL ANALYSIS REPORT

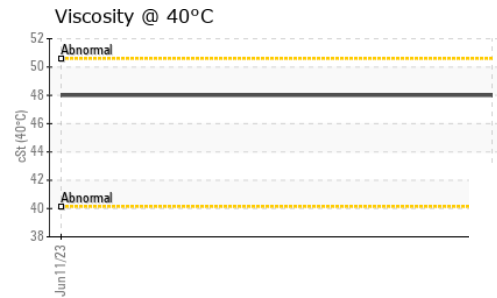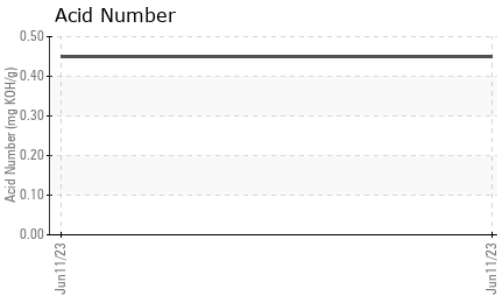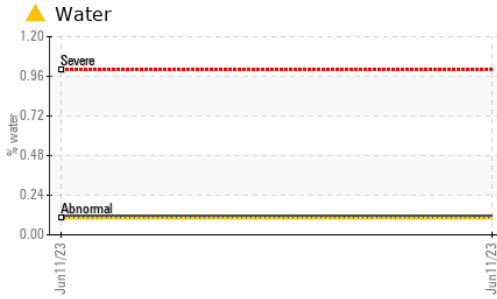





VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	---
Yellow Metal	scalar	*Visual	NONE	NONE	---
Precipitate	scalar	*Visual	NONE	NONE	---
Silt	scalar	*Visual	NONE	NONE	---
Debris	scalar	*Visual	NONE	▲ MODER	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---
Appearance	scalar	*Visual	NORML	▲ HAZY	---
Odor	scalar	*Visual	NORML	NORML	---
Emulsified Water	scalar	*Visual	>0.1	▲ 0.2%	---
Free Water	scalar	*Visual		NEG	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	48.0	---	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

Color				no image	no image
Bottom				no image	no image

GRAPHS

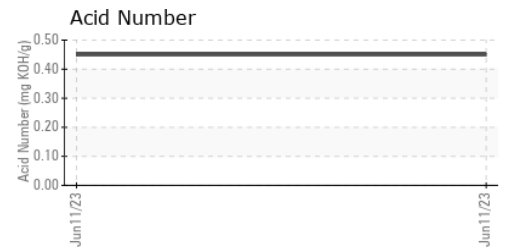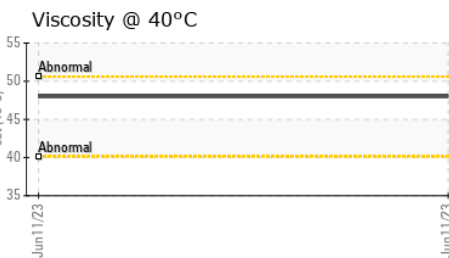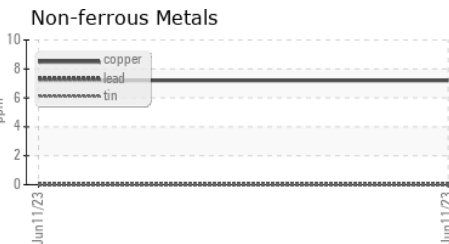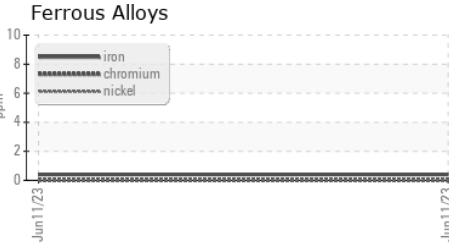

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
 Sample No. : KCPA002419 Received : 12 Jun 2023
 Lab Number : 05870962 Diagnosed : 14 Jun 2023
 Unique Number : 10510746 Diagnostician : Don Baldrige
 Test Package : IND 2 (Additional Tests: KF, PrtCount)

KAESER COMPRESSOR
 511 SIGMA DRIVE
 FREDERICKSBURG, VA
 US 22408
 Contact: Warranty Department
 warranty.us@kaeser.com
 T: (540)898-5500
 F: (540)898-5520

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)