


# **OIL ANALYSIS REPORT**

# ROTO XTEND Machine Id ATLAS COPCO API253051 - MILAN LUMBER

Component

Compressor

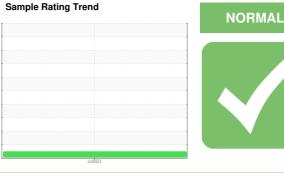

#### DIAGNOSIS

## Recommendation

Resample at the next service interval to monitor.

#### Wear

All component wear rates are normal.

## Contamination

There is no indication of any contamination in the oil


## **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Jul2023		
OAMBLE INFORM	4ATION!		11 1.0			
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH05900046		
Sample Date		Client Info		11 Jul 2023		
Machine Age	hrs	Client Info		436		
Oil Age	hrs	Client Info		1000		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>5	0		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>15	<1		
Lead	ppm	ASTM D5185m	>65	0		
Copper	ppm	ASTM D5185m	>65	2		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		214		
Zinc	ppm	ASTM D5185m		50		
Sulfur	ppm	ASTM D5185m		1372		
CONTAMINANTS		method	limit/base		history1	history2
	•			current	HISTORY	HISTOLYZ
Silicon	ppm	ASTM D5185m	>35	1		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	0		
FLUID DEGRADA	NOITA	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.14	0.08		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	LIGHT		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
<b>Emulsified Water</b>	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		



# **OIL ANALYSIS REPORT**

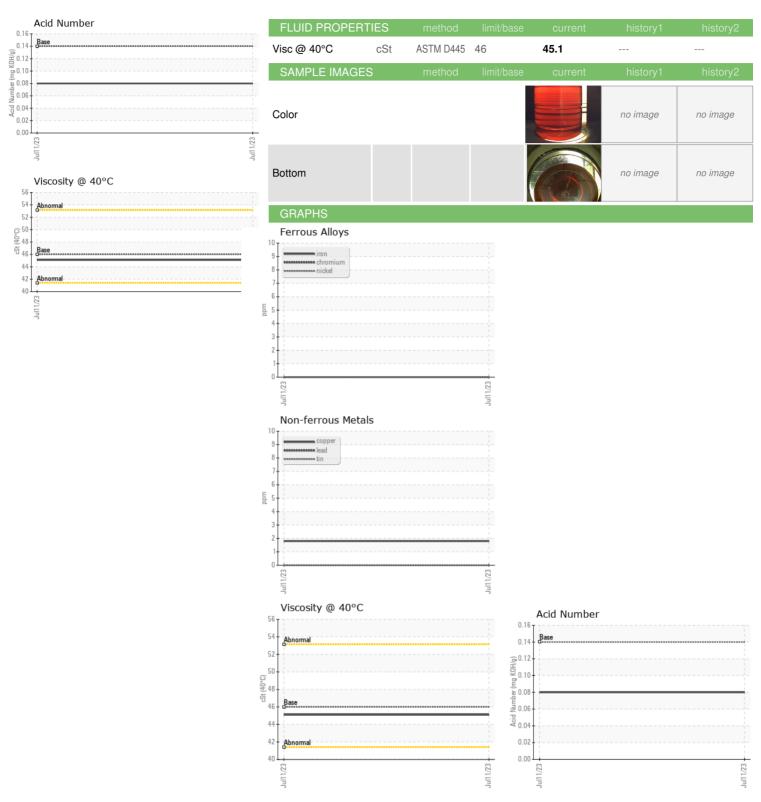





Laboratory Sample No. Lab Number Unique Number : 10561402

: 05900046

: UCH05900046 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 17 Jul 2023

Diagnosed : 18 Jul 2023 Diagnostician : Don Baldridge

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

D.L. THURROTT AIR PRODUCTS

84 EASTERN AVE WATERVILLE, ME US 04901

Contact: ROBERT TOWNE

rtowne@inscogroup.com

T: F:

Contact/Location: ROBERT TOWNE - UCDLTWAT