




PROBLEM SUMMARY

Sample Rating Trend

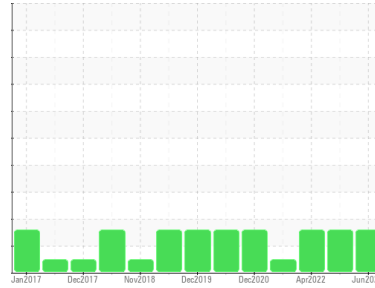


WATER



Area
NEW LYO
 Machine Id
MYCOM MYCOM 1 - IMMUCELL
 Component
Refrigeration Compressor
 Fluid
ICI EMKARATE RL 46H (--- GAL)

COMPONENT CONDITION SUMMARY

▲ Water

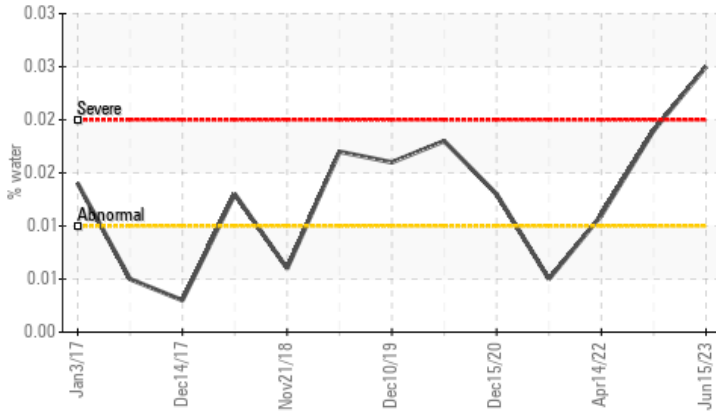

RECOMMENDATION

No corrective action is recommended at this time.
 Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status				MARGINAL	MARGINAL	MARGINAL
Water	%	ASTM D6304	>0.01	▲ 0.025	▲ 0.019	▲ 0.011
ppm Water	ppm	ASTM D6304	>100	▲ 253.2	▲ 191.4	▲ 110.1

Customer Id: AAASCA
 Sample No.: WC0736120
 Lab Number: 05900746
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Angela Borella +1 800-237-1369
angela.borella@wearcheckusa.com

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

08 May 2023 Diag: Angela Borella

WATER



No corrective action is recommended at this time. Resample at the next service interval to monitor. All component wear rates are normal. There is a trace of moisture present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



14 Apr 2022 Diag: Doug Bogart

WATER



No corrective action is recommended at this time. Resample at the next service interval to monitor. All component wear rates are normal. There is a trace of moisture present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



05 Jan 2022 Diag: Don Baldrige

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


view report





OIL ANALYSIS REPORT

Sample Rating Trend

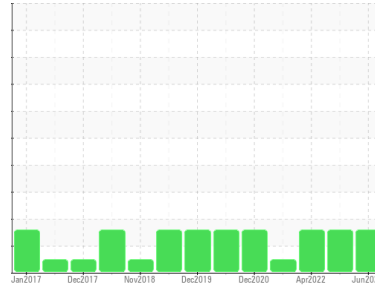

WATER



Area
NEW LYO
 Machine Id
MYCOM MYCOM 1 - IMMUCELL
 Component
Refrigeration Compressor
 Fluid
ICI EMKARATE RL 46H (--- GAL)

DIAGNOSIS

▲ Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

▲ Contamination

There is a trace of moisture present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0736120	WC0675164	WC0675159
Sample Date	Client Info		15 Jun 2023	08 May 2023	14 Apr 2022
Machine Age	hrs	Client Info	16865	14205	0
Oil Age	hrs	Client Info	0	0	0
Oil Changed	Client Info		N/A	N/A	N/A
Sample Status			MARGINAL	MARGINAL	MARGINAL

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >8	<1	<1	<1
Chromium	ppm	ASTM D5185m >2	0	0	0
Nickel	ppm	ASTM D5185m	<1	0	0
Titanium	ppm	ASTM D5185m	0	0	0
Silver	ppm	ASTM D5185m >2	0	0	0
Aluminum	ppm	ASTM D5185m >3	0	0	0
Lead	ppm	ASTM D5185m >2	0	0	0
Copper	ppm	ASTM D5185m >8	<1	<1	<1
Tin	ppm	ASTM D5185m >4	<1	<1	<1
Antimony	ppm	ASTM D5185m	---	---	---
Vanadium	ppm	ASTM D5185m	0	0	0
Cadmium	ppm	ASTM D5185m	0	0	0

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0	<1
Barium	ppm	ASTM D5185m	0	0	0
Molybdenum	ppm	ASTM D5185m	0	0	0
Manganese	ppm	ASTM D5185m	0	0	0
Magnesium	ppm	ASTM D5185m	0	0	0
Calcium	ppm	ASTM D5185m	0	0	0
Phosphorus	ppm	ASTM D5185m	0	4	8
Zinc	ppm	ASTM D5185m	0	0	0
Sulfur	ppm	ASTM D5185m	0	0	0

CONTAMINANTS




	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >15	<1	<1	<1
Sodium	ppm	ASTM D5185m	0	0	0
Potassium	ppm	ASTM D5185m >20	1	<1	0
Water	%	ASTM D6304 >0.01	▲ 0.025	▲ 0.019	▲ 0.011
ppm Water	ppm	ASTM D6304 >100	▲ 253.2	▲ 191.4	▲ 110.1

FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974 0.02	0.014	0.029	0.015




OIL ANALYSIS REPORT

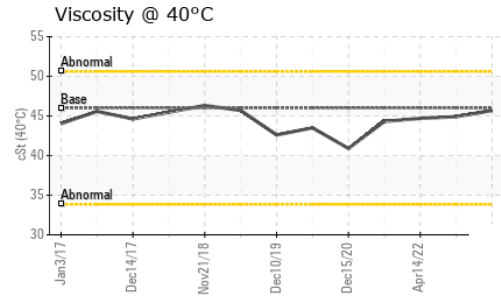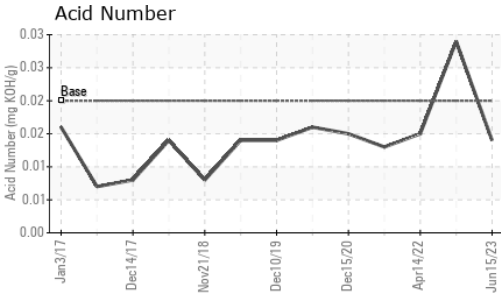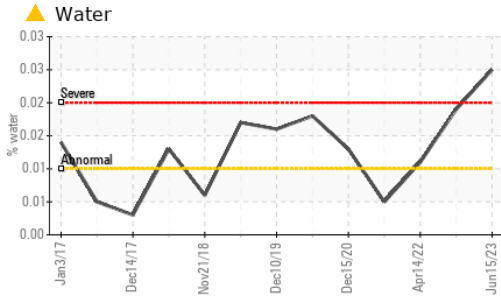





VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.01	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	46.0	45.7	44.9

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

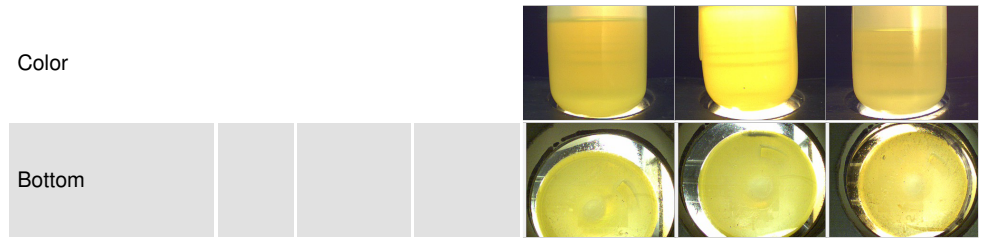

GRAPHS

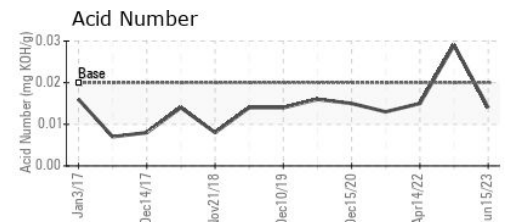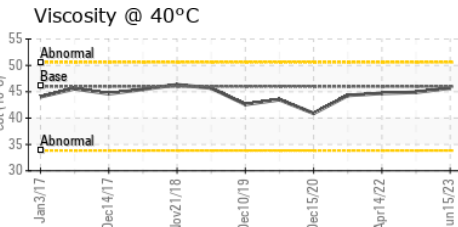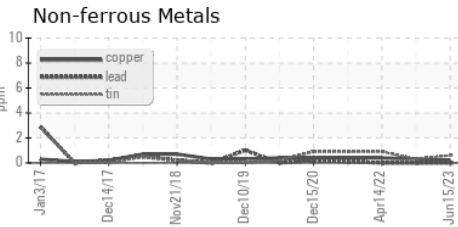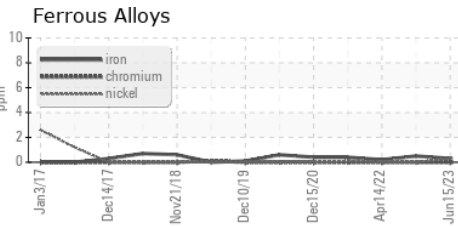

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0736120 **Received** : 17 Jul 2023
Lab Number : 05900746 **Diagnosed** : 19 Jul 2023
Unique Number : 10562102 **Diagnostician** : Angela Borella
Test Package : IND 2

AAA ENERGY SERVICES
 4 COMMERCIAL RD
 SCARBOROUGH, ME
 US 04074
 Contact: CHRIS WASSON
 cwasson@aaaenergy.com
 T: (207)883-1473
 F: x:

Certificate L2367
 To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)