


OIL ANALYSIS REPORT

Sample Rating Trend





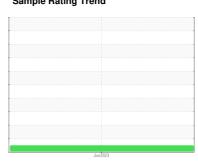

Machine Id 118 Component

Hydraulic System

PETRO CANADA 10W (--- GAL)

Recommendation

Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the

Fluid Condition


The condition of the oil is acceptable for the time in

			Jun ² 023			
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0822393		
Sample Date		Client Info		21 Jun 2023		
Machine Age	hrs	Client Info		3302		
Oil Age	hrs	Client Info		242		
Oil Changed	1110	Client Info		N/A		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	9		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m	>10	0		
Titanium	ppm	ASTM D5185m	7.0	<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>10	<1		
Lead	ppm	ASTM D5185m	>10	<1		
Copper	ppm		>75	8		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m	7.0	0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES	la la		12 21 /1		la faction and	la la tarre O
		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		10		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		1		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		13		
Calcium	ppm	ASTM D5185m		533		
Phosphorus	ppm	ASTM D5185m		733		
Zinc	ppm	ASTM D5185m ASTM D5185m		946		
Sulfur	ppm			1973		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>20	3		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	2		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPERT	IES	method	limit/base	current	history1	history2



OIL ANALYSIS REPORT



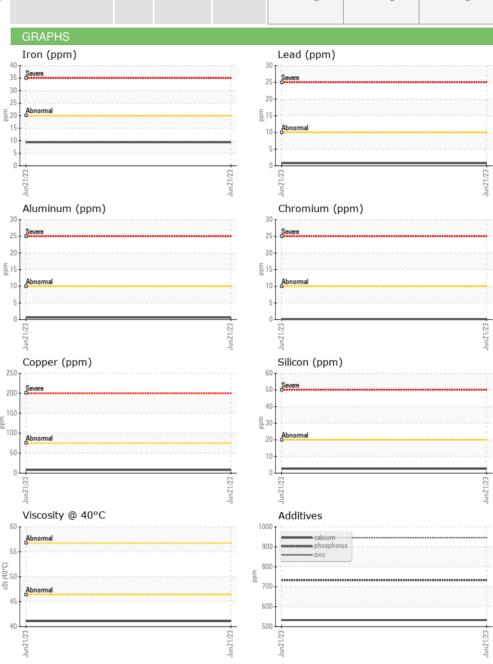



Certificate L2367

Laboratory Sample No. Lab Number

: WC0822393 : 05900878 Unique Number : 10562234 Test Package : MOB 1

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 17 Jul 2023 Diagnosed : 19 Jul 2023 Diagnostician : Wes Davis

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

C.L. BENTON & SONS INC

706 38TH AVE N MYRTLE BEACH, SC US 29577

Contact: NEIL neil@clbenton.com

no image

no image

T: F:

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: NEIL ? - CLBMYR