




FUEL REPORT

Sample Rating Trend

NORMAL

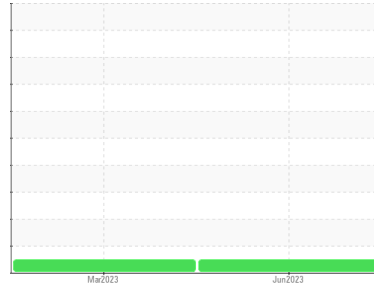

Machine Id
SPACE X JRTI - GEN 1

Component
Tank Diesel Fuel
Fluid
DDSL (2500 GAL)

DIAGNOSIS

Recommendation

All laboratory tests indicate that this sample meets specifications for No.2 low-sulfur diesel fuel.

Corrosion

All metal levels are normal indicating no corrosion in the system.

Contaminants

The water content is negligible. There is no bacteria or fungus (yeast and/or mold) indicated in the sample. There is no indication of any contamination in the fuel.

Fuel Condition

Sulfur value derived by ASTM D5453 method for ULSD validation.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			WC05901756	WCDF4366	---
Sample Date	Client Info			30 Jun 2023	22 Mar 2023	---
Machine Age	mls	Client Info		0	0	---
Sample Status				NORMAL	NORMAL	---





PHYSICAL PROPERTIES		method	limit/base	current	history1	history2
ASTM Color	scalar	*ASTM D1500		L4.0	L4.5	---
Visc @ 40°C	cSt	ASTM D445		3.07	3.01	---

SULFUR CONTENT		method	limit/base	current	history1	history2
Sulfur	ppm	ASTM D5185m		171	10	---
Sulfur (UVF)	ppm	ASTM D5453		116	10	---

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	<1.0	0	0	---
Sodium	ppm	ASTM D5185m	<0.1	0	<1	---
Potassium	ppm	ASTM D5185m	<0.1	0	0	---
Water	%	ASTM D6304	<0.05	0.003	0.003	---
ppm Water	ppm	ASTM D6304	<500	37.1	38.3	---
% Gasoline	%	*In-House	<0.50	0.0	0.0	---
% Biodiesel	%	*In-House	<20.0	0.0	0.0	---

HEAVY METALS		method	limit/base	current	history1	history2
Aluminum	ppm	ASTM D5185m	<0.1	<1	0	---
Nickel	ppm	ASTM D5185m	<0.1	0	0	---
Lead	ppm	ASTM D5185m	<0.1	0	0	---
Vanadium	ppm	ASTM D5185m	<0.1	<1	0	---
Iron	ppm	ASTM D5185m	<0.1	0	0	---
Calcium	ppm	ASTM D5185m	<0.1	0	0	---
Magnesium	ppm	ASTM D5185m	<0.1	<1	0	---
Phosphorus	ppm	ASTM D5185m	<0.1	1	<1	---
Zinc	ppm	ASTM D5185m	<0.1	0	0	---




SAMPLE IMAGES		method	limit/base	current	history1	history2
---------------	--	--------	------------	---------	----------	----------

Color						no image
Bottom						no image



FUEL REPORT

GRAPHS

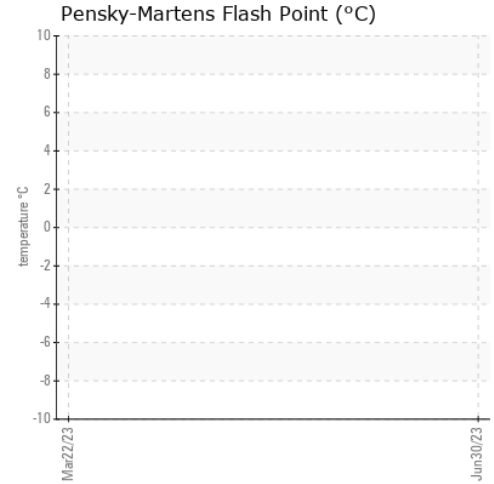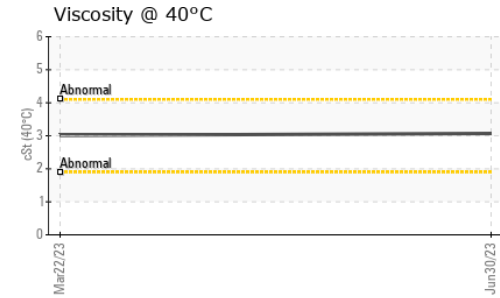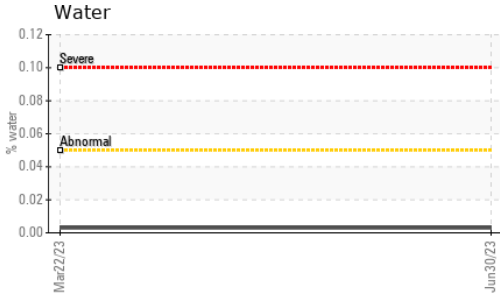

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC05901756 **Received** : 18 Jul 2023
Lab Number : 05901756 **Diagnosed** : 25 Jul 2023
Unique Number : 10563112 **Diagnostician** : Doug Bogart
Test Package : DF-5 (Additional Tests: Screen, Sulphur-Active)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

TANK WIZARDS
 1511 MASTERS RD NW
 PALM BAY, FL
 US 32907
 Contact: WENDALL STRODERD
 wendall@tankwizards.com
 T: (321)427-5149
 F: (321)574-4131