

FUEL REPORT

Sample Rating Trend

VISUAL METAL

SPACE X JRTI DECK

Forward Diesel Fuel Fluid DDSL (45000 GAL)

DIAGNOSIS

Recommendation

We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid. We advise that you inspect for the source(s) of rust. We recommend you service and check the fuel filters for mucous-like deposits. Check with fuel supplier for biocides available to destroy the microorganisms in the fuel system.

Corrosion

Moderate concentration of visible metal present as rust.

Contaminants

Moderate concentration of visible dirt/debris present in the fuel. Possible bacteria or fungus (yeast and/or mold) indicated in the sample. The water content is negligible.

Fuel Condition


Sulfur value derived by ASTM D5453 method for ULSD validation.


				Jun2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC05901759		
Sample Date		Client Info		30 Jun 2023		
Machine Age	mls	Client Info		0		
Sample Status				ABNORMAL		
PHYSICAL PROP	PERTIES	method	limit/base	current	history1	history2
ASTM Color	scalar	*ASTM D1500		L4.0		
Visc @ 40°C	cSt	ASTM D445		3.07		
SULFUR CONTE	NT	method	limit/base	current	history1	history2
Sulfur	ppm	ASTM D5185m		156		
Sulfur (UVF)	ppm	ASTM D5453		114		
CONTAMINANTS	5	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	<1.0	0		
Sodium	ppm	ASTM D5185m	<0.1	0		
Potassium	ppm	ASTM D5185m	<0.1	0		
Water	%	ASTM D6304	<0.05	0.003		
ppm Water	ppm	ASTM D6304	<500	33.4		
% Gasoline	%	*In-House	<0.50	0.0		
% Biodiesel	%	*In-House	<20.0	0.0		
HEAVY METALS		method	limit/base	current	history1	history2
Aluminum	ppm	ASTM D5185m	<0.1	<1		
Nickel	ppm	ASTM D5185m	<0.1	0		
Lead	ppm	ASTM D5185m	<0.1	0		
Vanadium	ppm	ASTM D5185m	<0.1	<1		
Iron	ppm	ASTM D5185m	<0.1	0		
Calcium	ppm	ASTM D5185m	<0.1	0		
Magnesium	ppm	ASTM D5185m	<0.1	0		
Phosphorus	ppm	ASTM D5185m	<0.1	<1		
Zinc	ppm	ASTM D5185m	<0.1	0		
SAMPLE IMAGES	S	method	limit/base	current	history1	history2
Color					no image	no image
Bottom					no image	no image




FUEL REPORT

GRAPHS

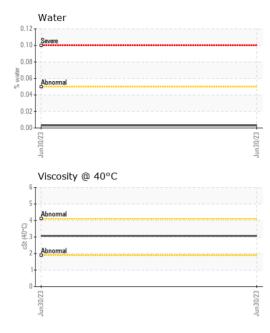

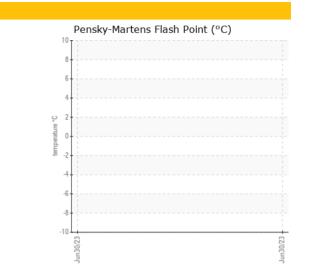

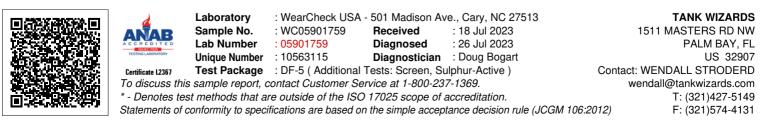

Contact/Location: 321-285-8878 X1 - WENDALL STRODERD - TANPAL

Page 2 of 2