

# **PROBLEM SUMMARY**

7

Sample Rating Trend

VIS DEBRIS

VIS DEBNIS

# KAESER 8172906

Component

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

## **COMPONENT CONDITION SUMMARY**

No relevant graphs to display

#### RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

PROBLEMATIC TEST RESULTS							
Sample Status ABNORI					ABNORMAL		
Debris	scalar	*Visual	NONE	▲ MODER	NONE		

Customer Id: OLAOLAKS Sample No.: KC110203 Lab Number: 05901902 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

## **RECOMMENDED ACTIONS**

Action	Status	Date	Done By	Description
Alert			?	We were unable to perform a particle count due to a high concentration of particles present in this sample.

## HISTORICAL DIAGNOSIS

17 Aug 2022 Diag: Don Baldridge

ISO



No corrective action is recommended at this time. Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





# **OIL ANALYSIS REPORT**



**VIS DEBRIS** 



**KAESER 8172906** 

Component

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

## **DIAGNOSIS**

#### Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

#### Wear

All component wear rates are normal.

#### Contamination

Moderate concentration of visible dirt/debris present in the oil.

#### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

			Aug2022	Jul2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KC110203	KCP49315	
Sample Date		Client Info		06 Jul 2023	17 Aug 2022	
Machine Age	hrs	Client Info		7614	3717	
Oil Age	hrs	Client Info		3897	3000	
Oil Changed		Client Info		Not Changd	Changed	
Sample Status				ABNORMAL	ABNORMAL	
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	<1	2	
Chromium	ppm	ASTM D5185m	>10	0	0	
Nickel	ppm	ASTM D5185m	>3	0	0	
Titanium	ppm	ASTM D5185m	>3	0	0	
Silver	ppm	ASTM D5185m	>2	0	0	
Aluminum	ppm	ASTM D5185m	>10	1	<1	
Lead	ppm	ASTM D5185m	>10	1	<1	
Copper	ppm	ASTM D5185m	>50	7	3	
Tin	ppm	ASTM D5185m	>10	0	<1	
Vanadium	ppm	ASTM D5185m		0	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	
Barium	ppm	ASTM D5185m	90	1	5	
Molybdenum	ppm	ASTM D5185m		0	0	
Manganese	ppm	ASTM D5185m		<1	<1	
Magnesium	ppm	ASTM D5185m	90	44	52	
Calcium	ppm	ASTM D5185m	2	<1	2	
Phosphorus	ppm	ASTM D5185m		1	4	
Zinc	ppm	ASTM D5185m		14	2	
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	2	<1	
Sodium	ppm	ASTM D5185m		5	10	
Potassium	ppm	ASTM D5185m	>20	3	8	
Water	%	ASTM D6304	>0.05	0.019	0.022	
ppm Water	ppm	ASTM D6304	>500	193.9	223.1	
FLUID CLEANLIN	ESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647			11106	
Particles >6µm		ASTM D7647	>1300		<u>▲</u> 5408	
Particles >14μm		ASTM D7647	>80		<b>▲</b> 412	
Particles >21µm		ASTM D7647	>20		<b>▲</b> 30	
Particles >38μm		ASTM D7647	>4		1	
Particles >71μm		ASTM D7647	>3		0	
Oil Cleanliness		ISO 4406 (c)	>/17/13		<u>\$\text{\Delta}\$ 21/20/16</u>	
FLUID DEGRADA	TION	method	limit/base	current	history1	history2

Acid Number (AN)


mg KOH/g ASTM D8045 0.4

0.35

0.35



## **OIL ANALYSIS REPORT**

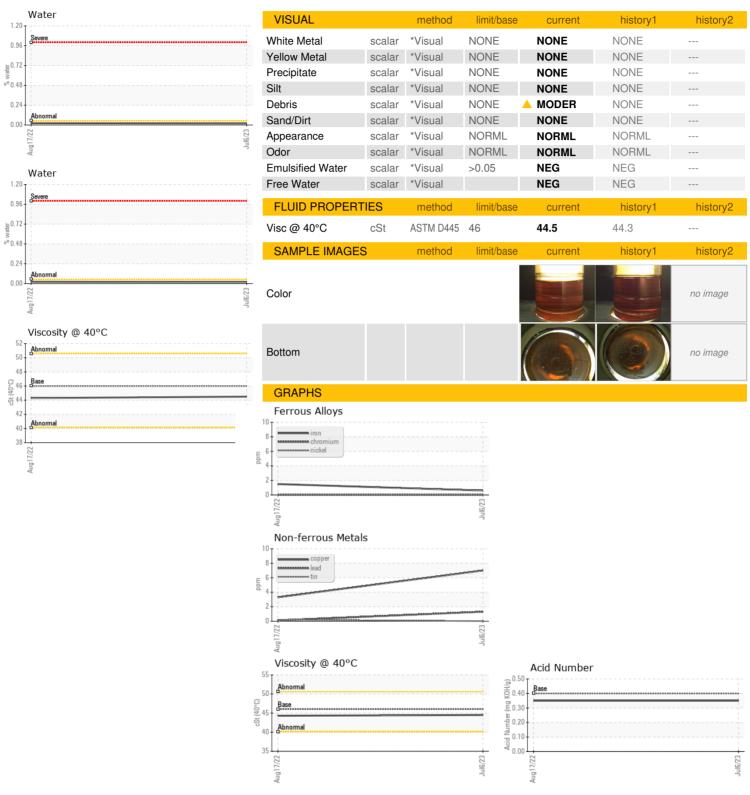





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number** 

: KC110203 : 05901902 : 10563258 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

: 18 Jul 2023 Received Diagnosed : 20 Jul 2023 : Don Baldridge Diagnostician

**OLATHE MEDICAL CENTER** 

20333 W 151ST ST OLATHE, KS US 66061

Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: F: