

OIL ANALYSIS REPORT

Sample Rating Trend



LINE 3 EXTRUDER

Gearbox Fluid MOBIL SHC 630 (25 GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		Apr2020	Dec2020 Jun2021	Jan2022 Jul2022	Jul2023	
SAMPLE INFORM	IATION	method				history2
Sample Number		Client Info		WC0838531	WC0656302	WC0656261
Sample Date		Client Info		14 Jul 2023	25 Jul 2022	06 Jan 2022
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	28	24	26
Chromium	ppm	ASTM D5185m	>15	0	0	0
Nickel	ppm	ASTM D5185m	>15	0	<1	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	<1	<1
Aluminum	ppm	ASTM D5185m	>25	<1	0	0
Lead	ppm	ASTM D5185m	>100	0	0	0
Copper	ppm	ASTM D5185m	>200	0	0	<1
Tin	ppm	ASTM D5185m	>25	0	<1	0
Antimony	ppm	ASTM D5185m	>5			0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	<1	<1
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		<1	<1	<1
Magnesium	ppm	ASTM D5185m		0	0	0
Calcium	ppm	ASTM D5185m		2	0	0
Phosphorus	ppm	ASTM D5185m		419	397	431
Zinc	ppm	ASTM D5185m		5	1	0
Sulfur	ppm	ASTM D5185m		397	401	449
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	5	7	7
Sodium	ppm	ASTM D5185m		0	0	0
Potassium	ppm	ASTM D5185m	>20	<1	0	0
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.50	0.53	0.520
				0.50		
VISUAL		method	limit/base	current	history1	history2
	scalar	method *Visual	limit/base			history2 NONE
White Metal	scalar scalar			current	history1	
White Metal Yellow Metal		*Visual	NONE	current NONE	history1 NONE	NONE
White Metal Yellow Metal Precipitate	scalar	*Visual *Visual	NONE NONE	current NONE NONE	history1 NONE NONE	NONE NONE
White Metal Yellow Metal Precipitate Silt	scalar scalar	*Visual *Visual *Visual	NONE NONE NONE	current NONE NONE NONE	history1 NONE NONE NONE	NONE NONE NONE
White Metal Yellow Metal Precipitate Silt Debris	scalar scalar scalar	*Visual *Visual *Visual *Visual	NONE NONE NONE NONE	Current NONE NONE NONE NONE	history1 NONE NONE NONE NONE	NONE NONE NONE NONE
White Metal Yellow Metal Precipitate Silt Debris Sand/Dirt	scalar scalar scalar scalar	*Visual *Visual *Visual *Visual *Visual	NONE NONE NONE NONE	Current NONE NONE NONE NONE NONE	history1 NONE NONE NONE NONE NONE	NONE NONE NONE VLITE
VISUAL White Metal Yellow Metal Precipitate Silt Debris Sand/Dirt Appearance Odor	scalar scalar scalar scalar scalar	*Visual *Visual *Visual *Visual *Visual *Visual	NONE NONE NONE NONE NONE	Current NONE NONE NONE NONE NONE NONE	history1 NONE NONE NONE NONE NONE	NONE NONE NONE VLITE NONE
White Metal Yellow Metal Precipitate Silt Debris Sand/Dirt Appearance	scalar scalar scalar scalar scalar scalar	*Visual *Visual *Visual *Visual *Visual *Visual	NONE NONE NONE NONE NONE NORE	Current NONE NONE NONE NONE NONE NONE	history1 NONE NONE NONE NONE NONE NONE NORML	NONE NONE NONE VLITE NONE NORML



OIL ANALYSIS REPORT

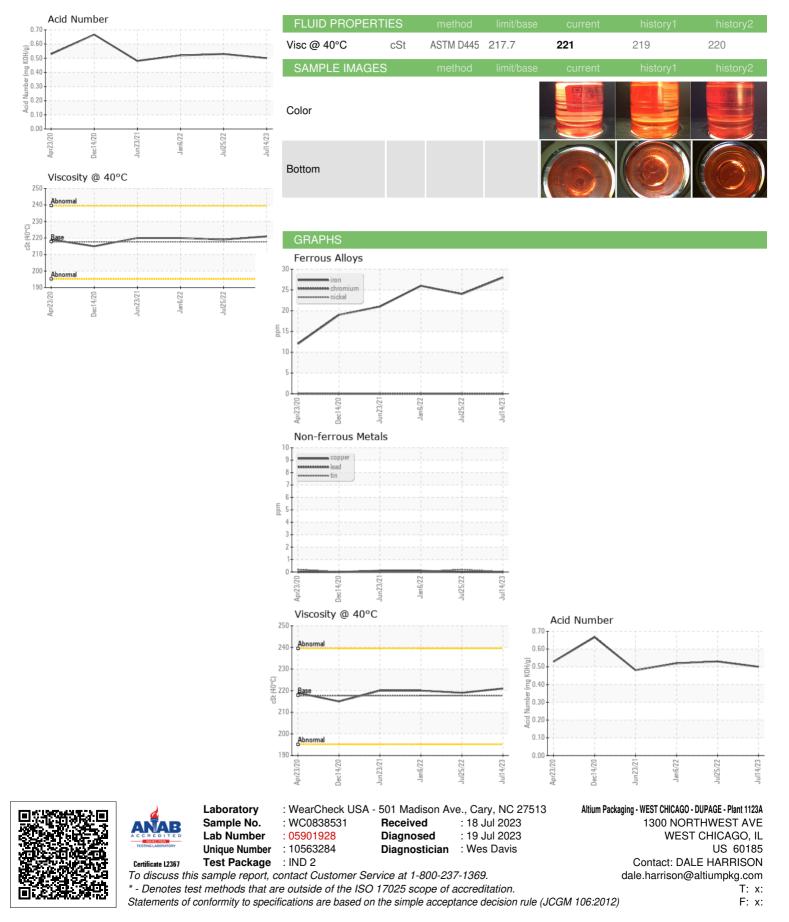

Contact/Location: DALE HARRISON - CONSTR