


# **OIL ANALYSIS REPORT**

### Sample Rating Trend



NORMAL

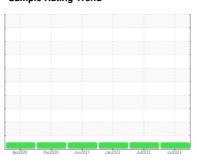

# LINE 1 EXTRUDER 1

Component Gearbox

MOBIL SHC 630 (3 GAL)

#### Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

#### Contamination

There is no indication of any contamination in the

## **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		Apr2020	Dec2020 Jun2021	Jan 2022 Jul 2022	Jul2023	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0838529	WC0656304	WC0656259
Sample Date		Client Info		14 Jul 2023	25 Jul 2022	06 Jan 2022
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	32	29	31
Chromium	ppm	ASTM D5185m	>15	0	0	0
Nickel	ppm	ASTM D5185m	>15	0	<1	0
Titanium	ppm	ASTM D5185m		0	0	<1
Silver	ppm	ASTM D5185m		0	<1	<1
Aluminum	ppm	ASTM D5185m	>25	1	0	0
Lead	ppm	ASTM D5185m	>100	0	0	<1
Copper	ppm	ASTM D5185m	>200	<1	<1	<1
Tin	ppm	ASTM D5185m	>25	0	<1	0
Antimony	ppm	ASTM D5185m	>5			0
Vanadium	ppm	ASTM D5185m	. •	0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
	ррпп		line it /le e e e			
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	<1	<1
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		<1	<1	<1
Magnesium	ppm	ASTM D5185m		0	0	0
Calcium	ppm	ASTM D5185m		0	0	0
Phosphorus	ppm	ASTM D5185m		443	408	474
Zinc	ppm	ASTM D5185m		3	3	0
Sulfur	ppm	ASTM D5185m		616	663	587
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	8	7	10
Sodium	ppm	ASTM D5185m		0	0	0
Potassium	ppm	ASTM D5185m	>20	<1	0	0
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.55	0.56	0.573
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	VLITE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG
	Journ	v iodai	- 0		DALETIADO	2011


1: DANECHARRISONNECONSTR


**NEG** 

scalar \*Visual





## **OIL ANALYSIS REPORT**

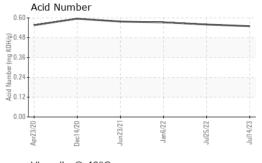


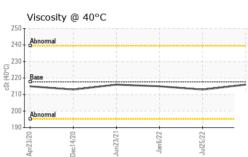




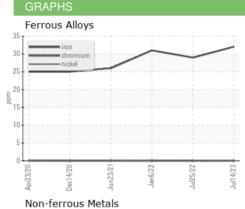

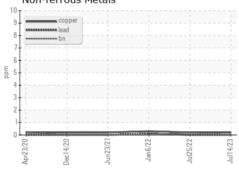

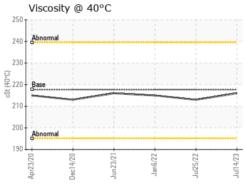

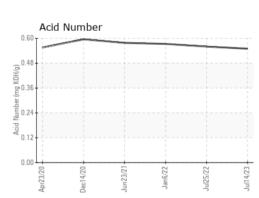



Certificate L2367

Laboratory Sample No. Lab Number **Unique Number** 

: WC0838529 : 05901932 : 10563288 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 18 Jul 2023

Diagnosed : 19 Jul 2023 Diagnostician : Wes Davis

1300 NORTHWEST AVE WEST CHICAGO, IL US 60185

Altium Packaging - WEST CHICAGO - DUPAGE - Plant 1123A

Contact: DALE HARRISON

dale.harrison@altiumpkg.com T: x:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: x: