

PROBLEM SUMMARY

Sample Rating Trend


ISO

KAESER SX 7.5 8149159 (S/N 1115)

Compressor

KAESER SIGMA (OEM) S-460 (--- QTS)

COMPONENT CONDITION SUMMARY

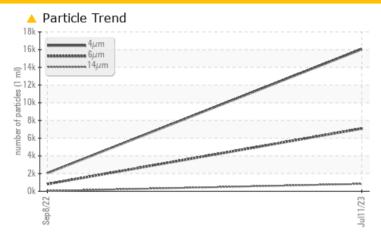

RECOMMENDATION

Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS										
Sample Status			ABNORMAL	NORMAL						
Particles >6µm	ASTM D7647	>1300	^ 7089	814						
Particles >14μm	ASTM D7647	>80	837	40						
Particles >21µm	ASTM D7647	>20	^ 270	7						
Particles >38μm	ASTM D7647	>4	<u> </u>	2						
Oil Cleanliness	ISO 4406 (c)	>/17/13	<u>^</u> 21/20/17	18/17/12						

Customer Id: IBIWES Sample No.: KC110967 Lab Number: 05902327 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

Action Status Date Done By Description Change Fluid --- ? Oil and filter change at the time of sampling has been noted. Change Filter --- ? Oil and filter change at the time of sampling has been noted.

HISTORICAL DIAGNOSIS

08 Sep 2022 Diag: Angela Borella

NORMAL



Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable. The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.






OIL ANALYSIS REPORT

KAESER SX 7.5 8149159 (S/N 1115)

Compressor

KAESER SIGMA (OEM) S-460 (--- QTS)

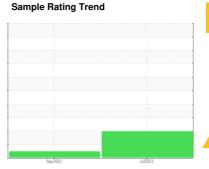



DIAGNOSIS

Recommendation

Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

			Sep 2022	Jul2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KC110967	KC97876	
Sample Date		Client Info		11 Jul 2023	08 Sep 2022	
Machine Age	hrs	Client Info		3760	2089	
Oil Age	hrs	Client Info		1329	0	
Oil Changed		Client Info		Changed	Changed	
Sample Status				ABNORMAL	NORMAL	
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	<1	1	
Chromium	ppm	ASTM D5185m	>10	0	0	
Nickel	ppm	ASTM D5185m	>3	0	0	
Titanium	ppm	ASTM D5185m	>3	0	0	
Silver	ppm	ASTM D5185m	>2	0	0	
Aluminum	ppm	ASTM D5185m	>10	<1	<1	
Lead	ppm	ASTM D5185m	>10	0	<1	
Copper	ppm	ASTM D5185m	>50	5	6	
Tin	ppm	ASTM D5185m	>10	0	<1	
Vanadium	ppm	ASTM D5185m		0	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	
Barium	ppm	ASTM D5185m	90	0	<1	
Molybdenum	ppm	ASTM D5185m		0	0	
Manganese	ppm	ASTM D5185m		0	<1	
Magnesium	ppm	ASTM D5185m	90	32	36	
Calcium	ppm	ASTM D5185m	2	0	1	
Phosphorus	ppm	ASTM D5185m		<1	8	
Zinc	ppm	ASTM D5185m		13	18	
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0	1	
Sodium	ppm	ASTM D5185m		13	15	
Potassium	ppm	ASTM D5185m	>20	3	2	
Water	%	ASTM D6304	>0.05	0.023	0.046	
ppm Water	ppm	ASTM D6304	>500	237.3	461.7	
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4μm		ASTM D7647		16045	2054	
Particles >6µm		ASTM D7647	>1300	^ 7089	814	
Particles >14µm		ASTM D7647	>80	837	40	
Particles >21µm		ASTM D7647	>20	<u>^</u> 270	7	
Particles >38µm		ASTM D7647	>4	<u> </u>	2	
Particles >71µm		ASTM D7647	>3	0	1	
Oil Cleanliness		ISO 4406 (c)	>/17/13	<u>^</u> 21/20/17	18/17/12	
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.4	0.26	0.28	



OIL ANALYSIS REPORT

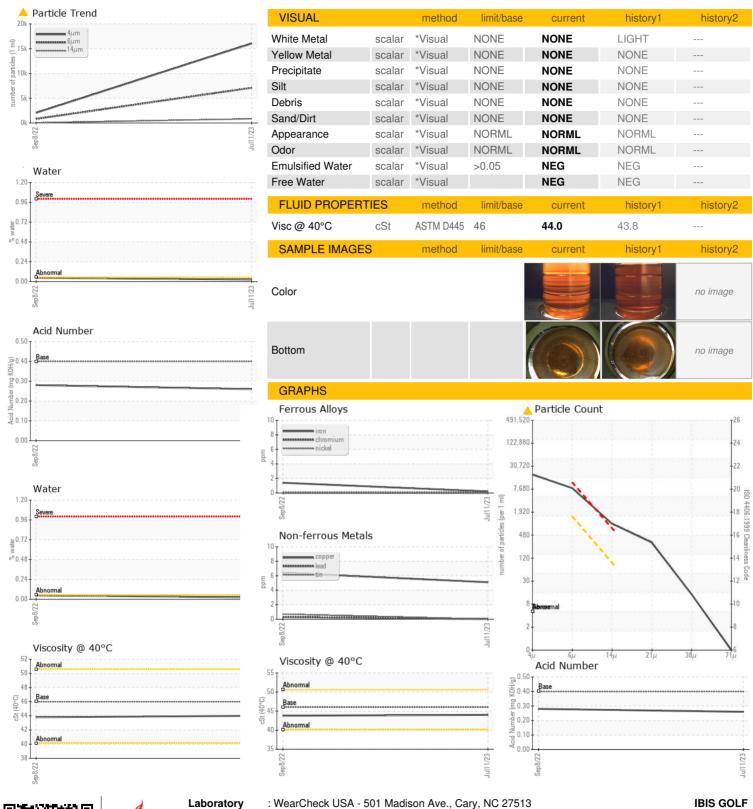



Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: KC110967 : 05902327

: 10563683 Test Package : IND 2

Received : 19 Jul 2023 Diagnosed : 21 Jul 2023 Diagnostician

: Don Baldridge

8001 SAND HILL-WAY EAST WEST PALM BEACH, FL US 33412

Contact: SERVICE MANAGER

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: F: