


OIL ANALYSIS REPORT



NORMAL

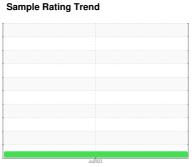

SEW EURODRIVE C

Component

Gearbox

NOT GIVEN (22 GAL)

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Jul2023		
SAMPLE INFORI	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0765645		
Sample Date		Client Info		11 Jul 2023		
Machine Age	yrs	Client Info		4		
Oil Age	yrs	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	8		
Chromium	ppm	ASTM D5185m	>15	0		
Nickel	ppm	ASTM D5185m	>15	0		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	0		
Lead	ppm	ASTM D5185m	>100	0		
Copper	ppm	ASTM D5185m	>200	0		
Tin	ppm	ASTM D5185m	>25	0		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
	nnm		mmbasc		•	,
Boron	ppm	ASTM D5185m		44		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		318		
Phosphorus	ppm	ASTM D5185m		363		
Zinc	ppm	ASTM D5185m		2		
Sulfur	ppm	ASTM D5185m		12359		
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	<1		
Sodium	ppm	ASTM D5185m		2		
Potassium	ppm	ASTM D5185m	>20	0		
FLUID DEGRAD	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.46		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.2	NEG		
Free Water	scalar	*Visual		NEG		
1 10 50\ D					DODDY IAMEO	



OIL ANALYSIS REPORT

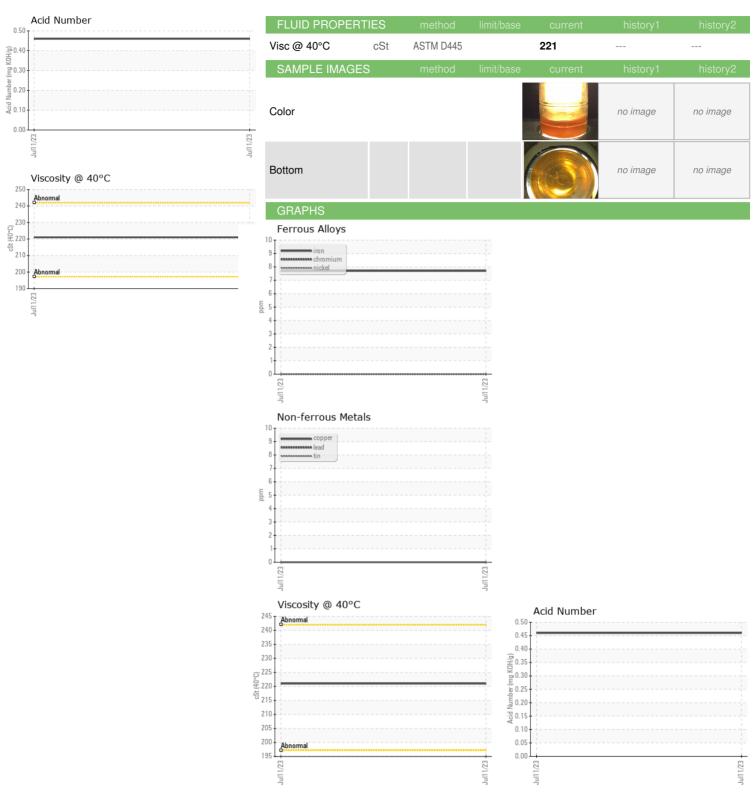





Certificate L2367

Laboratory Sample No. Lab Number

: 05902449 Unique Number : 10563805 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : WC0765645 Received : 19 Jul 2023

Diagnosed : 21 Jul 2023 Diagnostician : Don Baldridge

GOLD BOND BUILDING PRODUCTS 1725 DRYWALL DRIVE MOUNT HOLLY, NC US 28120

Contact: BOBBY JAMES robertja@goldbondbuilding.com T: (704)618-0255

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

Contact/Location: BOBBY JAMES - GOLMOUNC

F: