

# **FUEL REPORT**

# PMOAS2587530] Machine Id SGM32GPDF

Component **Diesel Fuel** 

**NOT GIVEN (--- GAL)** 

# Sample Rating Trend NO



### DIAGNOSIS

### Recommendation

All laboratory tests indicate that this sample meets specifications for No.2 ultra-low-sulfur diesel fuel.

### Corrosion

All metal levels are normal indicating no corrosion in the system.

### **Contaminants**

The water content is negligible. There is no bacteria or fungus (yeast and/or mold) indicated in the sample. There is no indication of any contamination in the fuel.


### **Fuel Condition**

Sulfur value derived by ASTM D5453 method for ULSD validation. Sulfur level is acceptable for ULSD specification.

				Jul2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		DC0030146		
Sample Date		Client Info		03 Jul 2023		
Machine Age	hrs	Client Info		196		
Sample Status				NORMAL		
PHYSICAL PROF	PERTIES	method	limit/base	current	history1	history2
ASTM Color	scalar	*ASTM D1500		L4.0		
Visc @ 40°C	cSt	ASTM D445		2.5		
SULFUR CONTE	NT	method	limit/base	current	history1	history2
Sulfur	ppm	ASTM D5185m		0		
Sulfur (UVF)	ppm	ASTM D5453		8		
IGNITION QUALI	TY	method	limit/base	current	history1	history2
API Gravity		ASTM D7777		36.9		
CONTAMINANTS	6	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	<1.0	0		
Sodium	ppm	ASTM D5185m	<0.1	<1		
Potassium	ppm	ASTM D5185m	<0.1	0		
Water	%	ASTM D6304	< 0.05	0.003		
ppm Water	ppm	ASTM D6304	<500	25.4		
% Gasoline	%	*In-House	< 0.50	0.0		
% Biodiesel	%	*In-House	<20.0	0.0		
HEAVY METALS		method	limit/base	current	history1	history2
Aluminum	ppm	ASTM D5185m	< 0.1	<1		
Nickel	ppm	ASTM D5185m	< 0.1	0		
Lead	ppm	ASTM D5185m	< 0.1	0		
Vanadium	ppm	ASTM D5185m	<0.1	<1		
Iron	ppm	ASTM D5185m	< 0.1	0		
Calcium	ppm	ASTM D5185m	<0.1	0		
Magnesium	ppm	ASTM D5185m	< 0.1	1		
Phosphorus	ppm	ASTM D5185m	< 0.1	2		
Zinc	ppm	ASTM D5185m	< 0.1	0		
SAMPLE IMAGES	S	method	limit/base	current	history1	history2
Color					no image	no image
Bottom					no image	no image



## **FUEL REPORT**

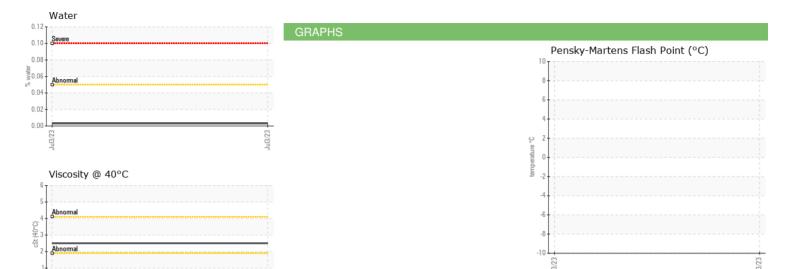



Certificate L2367

Laboratory Sample No. Lab Number Unique Number : 10564059

: DC0030146

: 05902703

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 19 Jul 2023 Diagnosed

: 25 Jul 2023 Diagnostician : Doug Bogart **Test Package**: DF-5 (Additional Tests: API, Cetane, Fuel, Screen)

**KELLY GENERATOR & EQUIPMENT INC** 1955 DALE LN

OWINGS, MD US 20736 Contact: LESLIE SNURR

F: (410)257-5227

LSNURR@KGE.COM T: (410)257-5225

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)