




PROBLEM SUMMARY

Sample Rating Trend

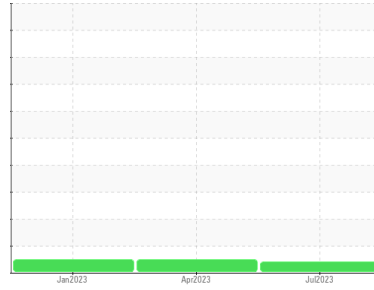

VIS DEBRIS



Area
LOHT
 Machine Id
[LOHT] LOHT-P-G0047B GRBX,ON CHRG PMP (B)
 Component
Gearbox
 Fluid
ROYAL PURPLE SYNFILM GT220 (--- QTS)

COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status		ABNORMAL	NORMAL	NORMAL
Debris	scalar *Visual	▲ MODER	NONE	NONE

Customer Id: CALSHR
 Sample No.: RP0034840
 Lab Number: 05904440
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Angela Borella +1 800-237-1369
angela.borella@wearcheckusa.com

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

05 Apr 2023 Diag: Wes Davis

NORMAL



Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. All component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



10 Jan 2023 Diag: Wes Davis

NORMAL



Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. All component wear rates are normal. The water content is negligible. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report






OIL ANALYSIS REPORT

Sample Rating Trend

VIS DEBRIS

Area
LOHT
 Machine Id
[LOHT] LOHT-P-G0047B GRBX,ON CHR G PMP (B)
 Component
Gearbox
 Fluid
ROYAL PURPLE SYNFILM GT220 (--- QTS)

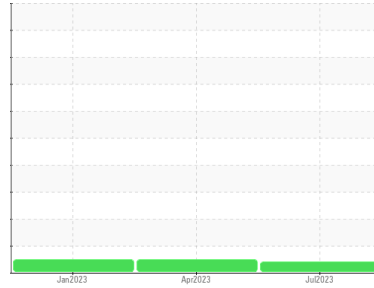

DIAGNOSIS

Recommendation
 Resample at the next service interval to monitor.

Wear
 All component wear rates are normal.

Contamination
 Moderate concentration of visible dirt/debris present in the oil.

Fluid Condition
 The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	RP0034840	RP0031625	RP0031648
Sample Date	Client Info	19 Jul 2023	05 Apr 2023	10 Jan 2023
Machine Age	hrs	Client Info	0	0
Oil Age	hrs	Client Info	0	0
Oil Changed	Client Info	Not Chngd	N/A	Not Chngd
Sample Status		ABNORMAL	NORMAL	NORMAL

WEAR METALS

method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185m >200	3	4	5
Chromium	ppm	ASTM D5185m >15	0	0	0
Nickel	ppm	ASTM D5185m >15	0	0	0
Titanium	ppm	ASTM D5185m	<1	0	0
Silver	ppm	ASTM D5185m	0	0	0
Aluminum	ppm	ASTM D5185m >25	<1	0	<1
Lead	ppm	ASTM D5185m >100	0	0	0
Copper	ppm	ASTM D5185m >200	<1	0	0
Tin	ppm	ASTM D5185m >25	0	0	0
Vanadium	ppm	ASTM D5185m	<1	0	0
Cadmium	ppm	ASTM D5185m	0	0	0

ADDITIVES

method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185m	0	0	0
Barium	ppm	ASTM D5185m	0	0	0
Molybdenum	ppm	ASTM D5185m	<1	<1	<1
Manganese	ppm	ASTM D5185m	<1	0	<1
Magnesium	ppm	ASTM D5185m 90	90	72	84
Calcium	ppm	ASTM D5185m	7	3	4
Phosphorus	ppm	ASTM D5185m	6	5	8
Zinc	ppm	ASTM D5185m	<1	0	0

CONTAMINANTS

method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185m >50	1	0	2
Sodium	ppm	ASTM D5185m	2	0	<1
Potassium	ppm	ASTM D5185m >20	0	<1	0
Water	%	ASTM D6304 >0.2	0.021	0.013	0.022
ppm Water	ppm	ASTM D6304 >2000	213.3	139.0	222.8




FLUID DEGRADATION

method	limit/base	current	history1	history2	
Acid Number (AN)	mg KOH/g	ASTM D8045 0.25	0.41	0.35	0.43

VISUAL


method	limit/base	current	history1	history2	
White Metal	scalar	*Visual NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual NONE	NONE	NONE	NONE
Silt	scalar	*Visual NONE	NONE	NONE	NONE
Debris	scalar	*Visual NONE	▲ MODER	NONE	NONE
Sand/Dirt	scalar	*Visual NONE	NONE	NONE	NONE
Appearance	scalar	*Visual NORML	NORML	NORML	NORML
Odor	scalar	*Visual NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual >0.2	NEG	NEG	NEG
Free Water	scalar	*Visual	NEG	Submitt	By: NICK FICHAERT

OIL ANALYSIS REPORT


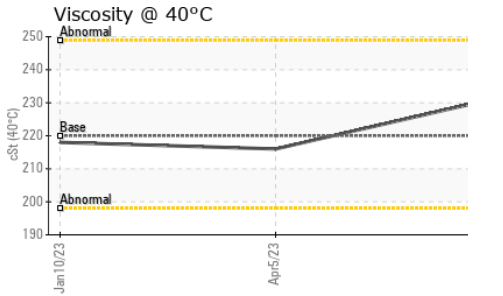
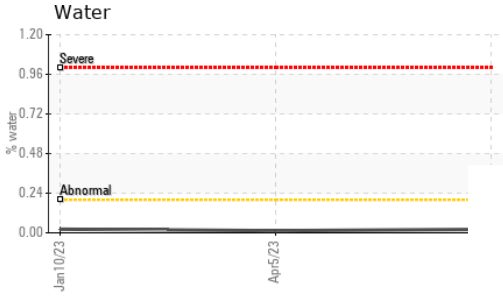
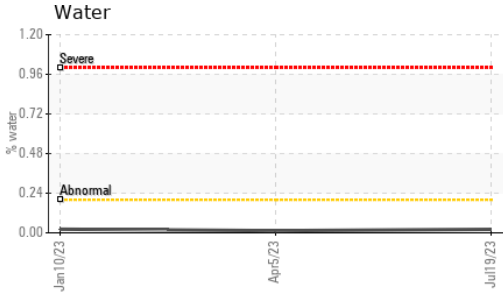


FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445 220	231	216	218

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

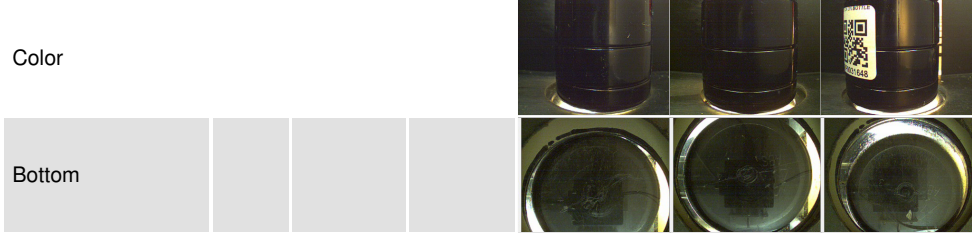

GRAPHS

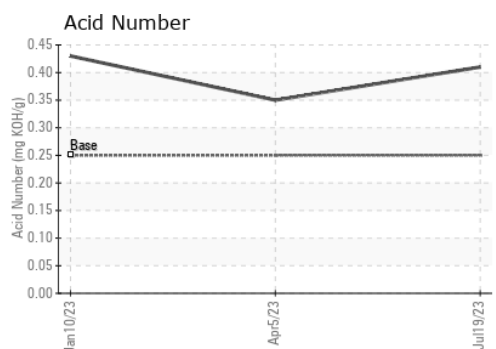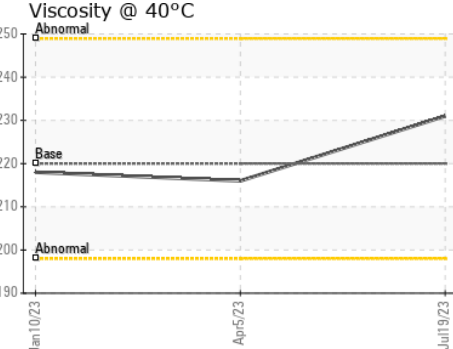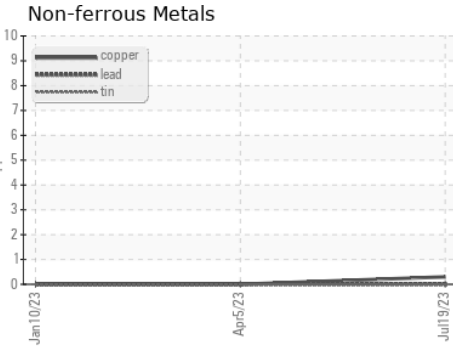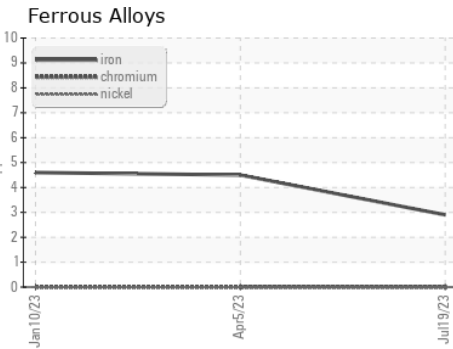

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : RP0034840 **Received** : 21 Jul 2023
Lab Number : **05904440** **Diagnosed** : 25 Jul 2023
Unique Number : 10565796 **Diagnostician** : Angela Borella
Test Package : IND 2

CALUMET
 3333 MIDWAY AVENUE
 SHREVEPORT, LA
 US 71109
 Contact: NICHOLAS LESAGE
 nicholas.lesage@clmt.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:
F: