

PROBLEM SUMMARY

Sample Rating Trend

VIS DEBRIS ne A...3007 C.4.3000 0.12010 4.02017 Feb.2014 Feb.2021

Machine Id TB-17 Component **Agitator Gearbox MOBIL MOBILGEAR 630 (8 GAL)**

COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

PROBLEMATIC T	EST RE	SULTS				
Sample Status				ABNORMAL	NORMAL	NORMAL
Debris	scalar	*Visual	NONE	▲ HEAVY	NONE	NONE

Customer Id: AVEMIL Sample No.: WC05905423 Lab Number: 05905423 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data: Angela Borella +1 800-237-1369 angela.borella@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Alert			?	We were unable to perform a particle count due to a high concentration of particles present in this sample.

HISTORICAL DIAGNOSIS

16 Feb 2021 Diag: Angela Borella

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report

30 Jan 2019 Diag: Jonathan Hester

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report

06 Jan 2017 Diag: Wes Davis

NORMAL




Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the component. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





OIL ANALYSIS REPORT

Sample Rating Trend

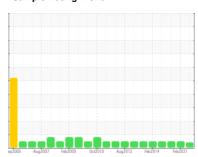

VIS DEBRIS



TB-17
Component

Agitator Gearbox

MOBIL MOBILGEAR 630 (8 GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

Wear

All component wear rates are normal.

Contamination

High concentration of visible dirt/debris present in the oil.


Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.


		ep2005 Au	g2007 Feb2009 Or	zt2010 Aug2012 Feb2014	Feb2021	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC05905423	WC0507884	WCI234133
Sample Date		Client Info		23 Jul 2023	16 Feb 2021	30 Jan 2019
Machine Age	mths	Client Info		0	0	0
Oil Age	mths	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	NORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>150	30	45	41
Chromium	ppm	ASTM D5185m	>10	0	<1	<1
Nickel	ppm	ASTM D5185m	>10	0	<1	<1
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		<1	0	0
Aluminum	ppm	ASTM D5185m	>25	0	0	<1
Lead	ppm	ASTM D5185m	>100	<1	<1	0
Copper	ppm	ASTM D5185m		<1	<1	<1
Tin	ppm	ASTM D5185m	>10	0	0	0
Antimony	ppm	ASTM D5185m			2	3
Vanadium	ppm	ASTM D5185m	70	0	0	0
Cadmium		ASTM D5185m		0	0	0
	ppm			U		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	2	2
Barium	ppm	ASTM D5185m		<1	0	<1
Molybdenum	ppm	ASTM D5185m		0	<1	0
Manganese	ppm	ASTM D5185m		<1	<1	<1
Magnesium	ppm	ASTM D5185m		4	4	4
Calcium	ppm	ASTM D5185m		29	37	44
Phosphorus	ppm	ASTM D5185m		234	241	234
Zinc	ppm	ASTM D5185m		4	0	8
Sulfur	ppm	ASTM D5185m		7500	6366	9108
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	<1	1	2
Sodium	ppm	ASTM D5185m		0	<1	<1
Potassium	ppm	ASTM D5185m	>20	1	<1	1
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.38	0.388	0.455
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
						NIGNIE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
	scalar scalar	*Visual *Visual	NONE	NONE NONE	NONE NONE	NONE
Precipitate						
Precipitate Silt	scalar scalar	*Visual *Visual	NONE	NONE	NONE	NONE
Precipitate Silt Debris	scalar scalar scalar	*Visual *Visual *Visual	NONE NONE NONE	NONE NONE HEAVY	NONE MODER NONE	NONE NONE
Precipitate Silt Debris Sand/Dirt	scalar scalar scalar scalar	*Visual *Visual *Visual *Visual	NONE NONE NONE	NONE NONE HEAVY NONE	NONE MODER NONE NONE	NONE NONE NONE
Precipitate Silt Debris Sand/Dirt Appearance	scalar scalar scalar scalar scalar	*Visual *Visual *Visual *Visual	NONE NONE NONE NONE NORML	NONE NONE HEAVY NONE NORML	NONE MODER NONE NONE NORML	NONE NONE NONE NONE NORML
Yellow Metal Precipitate Silt Debris Sand/Dirt Appearance Odor Emulsified Water	scalar scalar scalar scalar	*Visual *Visual *Visual *Visual	NONE NONE NONE	NONE NONE HEAVY NONE	NONE MODER NONE NONE	NONE NONE NONE



OIL ANALYSIS REPORT

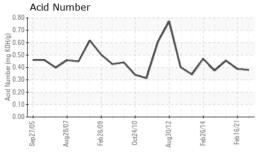


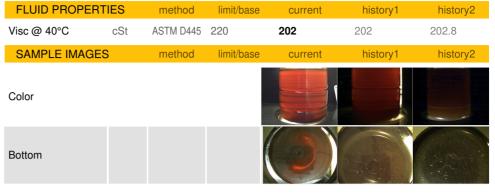


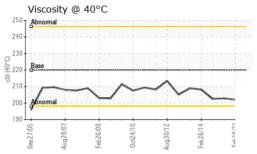



Ferrous Allovs

GRAPHS

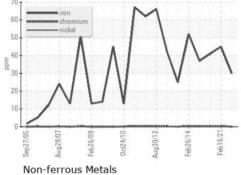

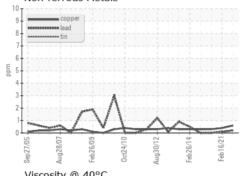

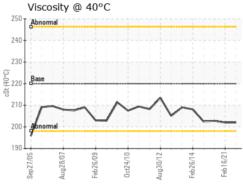

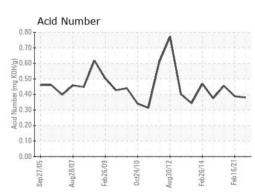





Certificate L2367

Laboratory Sample No. Lab Number Unique Number

: WC05905423

: 05905423 : 10566779

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 24 Jul 2023 Diagnosed

Diagnostician

: 25 Jul 2023 : Angela Borella

Test Package : IND 2 (Additional Tests: PrtCount)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

AVERY DENNISON CHEMICAL DIVISION

171 DRAKETOWN RD MILL HALL, PA

US 17751

Contact: DONALD EYER DONALD.EYER@AVERYDENNISON.COM

Contact/Location: DONALD EYER - AVEMIL

T:

F: (570)748-1813