

OIL ANALYSIS REPORT

Area ELGI AIRLUBE [33976] Machine Id ELGI MPCL16006 - KTN BAYTOWN BLDG 54 Component

Compressor

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear


All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.

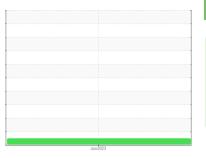

Sample Rating Trend




NORMAL

SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH05905568		
Sample Date		Client Info		26 Jun 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	2		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	5		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>50	0		
Tin	ppm	ASTM D5185m	>15	۰ <1		
Vanadium	ppm	ASTM D5185m	210	0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES	pp	method	limit/base	current	history1	history2
			mmubase			This to Fyz
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		2		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		1		
Phosphorus	ppm	ASTM D5185m		16		
Zinc	ppm	ASTM D5185m		<1		
Sulfur	ppm	ASTM D5185m		45		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	0		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.38		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		
5:42:43) Boy: 1				Contact/Least		

Contact/Location: AARON RIOS - UCAIRDEE



OIL ANALYSIS REPORT

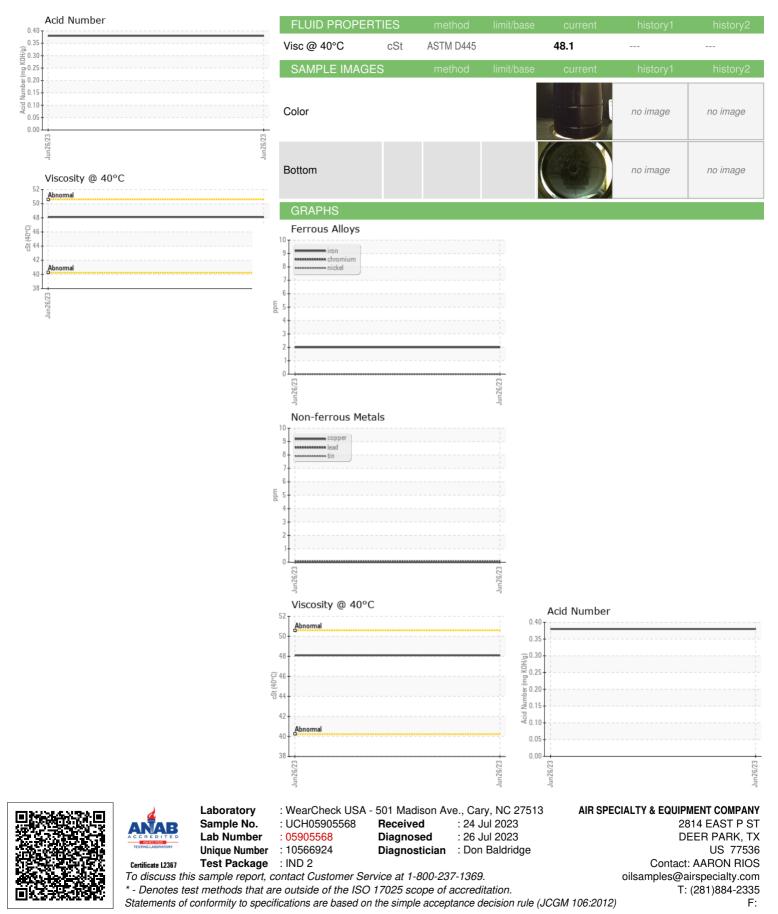

Contact/Location: AARON RIOS - UCAIRDEE