


Area
AIRLUBE UT ELGI 46
Machine Id
ELGI MSDC375868 - SCENIC COLLISION 2
Component
Compressor

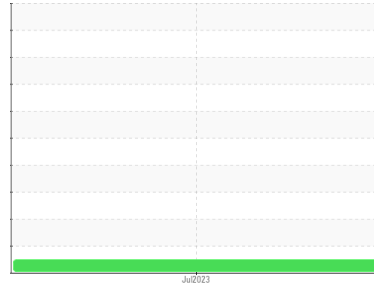

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION method limit/base current history1 history2

Sample Number	Client Info	UCS05905573	---	---
Sample Date	Client Info	11 Jul 2023	---	---
Machine Age	hrs Client Info	26650	---	---
Oil Age	hrs Client Info	5275	---	---
Oil Changed	Client Info	Not Chngd	---	---
Sample Status		NORMAL	---	---

WEAR METALS method limit/base current history1 history2

Iron	ppm	ASTM D5185m	>50	0	---	---
Chromium	ppm	ASTM D5185m	>10	0	---	---
Nickel	ppm	ASTM D5185m		0	---	---
Titanium	ppm	ASTM D5185m		0	---	---
Silver	ppm	ASTM D5185m		0	---	---
Aluminum	ppm	ASTM D5185m	>25	<1	---	---
Lead	ppm	ASTM D5185m	>25	0	---	---
Copper	ppm	ASTM D5185m	>50	0	---	---
Tin	ppm	ASTM D5185m	>15	<1	---	---
Vanadium	ppm	ASTM D5185m		0	---	---
Cadmium	ppm	ASTM D5185m		0	---	---

ADDITIVES method limit/base current history1 history2

Boron	ppm	ASTM D5185m		0	---	---
Barium	ppm	ASTM D5185m		<1	---	---
Molybdenum	ppm	ASTM D5185m		0	---	---
Manganese	ppm	ASTM D5185m		<1	---	---
Magnesium	ppm	ASTM D5185m		<1	---	---
Calcium	ppm	ASTM D5185m		<1	---	---
Phosphorus	ppm	ASTM D5185m		7	---	---
Zinc	ppm	ASTM D5185m		0	---	---
Sulfur	ppm	ASTM D5185m		28	---	---

CONTAMINANTS method limit/base current history1 history2

Silicon	ppm	ASTM D5185m	>25	<1	---	---
Sodium	ppm	ASTM D5185m		<1	---	---
Potassium	ppm	ASTM D5185m	>20	0	---	---



FLUID DEGRADATION method limit/base current history1 history2

Acid Number (AN)	mg KOH/g	ASTM D8045		0.31	---	---
------------------	----------	------------	--	-------------	-----	-----



VISUAL method limit/base current history1 history2

White Metal	scalar	*Visual	NONE	NONE	---	---
Yellow Metal	scalar	*Visual	NONE	NONE	---	---
Precipitate	scalar	*Visual	NONE	NONE	---	---
Silt	scalar	*Visual	NONE	NONE	---	---
Debris	scalar	*Visual	NONE	NONE	---	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---	---
Appearance	scalar	*Visual	NORML	NORML	---	---
Odor	scalar	*Visual	NORML	NORML	---	---
Emulsified Water	scalar	*Visual	>0.1	NEG	---	---
Free Water	scalar	*Visual		NEG	---	---





OIL ANALYSIS REPORT

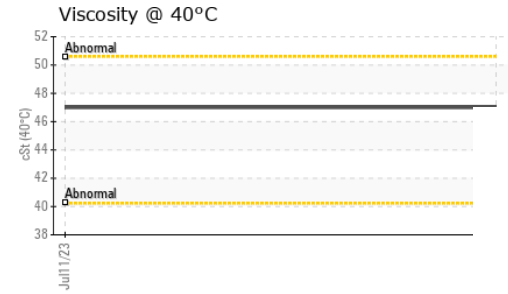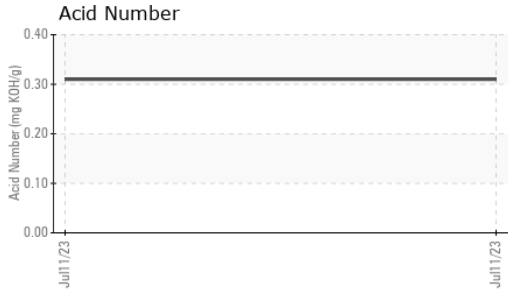

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	47.0	---	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color				no image	no image
Bottom				no image	no image

GRAPHS

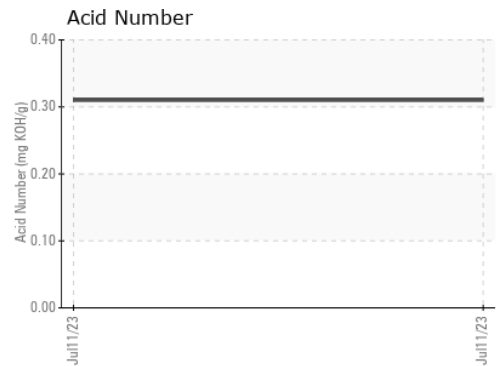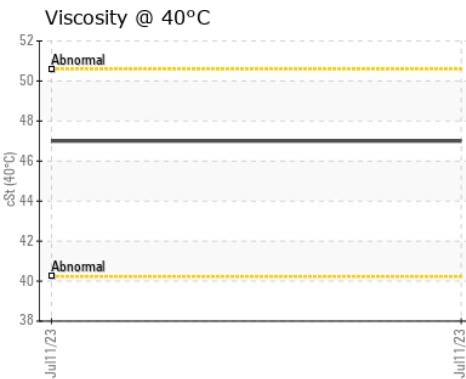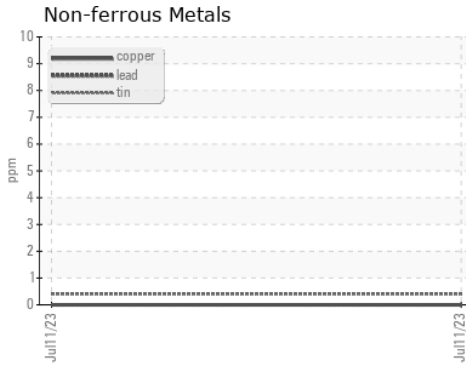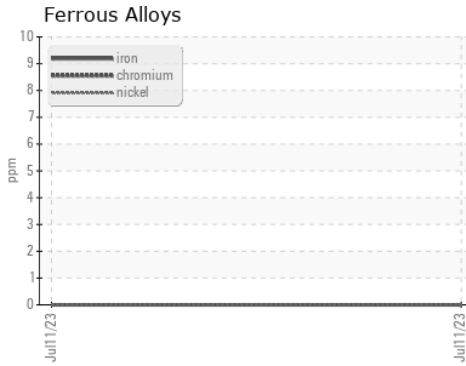

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : UCS05905573 **Received** : 24 Jul 2023
Lab Number : **05905573** **Diagnosed** : 26 Jul 2023
Unique Number : 10566929 **Diagnostician** : Angela Borella
Test Package : IND 2

STANLEY HEATING & AIR
 1002 DOBBINS MILL RD
 ELKIN, NC
 US 28621
 Contact: DARRYL WEDDLE
 darryl@stanleyhvac.com
 T: (336)366-4226
 F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)