



# OIL ANALYSIS REPORT

Sample Rating Trend



**NORMAL**



Machine Id

**G54**

Component

**Transmission (Auto)**

Fluid

**CASTROL TRANSYND 668 (--- GAL)**

## DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.

### Wear

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the fluid.

### Fluid Condition

The condition of the fluid is acceptable for the time in service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			<b>WC0841487</b>	---	---
Sample Date	Client Info			<b>01 Aug 2023</b>	---	---
Machine Age	hrs	Client Info		<b>14290</b>	---	---
Oil Age	hrs	Client Info		<b>3038</b>	---	---
Oil Changed	Client Info			<b>Changed</b>	---	---
Sample Status				<b>NORMAL</b>	---	---

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>160	<b>89</b>	---	---
Chromium	ppm	ASTM D5185m	>5	<b>0</b>	---	---
Nickel	ppm	ASTM D5185m	>5	<b>0</b>	---	---
Titanium	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
Silver	ppm	ASTM D5185m	>5	<b>0</b>	---	---
Aluminum	ppm	ASTM D5185m	>50	<b>41</b>	---	---
Lead	ppm	ASTM D5185m	>50	<b>24</b>	---	---
Copper	ppm	ASTM D5185m	>225	<b>38</b>	---	---
Tin	ppm	ASTM D5185m	>10	<b>4</b>	---	---
Vanadium	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
Cadmium	ppm	ASTM D5185m		<b>0</b>	---	---

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		<b>65</b>	---	---
Barium	ppm	ASTM D5185m		<b>0</b>	---	---
Molybdenum	ppm	ASTM D5185m		<b>1</b>	---	---
Manganese	ppm	ASTM D5185m		<b>1</b>	---	---
Magnesium	ppm	ASTM D5185m		<b>8</b>	---	---
Calcium	ppm	ASTM D5185m		<b>535</b>	---	---
Phosphorus	ppm	ASTM D5185m		<b>392</b>	---	---
Zinc	ppm	ASTM D5185m		<b>27</b>	---	---
Sulfur	ppm	ASTM D5185m		<b>1380</b>	---	---


CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>20	<b>4</b>	---	---
Sodium	ppm	ASTM D5185m		<b>10</b>	---	---
Potassium	ppm	ASTM D5185m	>20	<b>&lt;1</b>	---	---

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---
Precipitate	scalar	*Visual	NONE	<b>NONE</b>	---	---
Silt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Debris	scalar	*Visual	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Appearance	scalar	*Visual	NORML	<b>NORML</b>	---	---
Odor	scalar	*Visual	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	*Visual	>0.1	<b>NEG</b>	---	---
Free Water	scalar	*Visual		<b>NEG</b>	---	---

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	33	<b>25.8</b>	---	---






# OIL ANALYSIS REPORT

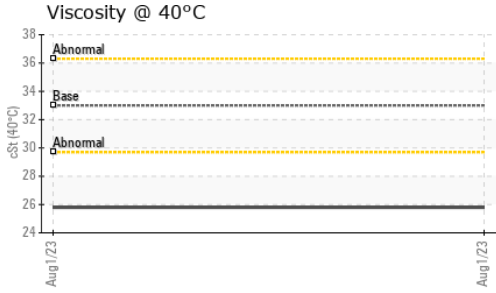

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color			no image	no image	no image
Bottom			no image	no image	no image

## GRAPHS

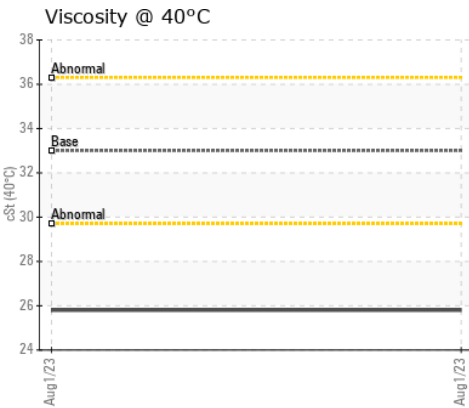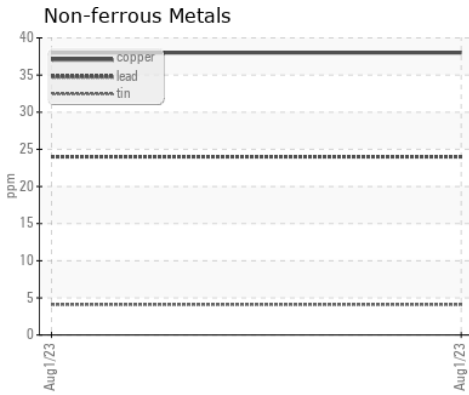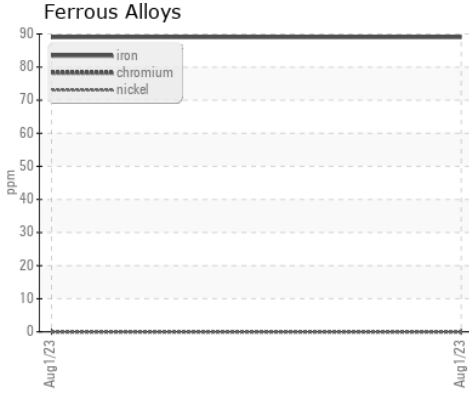

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : WC0841487      **Received** : 10 Aug 2023  
**Lab Number** : **05921881**      **Diagnosed** : 12 Aug 2023  
**Unique Number** : 10601828      **Diagnostician** : Don Baldrige  
**Test Package** : CONST

**Apple Valley Waste - SEW Location**  
 309 Salina Road  
 Sewell, NJ  
 US 08080  
 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:  
F: