




# PROBLEM SUMMARY

Sample Rating Trend

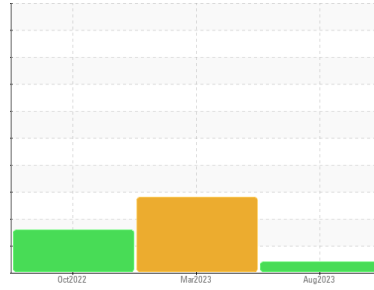

## VIS DEBRIS



Machine Id  
**KAESER SM10T 8363741 (S/N 1250)**  
 Component  
**Compressor**  
 Fluid  
**KAESER SIGMA (OEM) S-460 (--- GAL)**

### COMPONENT CONDITION SUMMARY

No relevant graphs to display

### RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

### PROBLEMATIC TEST RESULTS

Sample Status				ABNORMAL	ABNORMAL	ABNORMAL
Debris	scalar	*Visual	NONE	▲ MODER	▲ MODER	NONE

Customer Id: GENPHI  
 Sample No.: KC109309  
 Lab Number: 05922197  
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:  
 Don Baldrige +1  
[don.b505@comcast.net](mailto:don.b505@comcast.net)

To change component or sample information:  
 Customer Service +1 1-800-237-1369  
[customerservice@wearcheck.com](mailto:customerservice@wearcheck.com)

## RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter	---	---	?	We recommend you service the filters on this component.
Alert	---	---	?	We were unable to perform a particle count due to a high concentration of particles present in this sample.

## HISTORICAL DIAGNOSIS

### 08 Mar 2023 Diag: Doug Bogart

#### WATER



The filter change at the time of sampling has been noted. We were unable to perform a particle count due to a high concentration of particles present in this sample. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition. All component wear rates are normal. There is a light concentration of water present in the oil. Moderate concentration of visible dirt/debris present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

[view report](#)



### 06 Oct 2022 Diag: Don Baldrige

#### ISO



Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


[view report](#)





# OIL ANALYSIS REPORT

Sample Rating Trend

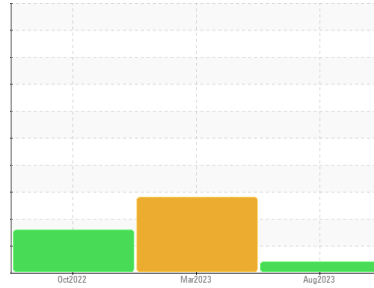

VIS DEBRIS



Machine Id  
**KAESER SM10T 8363741 (S/N 1250)**

Component  
**Compressor**

Fluid  
**KAESER SIGMA (OEM) S-460 (--- GAL)**

## DIAGNOSIS

### Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

### Wear

All component wear rates are normal.

### Contamination

Moderate concentration of visible dirt/debris present in the oil.

### Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			<b>KC109309</b>	KC112238	KC97072
Sample Date	Client Info			<b>08 Aug 2023</b>	08 Mar 2023	06 Oct 2022
Machine Age	hrs	Client Info		<b>9194</b>	6223	3130
Oil Age	hrs	Client Info		<b>6065</b>	2586	3130
Oil Changed	Client Info			<b>N/A</b>	Not Changd	Changed
Sample Status				<b>ABNORMAL</b>	ABNORMAL	ABNORMAL

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	<b>0</b>	<1	<1
Chromium	ppm	ASTM D5185m	>10	<b>0</b>	0	0
Nickel	ppm	ASTM D5185m	>3	<b>0</b>	0	0
Titanium	ppm	ASTM D5185m	>3	<b>0</b>	0	0
Silver	ppm	ASTM D5185m	>2	<b>0</b>	0	0
Aluminum	ppm	ASTM D5185m	>10	<b>1</b>	<1	0
Lead	ppm	ASTM D5185m	>10	<b>0</b>	<1	0
Copper	ppm	ASTM D5185m	>50	<b>24</b>	8	22
Tin	ppm	ASTM D5185m	>10	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185m		<b>&lt;1</b>	<1	0
Cadmium	ppm	ASTM D5185m		<b>0</b>	0	0




ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		<b>0</b>	0	0
Barium	ppm	ASTM D5185m	90	<b>0</b>	18	2
Molybdenum	ppm	ASTM D5185m		<b>0</b>	0	0
Manganese	ppm	ASTM D5185m		<b>&lt;1</b>	<1	0
Magnesium	ppm	ASTM D5185m	90	<b>0</b>	24	2
Calcium	ppm	ASTM D5185m	2	<b>0</b>	1	0
Phosphorus	ppm	ASTM D5185m		<b>1</b>	7	4
Zinc	ppm	ASTM D5185m		<b>0</b>	15	9

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<b>&lt;1</b>	5	<1
Sodium	ppm	ASTM D5185m		<b>&lt;1</b>	<1	0
Potassium	ppm	ASTM D5185m	>20	<b>0</b>	0	<1
Water	%	ASTM D6304	>0.05	<b>0.011</b>	▲ 0.296	0.008
ppm Water	ppm	ASTM D6304	>500	<b>113.4</b>	▲ 2962	83.8

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		---	---	31051
Particles >6µm		ASTM D7647	>1300	---	---	▲ 13109
Particles >14µm		ASTM D7647	>80	---	---	▲ 711
Particles >21µm		ASTM D7647	>20	---	---	▲ 94
Particles >38µm		ASTM D7647	>4	---	---	3
Particles >71µm		ASTM D7647	>3	---	---	0
Oil Cleanliness		ISO 4406 (c)	>--/17/13	---	---	▲ 22/21/17

FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.4	<b>0.39</b>	0.40	0.37


# OIL ANALYSIS REPORT

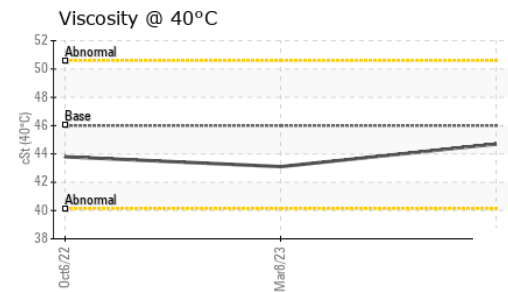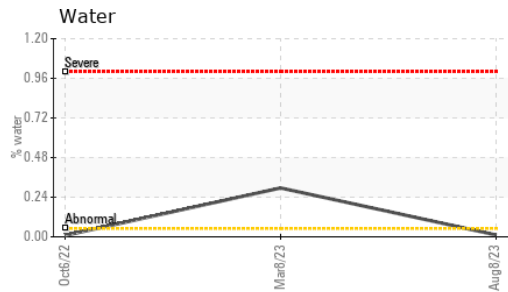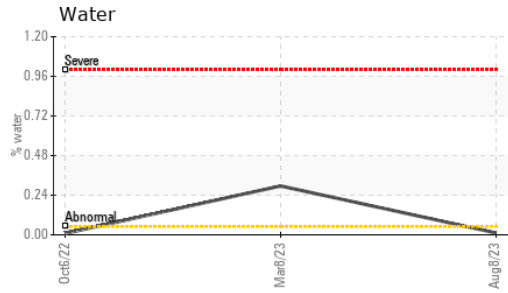





VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	▲ MODER	▲ MODER
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	▲ HAZY	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.05	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	46	44.7	43.1

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

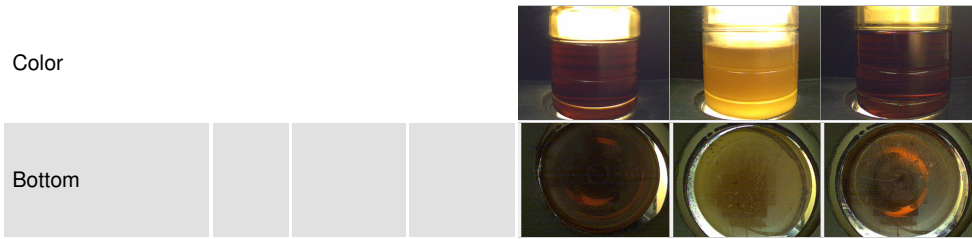

## GRAPHS

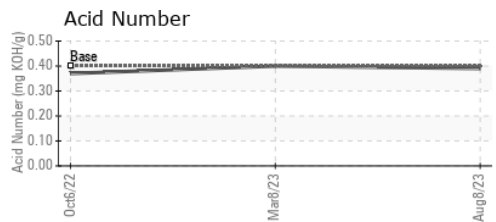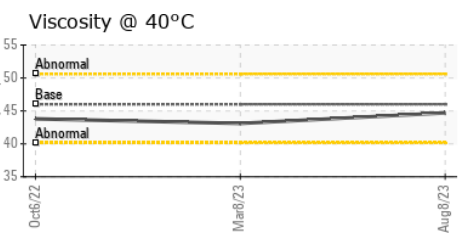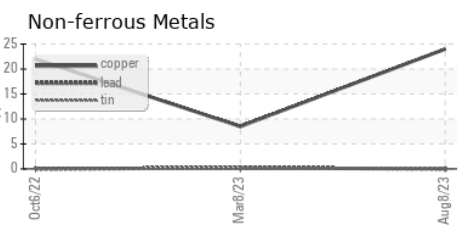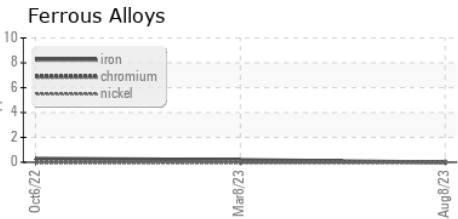

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : KC109309 **Received** : 11 Aug 2023  
**Lab Number** : 05922197 **Diagnosed** : 14 Aug 2023  
**Unique Number** : 10602144 **Diagnostician** : Don Baldrige  
**Test Package** : IND 2

**GENERAL MACHINE KRAFT**  
 45 HOWARD ST  
 PHILLIPSBURG, NJ  
 US 08865  
 Contact:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:  
F: