




PROBLEM SUMMARY

Sample Rating Trend

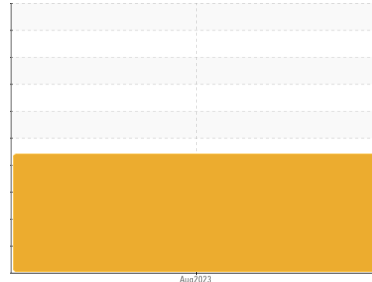


WATER



Machine Id
KAESER 8300221 (S/N 1158)
 Component
Compressor
 Fluid
KAESER SIGMA (OEM) M-460 (--- GAL)

COMPONENT CONDITION SUMMARY

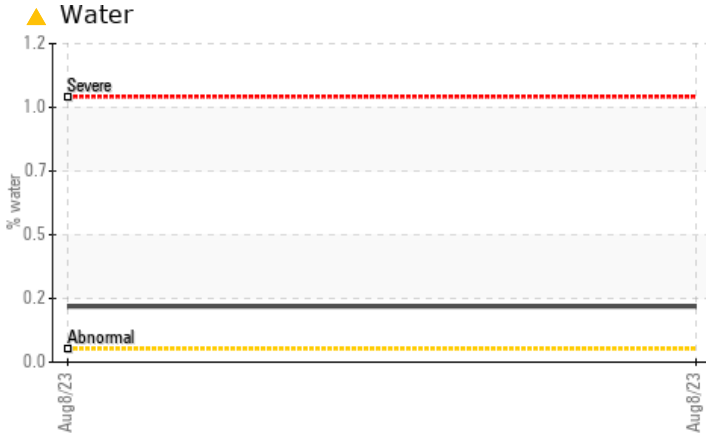

RECOMMENDATION

The filter change at the time of sampling has been noted. We were unable to perform a particle count due to a high concentration of particles present in this sample. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition.

PROBLEMATIC TEST RESULTS

Sample Status				ABNORMAL	---	---
Water	%	ASTM D6304	>0.05	▲ 0.210	---	---
ppm Water	ppm	ASTM D6304	>500	▲ 2100	---	---
Debris	scalar	*Visual	NONE	▲ MODER	---	---
Appearance	scalar	*Visual	NORML	▲ HAZY	---	---
Emulsified Water	scalar	*Visual	>0.05	▲ 0.2%	---	---
Free Water	scalar	*Visual		▲ 1.0	---	---

Customer Id: BELMOK
 Sample No.: KCPA006087
 Lab Number: 05922202
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Don Baldrige +1
don.b505@comcast.net

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com


RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Alert	---	---	?	We were unable to perform a particle count due to a high concentration of particles present in this sample.

HISTORICAL DIAGNOSIS

OIL ANALYSIS REPORT

Sample Rating Trend

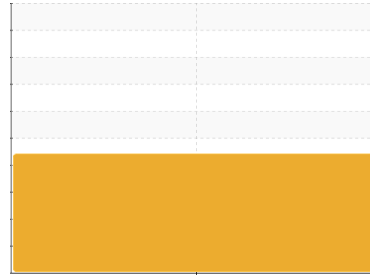

WATER



Machine Id
KAESER 8300221 (S/N 1158)

Component
Compressor

Fluid
KAESER SIGMA (OEM) M-460 (--- GAL)

DIAGNOSIS

▲ Recommendation

The filter change at the time of sampling has been noted. We were unable to perform a particle count due to a high concentration of particles present in this sample. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition.

Wear

All component wear rates are normal.

▲ Contamination

Moderate concentration of visible dirt/debris present in the oil. There is a light concentration of water present in the oil. Free water present.

Fluid Condition

The AN level is acceptable for this fluid.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		KCPA006087	---	---
Sample Date	Client Info		08 Aug 2023	---	---
Machine Age	hrs	Client Info	1414	---	---
Oil Age	hrs	Client Info	0	---	---
Oil Changed	Client Info		N/A	---	---
Sample Status			ABNORMAL	---	---

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >50	2	---	---
Chromium	ppm	ASTM D5185m >10	0	---	---
Nickel	ppm	ASTM D5185m >3	0	---	---
Titanium	ppm	ASTM D5185m >3	0	---	---
Silver	ppm	ASTM D5185m >2	0	---	---
Aluminum	ppm	ASTM D5185m >10	1	---	---
Lead	ppm	ASTM D5185m >10	0	---	---
Copper	ppm	ASTM D5185m >50	6	---	---
Tin	ppm	ASTM D5185m >10	0	---	---
Vanadium	ppm	ASTM D5185m	<1	---	---
Cadmium	ppm	ASTM D5185m	0	---	---

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m 0	0	---	---
Barium	ppm	ASTM D5185m 90	0	---	---
Molybdenum	ppm	ASTM D5185m 0	0	---	---
Manganese	ppm	ASTM D5185m	<1	---	---
Magnesium	ppm	ASTM D5185m 100	3	---	---
Calcium	ppm	ASTM D5185m 0	0	---	---
Phosphorus	ppm	ASTM D5185m 0	1	---	---
Zinc	ppm	ASTM D5185m 0	3	---	---
Sulfur	ppm	ASTM D5185m 23500	20611	---	---




CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >25	<1	---	---
Sodium	ppm	ASTM D5185m	1	---	---
Potassium	ppm	ASTM D5185m >20	0	---	---
Water	%	ASTM D6304 >0.05	▲ 0.210	---	---
ppm Water	ppm	ASTM D6304 >500	▲ 2100	---	---

FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045 1.0	0.19	---	---

OIL ANALYSIS REPORT

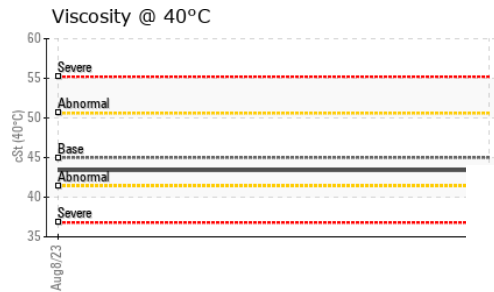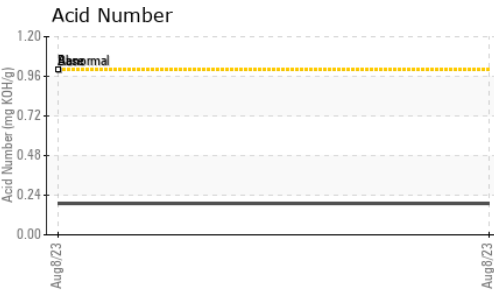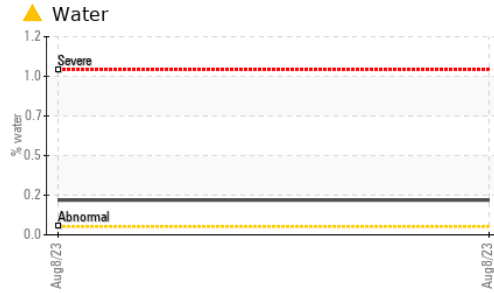





VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	---
Yellow Metal	scalar	*Visual	NONE	NONE	---
Precipitate	scalar	*Visual	NONE	NONE	---
Silt	scalar	*Visual	NONE	NONE	---
Debris	scalar	*Visual	NONE	▲ MODER	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---
Appearance	scalar	*Visual	NORML	▲ HAZY	---
Odor	scalar	*Visual	NORML	NORML	---
Emulsified Water	scalar	*Visual	>0.05	▲ 0.2%	---
Free Water	scalar	*Visual		▲ 1.0	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	45	43.4	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

Color				no image	no image
Bottom				no image	no image

GRAPHS

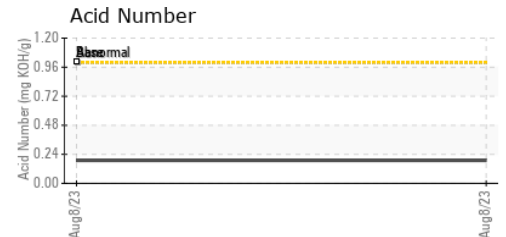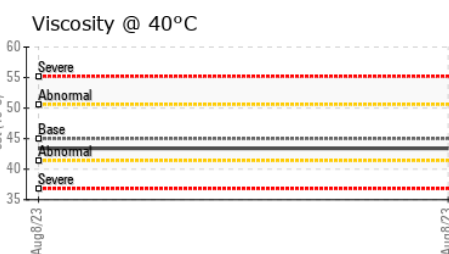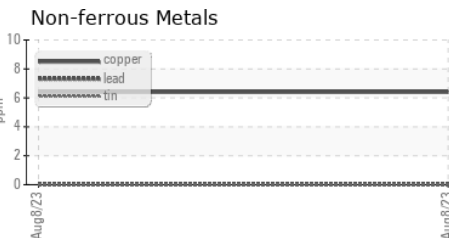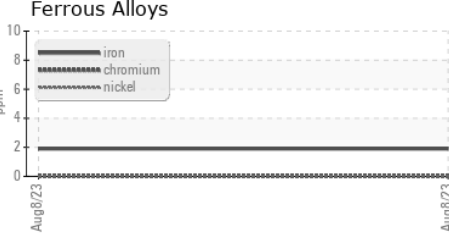

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : KCPA006087 **Received** : 11 Aug 2023
Lab Number : 05922202 **Diagnosed** : 14 Aug 2023
Unique Number : 10602149 **Diagnostician** : Don Baldrige
Test Package : IND 2 (Additional Tests: KF, PrtCount)

BELLE TIRE
 19966 S LAGRANGE RD
 MOKENA, IL
 US 60448
 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:
F: