




# PROBLEM SUMMARY

Sample Rating Trend

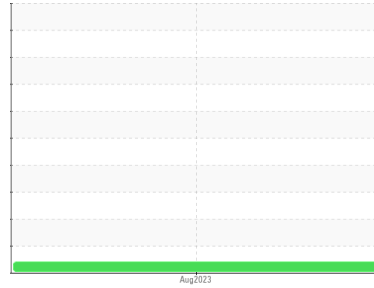

VIS DEBRIS



Machine Id  
**KAESER 8272139 (S/N 1151)**  
Component  
**Compressor**  
Fluid  
**KAESER SIGMA (OEM) M-460 (--- GAL)**

## COMPONENT CONDITION SUMMARY

No relevant graphs to display

## RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

## PROBLEMATIC TEST RESULTS

Sample Status				<b>ABNORMAL</b>	---	---
Debris	scalar	*Visual	NONE	<b>▲ MODER</b>	---	---

**Customer Id:** BELMOK  
**Sample No.:** KCPA006086  
**Lab Number:** 05922203  
**Test Package:** IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:  
Don Baldrige +1  
[don.b505@comcast.net](mailto:don.b505@comcast.net)

To change component or sample information:  
Customer Service +1 1-800-237-1369  
[customerservice@wearcheck.com](mailto:customerservice@wearcheck.com)

## RECOMMENDED ACTIONS


Action	Status	Date	Done By	Description
Alert	---	---	?	We were unable to perform a particle count due to a high concentration of particles present in this sample.

## HISTORICAL DIAGNOSIS



# OIL ANALYSIS REPORT

Sample Rating Trend

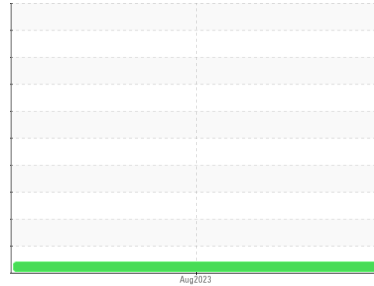

VIS DEBRIS



Machine Id  
**KAESER 8272139 (S/N 1151)**  
 Component  
**Compressor**  
 Fluid  
**KAESER SIGMA (OEM) M-460 (--- GAL)**

## DIAGNOSIS

### ▲ Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

### Wear

All component wear rates are normal.

### ▲ Contamination

Moderate concentration of visible dirt/debris present in the oil.

### Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			<b>KCPA006086</b>	---	---
Sample Date	Client Info			<b>08 Aug 2023</b>	---	---
Machine Age	hrs	Client Info		<b>4329</b>	---	---
Oil Age	hrs	Client Info		<b>0</b>	---	---
Oil Changed	Client Info			<b>N/A</b>	---	---
Sample Status				<b>ABNORMAL</b>	---	---



WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	<b>0</b>	---	---
Chromium	ppm	ASTM D5185m	>10	<b>0</b>	---	---
Nickel	ppm	ASTM D5185m	>3	<b>0</b>	---	---
Titanium	ppm	ASTM D5185m	>3	<b>0</b>	---	---
Silver	ppm	ASTM D5185m	>2	<b>0</b>	---	---
Aluminum	ppm	ASTM D5185m	>10	<b>1</b>	---	---
Lead	ppm	ASTM D5185m	>10	<b>0</b>	---	---
Copper	ppm	ASTM D5185m	>50	<b>12</b>	---	---
Tin	ppm	ASTM D5185m	>10	<b>0</b>	---	---
Vanadium	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
Cadmium	ppm	ASTM D5185m		<b>0</b>	---	---

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	<b>0</b>	---	---
Barium	ppm	ASTM D5185m	90	<b>0</b>	---	---
Molybdenum	ppm	ASTM D5185m	0	<b>0</b>	---	---
Manganese	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
Magnesium	ppm	ASTM D5185m	100	<b>7</b>	---	---
Calcium	ppm	ASTM D5185m	0	<b>0</b>	---	---
Phosphorus	ppm	ASTM D5185m	0	<b>2</b>	---	---
Zinc	ppm	ASTM D5185m	0	<b>20</b>	---	---
Sulfur	ppm	ASTM D5185m	23500	<b>20008</b>	---	---

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<b>1</b>	---	---
Sodium	ppm	ASTM D5185m		<b>4</b>	---	---
Potassium	ppm	ASTM D5185m	>20	<b>0</b>	---	---
Water	%	ASTM D6304	>0.05	<b>0.019</b>	---	---
ppm Water	ppm	ASTM D6304	>500	<b>198.4</b>	---	---

FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	1.0	<b>0.21</b>	---	---

# OIL ANALYSIS REPORT

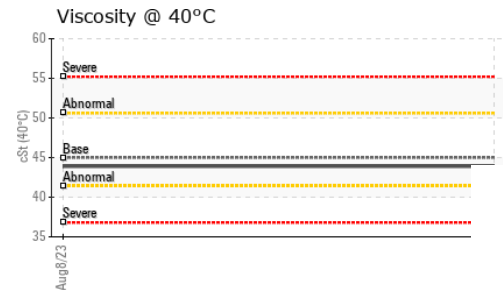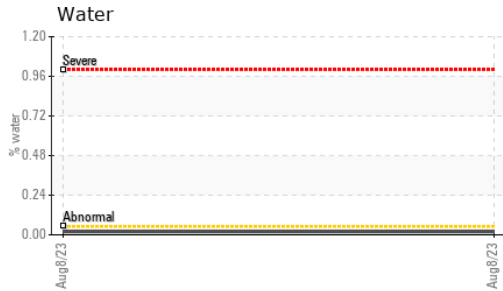





VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	---
Yellow Metal	scalar	*Visual	NONE	NONE	---
Precipitate	scalar	*Visual	NONE	NONE	---
Silt	scalar	*Visual	NONE	NONE	---
Debris	scalar	*Visual	NONE	▲ MODER	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---
Appearance	scalar	*Visual	NORML	NORML	---
Odor	scalar	*Visual	NORML	NORML	---
Emulsified Water	scalar	*Visual	>0.05	NEG	---
Free Water	scalar	*Visual		NEG	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	45	43.9	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

Color				no image	no image
Bottom				no image	no image

## GRAPHS

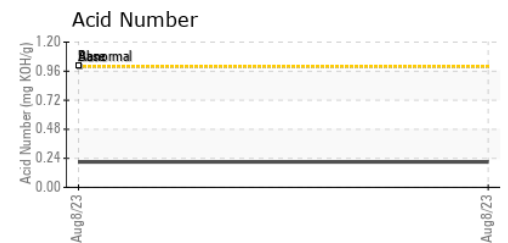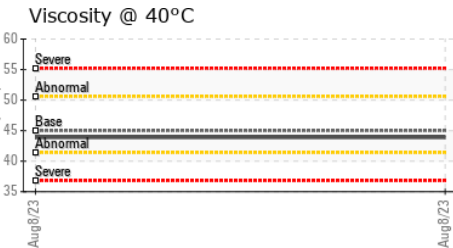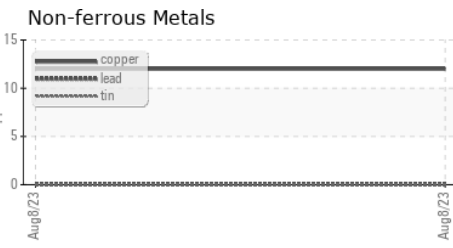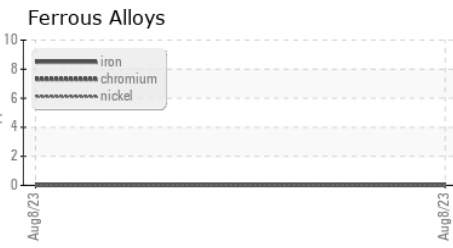

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : KCPA006086 **Received** : 11 Aug 2023  
**Lab Number** : 05922203 **Diagnosed** : 14 Aug 2023  
**Unique Number** : 10602150 **Diagnostician** : Don Baldrige  
**Test Package** : IND 2 ( Additional Tests: KF, PrtCount )

**BELLE TIRE**  
 19966 S LAGRANGE RD  
 MOKENA, IL  
 US 60448  
 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:  
F: