


OIL ANALYSIS REPORT

Sample Rating Trend



NORMAL

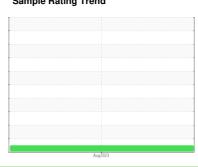

1103B - LINE 3

Component

Gearbox

MOBIL MOBILGEAR 600 XP 220 (5 GAL)

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

Insufficient sample was received to conduct all the routine laboratory tests. There is no indication of any contamination in the oil.


Fluid Condition

The condition of the oil is acceptable for the time in service.

				Aug2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0834167		
Sample Date		Client Info		04 Aug 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	18		
Chromium	ppm	ASTM D5185m	>15	0		
Nickel	ppm	ASTM D5185m	>15	<1		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	1		
Lead	ppm	ASTM D5185m	>100	<1		
Copper	ppm	ASTM D5185m	>200	4		
Tin	ppm	ASTM D5185m	>25	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		9		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		1		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		5		
Phosphorus	ppm	ASTM D5185m		330		
Zinc	ppm	ASTM D5185m		10		
Sulfur	ppm	ASTM D5185m		14436		
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	1		
Sodium	ppm	ASTM D5185m		2		
Potassium	ppm	ASTM D5185m	>20	1		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.2	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPERT	ΓIES	method	limit/base	current	history1	history2



OIL ANALYSIS REPORT

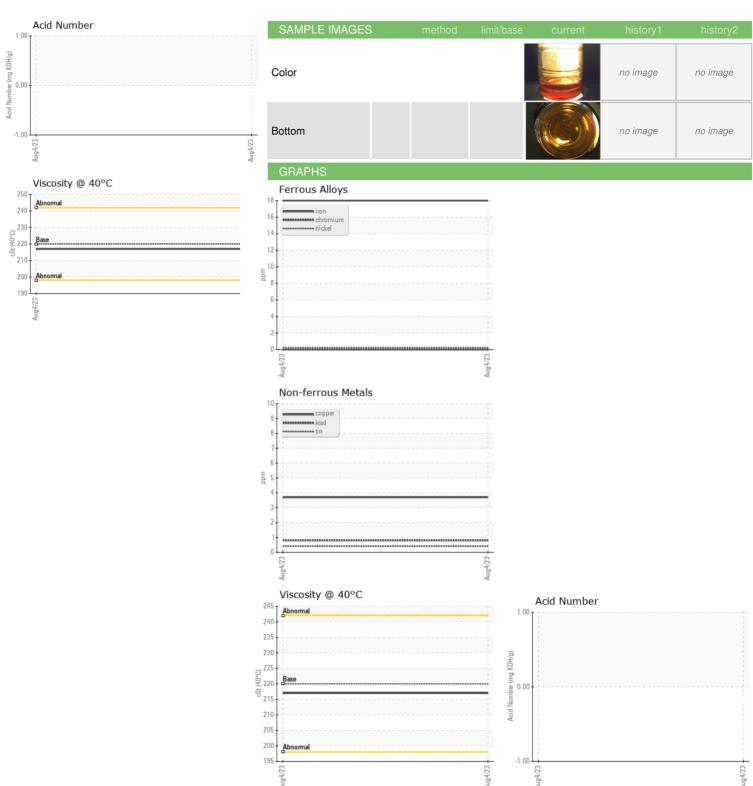





Certificate L2367

Laboratory Sample No. Lab Number Unique Number : 10602298

: WC0834167 : 05922351

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 11 Aug 2023 Diagnosed

: 14 Aug 2023 Diagnostician : Doug Bogart

Test Package : IND 2 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

MANTALINE CORP-MANTUA

4754 EAST HIGH STREET MANTUA, OH US 44255

Contact: BILL STEWART

bstewart@mantaline.com T: x:

F: x: