WEAR	PROBLEM SUMMARY	Sample Rating Trend	VIS DEBRIS
Machine Id MB10382 Component Hydraulic System Fluid PHILLIPS 66 Powerflow	v NZ AW46 (QTS)	Augtorz Judorz	
COMPONENT CONDITION	SUMMARY		

No relevant graphs to display

monitor.

RECOMMENDATION	PROBLEMATIC TEST RESULTS						
We recommend you service the filters on this	Sample Status				ABNORMAL	NORMAL	
component. Resample at the next service interval to	Debris	scalar	*Visual	NONE	🔺 MODER	VLITE	

Customer Id: DTRTAZ Sample No.: WC0799356 Lab Number: 05922613 Test Package: IND 1



To manage this report scan the QR code

To discuss the diagnosis or test data: Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS					
Action	Status	Date	Done By	Description	
Change Filter			?	We recommend you service the filters on this component.	

HISTORICAL DIAGNOSIS

05 Aug 2022 Diag: Don Baldridge

NODMAL



Resample at the next service interval to monitor.All component wear rates are normal. There is no indication of any contamination in the component. The condition of the oil is acceptable for the time in service.





OIL ANALYSIS REPORT

Sample Rating Trend

VIS DEBRIS

Machine Id **MB10382**

Component **Hydraulic System**

PHILLIPS 66 Powerflow NZ AW46 (--- QTS)

DIAGNOSIS

A Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

Moderate concentration of visible dirt/debris present in the oil.

Fluid Condition

The condition of the oil is acceptable for the time in service.


SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0799356	WC0719643	
Sample Date		Client Info		31 Jul 2023	05 Aug 2022	
Machine Age	hrs	Client Info		0	0	
Oil Age	hrs	Client Info		0	0	
Oil Changed		Client Info		N/A	N/A	
Sample Status				ABNORMAL	NORMAL	
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	2	1	
Chromium	ppm	ASTM D5185m	>20	<1	0	
Nickel	ppm	ASTM D5185m	>20	<1	0	
Titanium	ppm	ASTM D5185m		<1	<1	
Silver	ppm	ASTM D5185m		0	0	
Aluminum	ppm	ASTM D5185m	>20	1	1	
Lead	ppm	ASTM D5185m	>20	<1	<1	
Copper	ppm	ASTM D5185m	>20	7	5	
Tin	ppm	ASTM D5185m	>20	0	0	
Vanadium	ppm	ASTM D5185m		0	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	
Barium	ppm	ASTM D5185m		2	1	
Volybdenum	ppm	ASTM D5185m		0	0	
Manganese	ppm	ASTM D5185m		0	0	
Magnesium	ppm	ASTM D5185m		<1	<1	
Calcium	ppm	ASTM D5185m		56	49	
Phosphorus	ppm	ASTM D5185m		389	295	
Zinc	ppm	ASTM D5185m		501	398	
Sulfur	ppm	ASTM D5185m		2072	1501	
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	<1	<1	
Sodium	ppm	ASTM D5185m		<1	0	
Potassium	ppm	ASTM D5185m	>20	0	<1	
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	LIGHT	
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	
Precipitate	scalar	*Visual	NONE	NONE	NONE	
Silt	scalar	*Visual	NONE	NONE	NONE	
Debris	scalar	*Visual	NONE	A MODER	VLITE	
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	
Appearance	scalar	*Visual	NORML	NORML	NORML	
Odor	scalar	*Visual	NORML	NORML	NORML	
Emulsified Water	scalar	*Visual	>0.05	NEG	NEG	
Free Water	scalar	*Visual		NEG	NEG	
FLUID PROPERT	IES	method	limit/base	current	history1	history2
Visc @ 40°C 54:34) Rev: 1	cSt	ASTM D445	46	46.5 ontact/Location	46.6	

Report Id: DTRTAZ [WUSCAR] 05922613 (Generated: 08/14/2023 12:54:34) Rev: 1

Contact/Location: JEREMY COLLINS - DTRTAZ



OIL ANALYSIS REPORT

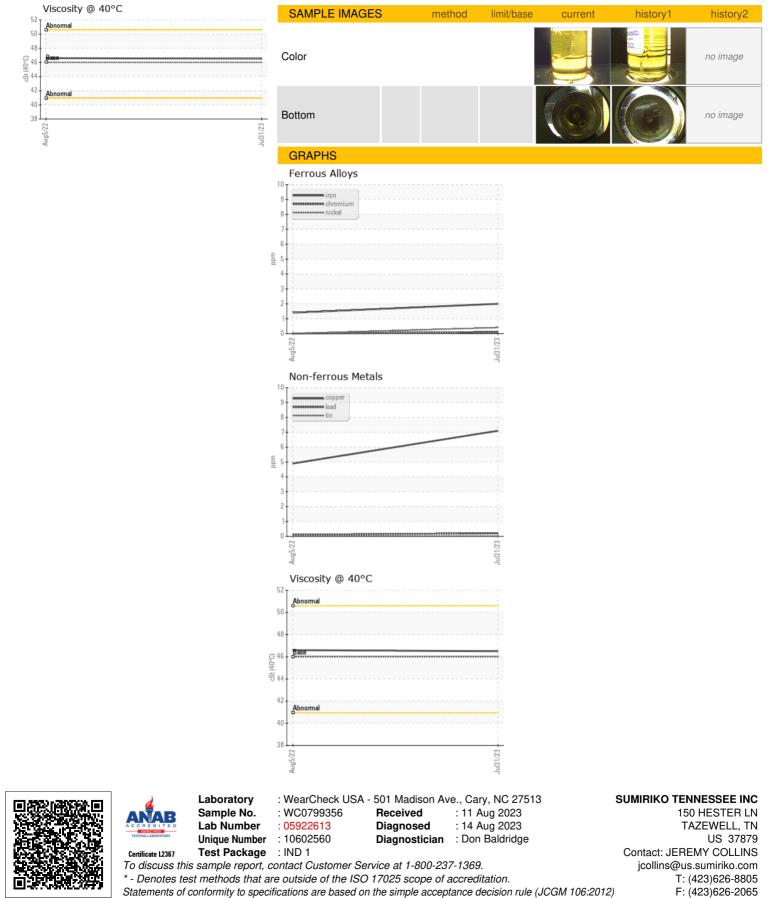

Contact/Location: JEREMY COLLINS - DTRTAZ