

PROBLEM SUMMARY


Built for a lifetime."

Machine Id KAESER SM 15T 2712732 (S/N 1001) Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

COMPONENT CONDITION SUMMARY

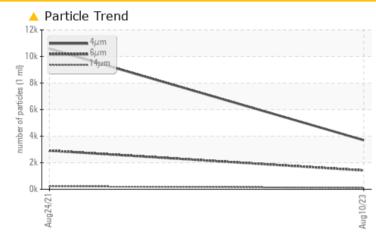

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status		ATTENTION	ABNORMAL	
Particles >6µm	ASTM D7647 >1300	🔺 1418	<u> </u>	
Particles >14µm	ASTM D7647 >80	106	<u> </u>	
Particles >21µm	ASTM D7647 >20	<u> </u>	A 39	
Oil Cleanliness	ISO 4406 (c) >/17/1	3 🔺 19/18/14	1 9/15	


Customer Id: JIMCON Sample No.: KCPA004365 Lab Number: 05924311 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

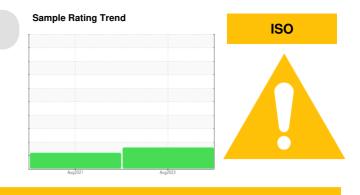

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

24 Aug 2021 Diag: Don Baldridge



No corrective action is recommended at this time. Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





OIL ANALYSIS REPORT

KAESER SM 15T 2712732 (S/N 1001)

Compressor Fluid

KAESER SIGMA (OEM) M-460 (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear


All component wear rates are normal.

Contamination

There is a moderate amount of particulates present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

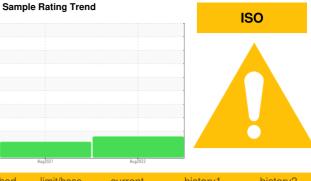

SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA004365	KCP37752	
Sample Date		Client Info		10 Aug 2023	24 Aug 2021	
Machine Age	hrs	Client Info		36209	30533	
Oil Age	hrs	Client Info		0	0	
Oil Changed		Client Info		N/A	Changed	
Sample Status				ATTENTION	ABNORMAL	
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	<1	
Chromium	ppm	ASTM D5185m	>10	0	0	
Nickel	ppm	ASTM D5185m	>3	0	0	
Titanium	ppm	ASTM D5185m	>3	0	0	
Silver	ppm	ASTM D5185m	>2	0	<1	
Aluminum	ppm	ASTM D5185m	>10	0	0	
Lead	ppm	ASTM D5185m	>10	0	<1	
Copper	ppm	ASTM D5185m	>50	9	5	
Tin	ppm	ASTM D5185m	>10	<1	0	
Antimony	ppm	ASTM D5185m			0	
Vanadium	ppm	ASTM D5185m		0	0	
Cadmium	ppm	ASTM D5185m		0	0	
	ррш		11 11 11	-	-	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0	<1	
Barium	ppm	ASTM D5185m	90	0	3	
Molybdenum	ppm	ASTM D5185m	0	0	0	
Manganese	ppm	ASTM D5185m		<1	<1	
Magnesium	ppm	ASTM D5185m	100	2	24	
Calcium	ppm	ASTM D5185m	0	0	0	
Phosphorus	ppm	ASTM D5185m	0	3	5	
Zinc	ppm	ASTM D5185m	0	10	6	
Sulfur	ppm	ASTM D5185m	23500	21849	18645	
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	1	<1	
Sodium	ppm	ASTM D5185m		<1	4	
Potassium	ppm	ASTM D5185m	>20	0	<1	
Water	%	ASTM D6304	>0.05	0.006	0.016	
ppm Water	ppm	ASTM D6304	>500	67.3	162.4	
FLUID CLEANLIN	ESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		3698	10575	
Particles >6µm		ASTM D7647	>1300	<u> </u>	<u> </u>	
Particles >14µm		ASTM D7647	>80	A 106	<u> </u>	
Particles >21µm		ASTM D7647	>20	<u> </u>	A 39	
Particles >38µm		ASTM D7647	>4	1	1	
Particles >71µm		ASTM D7647	>3	0	0	
Oil Cleanliness		ISO 4406 (c)	>/17/13	A 19/18/14	1 9/15	
FLUID DEGRADA	TION	method	limit/base	current	history1	history2

Acid Number (AN)

mg KOH/g ASTM D8045 1.0

0.392 ---

Report Id: JIMCON [WUSCAR] 05924311 (Generated: 08/16/2023 09:25:05) Rev: 1

Contact/Location: ? ? - JIMCON

0.40





Built for a lifetime

OIL ANALYSIS REPORT

limit/base

current

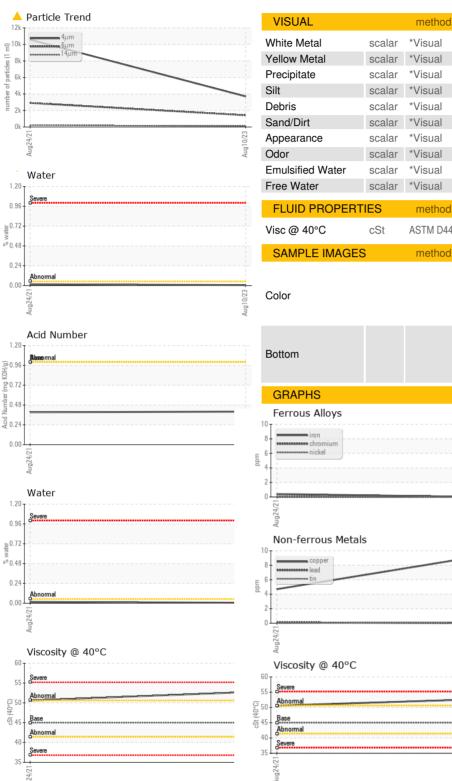

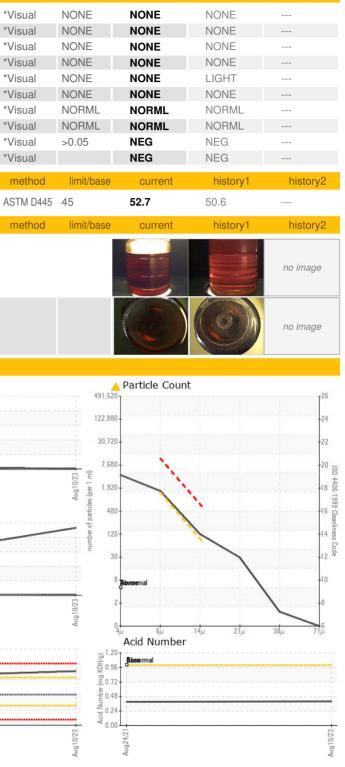

history1

history2



To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Test Package : IND 2 (Additional Tests: KF, PrtCount)

: KCPA004365

: 05924311

: 10604258

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

: 14 Aug 2023

: 16 Aug 2023

Diagnostician : Don Baldridge

Received

Diagnosed

Certificate L2367

Laboratory

Sample No.

Lab Number

Unique Number

JIMS AUTO BODY

CONCORD, CA

US 94520

Contact:

T:

F:

2520 MONUMENT BLVD